

Arboricultural Impact Statement Report

Written as per Australian Standard 4970-2009

**12 Day Street
East Maitland NSW 2323**

Prepared by Mark Bury Consulting

ABN: 53 797 009 569

AQF Level 5 Arborist Hortus Australia National Code 1042

Diploma of Horticulture/Arboriculture Parchment Number 6621

31st January 2006 Course Code RTF50203

International Society of Arboriculture Credential Licence Au-0345AM

10 Arlington Street Gorokan NSW 2263

E-mail mark.bury@bigpond.com

Phone 0400485878

19th June 2023

Contents

1. Synopsis	3
2. Background/Brief.....	3
3. Method of Assessment.....	3
4. Site Analysis.....	4
5. Discussion.....	4
6. Overall Recommendations from Arboricultural assessment and Development impact Statements	10
Appendix 3 - ULE Useful Life Expectancy (Barell 1995)	54
Appendix 4 - Overall Site Map and Tree Location	61
Appendix 5 - Brief Qualifications and Experience of Mark Bury	63
Appendix 6 - Construction Impact Statement	68
Appendix 7 - Arboricultural Management Plan (Tree Protection Plan)	101
Appendix 8 - Bibliography / References.....	147
Appendix 9 - Root Management Systems	177
Appendix 10 - Arborist Report Specification	178
Appendix 11 - Disclaimer	181

1. Synopsis

This report advises and concludes that twenty-eight (28) trees (Tree numbers 1-28) located on the proposed development site cannot be preserved as part of the proposed development for the site to construct a new development.

The proposed development will have significant levels of impact into the root zones of twenty-eight (18) trees (See Appendix 6 Construction Impact Statement) with 50% incursions into the root zones of the trees which will removal of the trees.

This report is based on the plans in appendix 4 supplied for the report by the client Cameron Ashe from Perception Planning

Arboricultural Impact Report on: Twenty-Eight (28) Trees

Tree Inspection: 19th June 2023

Report Prepared: 19th June 2023

Report Commissioned by Cameron Ashe Perception Planning

Legislation:

Maitland City Council DCP

Scope of Works:

To determine the effects of the proposed development (See Appendix 4) at 12 Day Street East Maitland NSW on twenty-eight trees (28) trees on the property as per the surveyor's plan on the site. See Appendix 4 proposed development infrastructure.

2. Background/Brief

2.1 Cameron Ashe has requested an Arboricultural Impact Statement report on twenty-eight (28) trees as per the surveyor's plan located on the property to determine their suitability for retention on the site as part of a proposed development for the site.

2.2 A visual tree inspection (VTA) of the trees was carried out by Mark Bury. The inspection included observing branch structure and condition, any insect or disease damage, inspection of surface roots and observations of the tree canopy. The inspection also involved measuring the height, canopy and diameter at breast height and diameter at base height of the tree. An onsite inspection occurred on 19th June 2023 at the location. No aerial (climbing inspections) was taken as part of the assessment.

2.3 The conclusions and recommendations contained in this assessment are based on the aforementioned inspection and discussions.

3. Method of Assessment

- 3.1 The site was inspected on 19th June 2023. An objective visual inspection was made from the ground of the health and condition of the trees. This assessment has been carried out in reference to the accepted methods of tree assessment by Mattheck and Breloer (VTA) Page 119 of The Body Language of Trees and Strouts and Winter (Page 1) in Diagnosis of ill health in trees A Tree Schedule (Appendix 3) Binoculars were used to inspect the crown of the tree. Trees on the property have been tagged with numbers.
- 3.2 Photographs used in this report are originals taken at the inspection and are not altered in any way. Tree heights are determined with a Silva Clinomaster/Heightmeter™ and canopy spread were determined by visual estimations. Soil compaction was assessed by using an 8mm x 400mm steel spike being pushed by hand vertically into the ground. Soil samples were tested using a pH Meter and confirmed using a Manutec pH Soil Kit. Tree Protection Zones and Structural Root Zones are calculated using the Australian Standard AS 4970-2009 Protection of Trees on Development Sites. From this information conclusions were drawn.
- 3.3 The tree root zones have been inspected and unless stated in this report are stable except for were stated. The trees have not displayed the normal signs of root plate shear failure on the day of this inspection the 19th June 2023. This was a visual inspection only and I have little history of works which involved work in the root zone of the tree which could affect the stability of the tree in the future.

4. Site Analysis

- 4.1 The site is located in East Maitland on the northern side of Day Street East Maitland. The site is a high-density commercial property located on a flat site. The site is considered to be urban bushland. The site is less than 1km to any area of bushland.
- 4.2 The trees are planted on disturbed Patterson River Soils.
- 4.3 These species of trees normally do well in this soil type and are not indigenous to this area of east Maitland. I stress that my inspection of this site was of an ISA Level 2 Inspection and did not involve any climbing or detailed investigation beyond what was visible from accessible points at ground level.

5. Discussion

- 5.1 **Tree 1** (*Eucalyptus paniculata* Grey Ironbark) is a tree in fair condition Appendix 1 gives a description of the trees as per AS-4970-2009 Section 2. Appendix 4 gives the location of the tree on the property.
- 5.2 The tree will be affected by the proposed development (See Appendix 6 Construction Impact Statement). The trees soil environment and hydrological environment will be severely affected by the proposed development. Appropriate tree management in this situation would be the removal and replacement of the tree in a more suitable species and location as part of the landscape plan for the site

- 5.3 **Tree 2** (*Ficus benjamina* Weeping Fig) is a tree in fair condition Appendix 1 gives a description of the trees as per AS-4970-2009 Section 2. Appendix 4 gives the location of the tree on the property.
- 5.4 The tree will be affected by the proposed development (See Appendix 6 Construction Impact Statement). The trees soil environment and hydrological environment will be severely affected by the proposed development. Appropriate tree management in this situation would be the removal and replacement of the tree in a more suitable species and location as part of the landscape plan for the site.
- 5.5 **Tree 3** (*Eucalyptus paniculata* Grey Ironbark) is a tree in fair condition Appendix 1 gives a description of the trees as per AS-4970-2009 Section 2. Appendix 4 gives the location of the tree on the property.
- 5.6 The tree will be affected by the proposed development (See Appendix 6 Construction Impact Statement). The trees soil environment and hydrological environment will be severely affected by the proposed development. Appropriate tree management in this situation would be the removal and replacement of the tree in a more suitable species and location as part of the landscape plan for the site.
- 5.7 **Tree 4** (*Jacaranda mimosifolia* Jacaranda) is a tree in fair condition Appendix 1 gives a description of the trees as per AS-4970-2009 Section 2. Appendix 4 gives the location of the tree on the property.
- 5.8 The tree will be affected by the proposed development (See Appendix 6 Construction Impact Statement). The trees soil environment and hydrological environment will be severely affected by the proposed development. Appropriate tree management in this situation would be the removal and replacement of the tree in a more suitable species and location as part of the landscape plan for the site
- 5.9 **Tree 5** (*Jacaranda mimosifolia* Jacaranda) is a tree in fair condition Appendix 1 gives a description of the trees as per AS-4970-2009 Section 2. Appendix 4 gives the location of the tree on the property.
- 5.10 The tree will be affected by the proposed development (See Appendix 6 Construction Impact Statement). The trees soil environment and hydrological environment will be severely affected by the proposed development. Appropriate tree management in this situation would be the removal and replacement of the tree in a more suitable species and location as part of the landscape plan for the site.
- 5.11 **Tree 6** (*Cinnamomum camphora* Camphor laurel) is a tree in fair condition Appendix 1 gives a description of the trees as per AS-4970-2009 Section 2. Appendix 4 gives the location of the tree on the property.
- 5.12 The tree will be affected by the proposed development (See Appendix 6 Construction Impact Statement). The trees soil environment and hydrological environment will be severely affected by the proposed development. Appropriate tree management in this situation would be the removal and replacement of the tree in a more suitable species and location as part of the

landscape plan for the site.

- 5.13 **Tree 7** (*Cinnamomum camphora* Camphor laurel) is a tree in fair condition Appendix 1 gives a description of the trees as per AS-4970-2009 Section 2. Appendix 4 gives the location of the tree on the property.
- 5.14 The tree will be affected by the proposed development (See Appendix 6 Construction Impact Statement). The trees soil environment and hydrological environment will be severely affected by the proposed development. Appropriate tree management in this situation would be the removal and replacement of the tree in a more suitable species and location as part of the landscape plan for the site
- 5.15 **Tree 8** (*Callistemon viminalis* Weeping Bottlebrush) is a tree in fair condition Appendix 1 gives a description of the trees as per AS-4970-2009 Section 2. Appendix 4 gives the location of the tree on the property.
- 5.16 The tree will be affected by the proposed development (See Appendix 6 Construction Impact Statement). The trees soil environment and hydrological environment will be severely affected by the proposed development. Appropriate tree management in this situation would be the removal and replacement of the tree in a more suitable species and location as part of the landscape plan for the site.
- 5.17 **Tree 9** (*Jacaranda mimosifolia* Jacaranda) is a tree in fair condition Appendix 1 gives a description of the trees as per AS-4970-2009 Section 2. Appendix 4 gives the location of the tree on the property.
- 5.18 The tree will be affected by the proposed development (See Appendix 6 Construction Impact Statement). The trees soil environment and hydrological environment will be severely affected by the proposed development. Appropriate tree management in this situation would be the removal and replacement of the tree in a more suitable species and location as part of the landscape plan for the site.
- 5.19 **Tree 10** (*Eucalyptus paniculata* Grey Gum) is a tree in poor condition Appendix 1 gives a description of the trees as per AS-4970-2009 Section 2. Appendix 4 gives the location of the tree on the property.
- 5.20 The tree will be affected by the proposed development (See Appendix 6 Construction Impact Statement). The trees soil environment and hydrological environment will be severely affected by the proposed development. Appropriate tree management in this situation would be the removal and replacement of the tree in a more suitable species and location as part of the landscape plan for the site
- 5.21 **Tree 11** (*Pittosporum undulatum* Pittosporum) is a tree in fair condition Appendix 1 gives a description of the trees as per AS-4970-2009 Section 2. Appendix 4 gives the location of the tree on the property.
- 5.22 The tree will be affected by the proposed development (See Appendix 6 Construction Impact Statement). The trees soil environment and hydrological environment will be severely affected by the proposed development. Appropriate tree management in this situation would be the removal and

replacement of the tree in a more suitable species and location as part of the landscape plan for the site

- 5.23 **Tree 12** (*Eucalyptus paniculata* Grey Ironbark) is a tree in fair condition Appendix 1 gives a description of the trees as per AS-4970-2009 Section 2. Appendix 4 gives the location of the tree on the property.
- 5.24 The tree will be affected by the proposed development (See Appendix 6 Construction Impact Statement). The trees soil environment and hydrological environment will be severely affected by the proposed development. Appropriate tree management in this situation would be the removal and replacement of the tree in a more suitable species and location as part of the landscape plan for the site
- 5.25 **Tree 13** (*Jacaranda mimosifolia* Jacaranda) is a tree in fair condition Appendix 1 gives a description of the trees as per AS-4970-2009 Section 2. Appendix 4 gives the location of the tree on the property.
- 5.26 The tree will be affected by the proposed development (See Appendix 6 Construction Impact Statement). The trees soil environment and hydrological environment will be severely affected by the proposed development. Appropriate tree management in this situation would be the removal and replacement of the tree in a more suitable species and location as part of the landscape plan for the site
- 5.27 **Tree 14** (*Unknown Species* Non indigenous) is a tree in fair condition Appendix 1 gives a description of the trees as per AS-4970-2009 Section 2. Appendix 4 gives the location of the tree on the property.
- 5.28 The tree will be affected by the proposed development (See Appendix 6 Construction Impact Statement). The trees soil environment and hydrological environment will be severely affected by the proposed development. Appropriate tree management in this situation would be the removal and replacement of the tree in a more suitable species and location as part of the landscape plan for the site
- 5.29 **Tree 15** (*Liquidambar styraciflua* Liquidambar) is a tree in fair condition Appendix 1 gives a description of the trees as per AS-4970-2009 Section 2. Appendix 4 gives the location of the tree on the property.
- 5.30 The tree will be affected by the proposed development (See Appendix 6 Construction Impact Statement). The trees soil environment and hydrological environment will be severely affected by the proposed development. Appropriate tree management in this situation would be the removal and replacement of the tree in a more suitable species and location as part of the landscape plan for the site
- 5.31 **Tree 16** (*Casuarina glauca* Swamp Oak) is a tree in fair condition Appendix 1 gives a description of the trees as per AS-4970-2009 Section 2. Appendix 4 gives the location of the tree on the property.
- 5.32 The tree will be affected by the proposed development (See Appendix 6 Construction Impact Statement). The trees soil environment and hydrological environment will be severely affected by the proposed development.

Appropriate tree management in this situation would be the removal and replacement of the tree in a more suitable species and location as part of the landscape plan for the site

- 5.33 **Tree 17** (*Schinus areira* Peppercorn) is a tree in fair condition Appendix 1 gives a description of the trees as per AS-4970-2009 Section 2. Appendix 4 gives the location of the tree on the property.
- 5.34 The tree will be affected by the proposed development (See Appendix 6 Construction Impact Statement). The trees soil environment and hydrological environment will be severely affected by the proposed development. Appropriate tree management in this situation would be the removal and replacement of the tree in a more suitable species and location as part of the landscape plan for the site
- 5.35 **Tree 18** (*Liquidambar styraciflua* Liquidambar) is a tree in fair condition Appendix 1 gives a description of the trees as per AS-4970-2009 Section 2. Appendix 4 gives the location of the tree on the property.
- 5.36 The tree will be affected by the proposed development (See Appendix 6 Construction Impact Statement). The trees soil environment and hydrological environment will be severely affected by the proposed development. Appropriate tree management in this situation would be the removal and replacement of the tree in a more suitable species and location as part of the landscape plan for the site
- 5.37 **Tree 19** (*Melia azedarach* China Berry) is a tree in fair condition Appendix 1 gives a description of the trees as per AS-4970-2009 Section 2. Appendix 4 gives the location of the tree on the property.
- 5.38 The tree will be affected by the proposed development (See Appendix 6 Construction Impact Statement). The trees soil environment and hydrological environment will be severely affected by the proposed development. Appropriate tree management in this situation would be the removal and replacement of the tree in a more suitable species and location as part of the landscape plan for the site
- 5.39 **Tree 20** (*Melaleuca bracteata* Revolution Green) is a tree in fair condition Appendix 1 gives a description of the trees as per AS-4970-2009 Section 2. Appendix 4 gives the location of the tree on the property.
- 5.40 The tree will be affected by the proposed development (See Appendix 6 Construction Impact Statement). The trees soil environment and hydrological environment will be severely affected by the proposed development. Appropriate tree management in this situation would be the removal and replacement of the tree in a more suitable species and location as part of the landscape plan for the site
- 5.41 **Tree 21** (*Liquidambar styraciflua* Liquidambar) is a tree in fair condition Appendix 1 gives a description of the trees as per AS-4970-2009 Section 2. Appendix 4 gives the location of the tree on the property.
- 5.42 The tree will be affected by the proposed development (See Appendix 6 Construction Impact Statement). The trees soil environment and hydrological

environment will be severely affected by the proposed development. Appropriate tree management in this situation would be the removal and replacement of the tree in a more suitable species and location as part of the landscape plan for the site

- 5.43 **Tree 22** (*Archontophoenix cunninghamiana* Bangalow Palm) is a tree in fair condition Appendix 1 gives a description of the trees as per AS-4970-2009 Section 2. Appendix 4 gives the location of the tree on the property.
- 5.44 The tree will be affected by the proposed development (See Appendix 6 Construction Impact Statement). The trees soil environment and hydrological environment will be severely affected by the proposed development. Appropriate tree management in this situation would be the removal and replacement of the tree in a more suitable species and location as part of the landscape plan for the site
- 5.45 **Tree 23** (*Eucalyptus nicholii* Small Leaved Peppermint) is a tree in fair condition Appendix 1 gives a description of the trees as per AS-4970-2009 Section 2. Appendix 4 gives the location of the tree on the property.
- 5.46 The tree will be affected by the proposed development (See Appendix 6 Construction Impact Statement). The trees soil environment and hydrological environment will be severely affected by the proposed development. Appropriate tree management in this situation would be the removal and replacement of the tree in a more suitable species and location as part of the landscape plan for the site
- 5.47 **Tree 24** (*Callistemon viminalis* Weeping Bottlebrush) is a tree in fair condition Appendix 1 gives a description of the trees as per AS-4970-2009 Section 2. Appendix 4 gives the location of the tree on the property.
- 5.48 The tree will be affected by the proposed development (See Appendix 6 Construction Impact Statement). The trees soil environment and hydrological environment will be severely affected by the proposed development. Appropriate tree management in this situation would be the removal and replacement of the tree in a more suitable species and location as part of the landscape plan for the site
- 5.49 **Tree 25** (*Jacaranda mimosifolia* Jacaranda) is a tree in fair condition Appendix 1 gives a description of the trees as per AS-4970-2009 Section 2. Appendix 4 gives the location of the tree on the property.
- 5.50 The tree will be affected by the proposed development (See Appendix 6 Construction Impact Statement). The trees soil environment and hydrological environment will be severely affected by the proposed development. Appropriate tree management in this situation would be the removal and replacement of the tree in a more suitable species and location as part of the landscape plan for the site
- 5.51 **Tree 26** (*Harpephyllum caffrum* Kaffir Plum) is a tree in fair condition Appendix 1 gives a description of the trees as per AS-4970-2009 Section 2. Appendix 4 gives the location of the tree on the property.
- 5.52 The tree will be affected by the proposed development (See Appendix 6

Construction Impact Statement). The trees soil environment and hydrological environment will be severely affected by the proposed development. Appropriate tree management in this situation would be the removal and replacement of the tree in a more suitable species and location as part of the landscape plan for the site

- 5.53 **Tree 27** (*Grevillea robusta* Silky Oak) is a tree in fair condition Appendix 1 gives a description of the trees as per AS-4970-2009 Section 2. Appendix 4 gives the location of the tree on the property.
- 5.54 The tree will be affected by the proposed development (See Appendix 6 Construction Impact Statement). The trees soil environment and hydrological environment will be severely affected by the proposed development. Appropriate tree management in this situation would be the removal and replacement of the tree in a more suitable species and location as part of the landscape plan for the site
- 5.55 **Tree 28** (*Morus nigra* Mulberry Tree) is a tree in fair condition Appendix 1 gives a description of the trees as per AS-4970-2009 Section 2. Appendix 4 gives the location of the tree on the property.
- 5.56 The tree will be affected by the proposed development (See Appendix 6 Construction Impact Statement). The trees soil environment and hydrological environment will be severely affected by the proposed development. Appropriate tree management in this situation would be the removal and replacement of the tree in a more suitable species and location as part of the landscape plan for the site

6. Overall Recommendations from Arboricultural assessment and Development impact Statements

- 6.1 Trees 1-28 will be impacted by the proposed development and mitigation works as suggested above should be carried out.
- 6.2 All mitigation works as advised above are to be carried out so that the proposed works can be carried out.
- 6.3 If any trees are considered by Council to be preserved an AQF 5 Arborist should be on site during all future excavation works near the tree. Furthermore, the site arborist should carry out regular inspections to ensure compliance with Appendix 6 AIS.
- 6.4 This will include compliance certifications being issued before construction commences that all tree protection measures are installed, that an AQF Level 5 Arborist is present during excavations to ensure roots are not damaged before further works can be commenced and a compliance certificate is issued prior to further works being carried out and a compliance certificate being issued when the development has been completed before the development can be occupied.
- 6.5 That all tree pruning works if required are carried out as per the Australian Standard AS 4373-2007 Pruning of amenity trees and as per the Code of Practice Amenity Tree Industry August 1998. Works specified in Appendix 7 Arboricultural Impact Statement are to be followed.

- 6.6 That tree works is to be carried out, by a suitably qualified arborist with adequate Public Liability Coverage. The Tree Contractors Association of NSW recommends 20 Million Dollars coverage
- 6.7 That tree works is to be carried out, by a suitably qualified arborist with adequate Public Liability Coverage. The Tree Contractors Association of NSW recommends 20 Million Dollars coverage.

Prepared by Mark Bury
Principal Consultant
Mark Bury Consulting

ABN: 53 797 009 569AQF Level 5 Arborist Hortus Australia
National Code 1042 Diploma of Horticulture/Arboriculture
Parchment Number 6621 31st January 2006 Course Code
RTF50203
International Society of Arboriculture Certified Arborist and
Municipal Arborist Licence Number AU-0345AM

Appendix 1 - Tree Schedule

Tree Number	1
Species	<i>Eucalyptus paniculata</i>
Common Name	Grey Ironbark
Vigour	Normal Vigour- Ability of a tree to maintain and sustain its life processes. This may be evident by the typical growth of leaves, crown cover and crown density, branches, roots and trunk and resistance to predation. This is independent of the condition of a tree but may impact upon it , and especially the ability of a tree but may impact upon it , and especially the ability of a tree to sustain itself against predation
Condition	Fair Condition - tree is of good habit or misshapen, a form not severely restricted for space and light has some physical indication of decline due to the early effects of predation by pests and diseases, fungal, bacterial, or insect infestation, or has suffered physical injury to itself that may be contributing to instability or structural weaknesses, or its basic survival. Such a tree may recover with remedial works where appropriate, or without intervention may stabilise or improve over time where appropriate, or without intervention may stabilise or improve over time, or in response to the implementation of beneficial changes to its local environment. This may be independent from, or contributed to by vigour.
Height (M)	25
Crown Spread and (M)	10
Diameter at Brest Height (MM) Tree Root Zone (M)	700 8.4
Diameter at Base Height (MM) Structural Root Zone (M)	850 3.1
Age Class	Mature- Tree aged 20-80% of life expectancy
Estimated Life Expectancy Sule Landscape Significance Overall Significance See Attachment 3	3b- Trees that may live for more than 15 years but would be removed for safety or nuisance reasons. Overall Significance. Medium –Tree not suitable for Preservation See Appendix 3 SULE and Significance of a Tree Assessment Rating System IACA Australia SULE and Significance of a Tree Assessment Rating System IACA Australia
Heritage/Cultural	Tree does not have a Heritage or Cultural Significance
Ecological and Habitat Matters	Tree has no Ecological or Habitat matters
Location to Site Features	The tree will be required to be removed for the development to be constructed on the site; There is a 50% incursion into the root zone by the proposed development. See Appendix 6
Tree Comments	Tree to be removed as per the demolition plan in appendix 7

Tree Number	2
Species	<i>Ficus benjamina</i>
Common Name	Weeping Fig
Vigour	Normal Vigour- Ability of a tree to maintain and sustain its life processes. This may be evident by the typical growth of leaves, crown cover and crown density, branches, roots and trunk and resistance to predation. This is independent of the condition of a tree but may impact upon it , and especially the ability of a tree but may impact upon it , and especially the ability of a tree to sustain itself against predation
Condition	Fair Condition - tree is of good habit or misshapen, a form not severely restricted for space and light has some physical indication of decline due to the early effects of predation by pests and diseases, fungal, bacterial, or insect infestation, or has suffered physical injury to itself that may be contributing to instability or structural weaknesses, or its basic survival. Such a tree may recover with remedial works where appropriate, or without intervention may stabilise or improve over time where appropriate, or without intervention may stabilise or improve over time, or in response to the implementation of beneficial changes to its local environment. This may be independent from, or contributed to by vigour.
Height (M)	20
Crown Spread and (M)	15
Diameter at Breast Height (MM) Tree Root Zone (M)	850 10.2
Diameter at Base Height (MM) Structural Root Zone (M)	980 3.3
Age Class	Mature- Tree aged 20-80% of life expectancy
Estimated Life Expectancy Sule Landscape Significance Overall Significance See Attachment 3	3b- Trees that may live for more than 15 years but would be removed for safety or nuisance reasons. Overall Significance. Medium –Tree not suitable for Preservation See Appendix 3 SULE and Significance of a Tree Assessment Rating System IACA Australia SULE and Significance of a Tree Assessment Rating System IACA Australia
Heritage/Cultural	Tree does not have a Heritage or Cultural Significance
Ecological and Habitat Matters	Tree has no Ecological or Habitat matters
Location to Site Features	The tree will be required to be removed for the development to be constructed on the site; There is a 50% incursion into the root zone by the proposed development. See Appendix 6
Tree Comments	Tree to be removed as per the demolition plan in appendix 7

Tree Number	3
Species	<i>Eucalyptus paniculata</i>
Common Name	Grey Ironbark
Vigour	Normal Vigour- Ability of a tree to maintain and sustain its life processes. This may be evident by the typical growth of leaves, crown cover and crown density, branches, roots and trunk and resistance to predation. This is independent of the condition of a tree but may impact upon it , and especially the ability of a tree but may impact upon it , and especially the ability of a tree to sustain itself against predation
Condition	Fair Condition - tree is of good habit or misshapen, a form not severely restricted for space and light has some physical indication of decline due to the early effects of predation by pests and diseases, fungal, bacterial, or insect infestation, or has suffered physical injury to itself that may be contributing to instability or structural weaknesses, or its basic survival. Such a tree may recover with remedial works where appropriate, or without intervention may stabilise or improve over time where appropriate, or without intervention may stabilise or improve over time, or in response to the implementation of beneficial changes to its local environment. This may be independent from, or contributed to by vigour.
Height (M)	20
Crown Spread and (M)	18
Diameter at Brest Height (MM) Tree Root Zone (M)	900 10.8
Diameter at Base Height (MM) Structural Root Zone (M)	1100 3.2
Age Class	Mature- Tree aged 20-80% of life expectancy
Estimated Life Expectancy Sule Landscape Significance Overall Significance See Attachment 3	3b- Trees that may live for more than 15 years but would be removed for safety or nuisance reasons. Overall Significance. Medium –Tree not suitable for Preservation See Appendix 3 SULE and Significance of a Tree Assessment Rating System IACA Australia SULE and Significance of a Tree Assessment Rating System IACA Australia
Heritage/Cultural	Tree does not have a Heritage or Cultural Significance
Ecological and Habitat Matters	Tree has no Ecological or Habitat matters
Location to Site Features	The tree will be required to be removed for the development to be constructed on the site; There is a 50% incursion into the root zone by the proposed development. See Appendix 6
Tree Comments	Tree to be removed as per the demolition plan in appendix 7

Tree Number	4
Species	<i>Jacaranda mimosifolia</i>
Common Name	Jacaranda
Vigour	Normal Vigour- Ability of a tree to maintain and sustain its life processes. This may be evident by the typical growth of leaves, crown cover and crown density, branches, roots and trunk and resistance to predation. This is independent of the condition of a tree but may impact upon it , and especially the ability of a tree but may impact upon it , and especially the ability of a tree to sustain itself against predation
Condition	Fair Condition - tree is of good habit or misshapen, a form not severely restricted for space and light has some physical indication of decline due to the early effects of predation by pests and diseases, fungal, bacterial, or insect infestation, or has suffered physical injury to itself that may be contributing to instability or structural weaknesses, or its basic survival. Such a tree may recover with remedial works where appropriate, or without intervention may stabilise or improve over time where appropriate, or without intervention may stabilise or improve over time, or in response to the implementation of beneficial changes to its local environment. This may be independent from, or contributed to by vigour.
Height (M)	20
Crown Spread and (M)	10
Diameter at Brest Height (MM) Tree Root Zone (M)	600 7.2
Diameter at Base Height (MM) Structural Root Zone (M)	660 2.7
Age Class	Mature- Tree aged 20-80% of life expectancy
Estimated Life Expectancy Sule Landscape Significance Overall Significance See Attachment 3	3b- Trees that may live for more than 15 years but would be removed for safety or nuisance reasons. Overall Significance. Medium –Tree not suitable for Preservation See Appendix 3 SULE and Significance of a Tree Assessment Rating System IACA Australia SULE and Significance of a Tree Assessment Rating System IACA Australia
Heritage/Cultural	Tree does not have a Heritage or Cultural Significance
Ecological and Habitat Matters	Tree has no Ecological or Habitat matters
Location to Site Features	The tree will be required to be removed for the development to be constructed on the site; There is a 50% incursion into the root zone by the proposed development. See Appendix 6
Tree Comments	Tree to be removed as per the demolition plan in appendix 7

Tree Number	5
Species	<i>Jacaranda mimosifolia</i>
Common Name	Jacaranda
Vigour	Normal Vigour- Ability of a tree to maintain and sustain its life processes. This may be evident by the typical growth of leaves, crown cover and crown density, branches, roots and trunk and resistance to predation. This is independent of the condition of a tree but may impact upon it , and especially the ability of a tree but may impact upon it , and especially the ability of a tree to sustain itself against predation
Condition e	Fair Condition - tree is of good habit or misshapen, a form not severely restricted for space and light has some physical indication of decline due to the early effects of predation by pests and diseases, fungal, bacterial, or insect infestation, or has suffered physical injury to itself that may be contributing to instability or structural weaknesses, or its basic survival. Such a tree may recover with remedial works where appropriate, or without intervention may stabilise or improve over time where appropriate, or without intervention may stabilise or improve over time, or in response to the implementation of beneficial changes to its local environment. This may be independent from, or contributed to by vigour.
Height (M)	20
Crown Spread and (M)	10
Diameter at Brest Height (MM) Tree Root Zone (M)	730 8.8
Diameter at Base Height (MM) Structural Root Zone (M)	810 3
Age Class	Mature- Tree aged 20-80% of life expectancy
Estimated Life Expectancy Sule Landscape Significance Overall Significance See Attachment 3	3b- Trees that may live for more than 15 years but would be removed for safety or nuisance reasons. Overall Significance. Medium –Tree not suitable for Preservation See Appendix 3 SULE and Significance of a Tree Assessment Rating System IACA Australia SULE and Significance of a Tree Assessment Rating System IACA Australia
Heritage/Cultural	Tree does not have a Heritage or Cultural Significance
Ecological and Habitat Matters	Tree has no Ecological or Habitat matters
Location to Site Features	The tree will be required to be removed for the development to be constructed on the site; There is a 50% incursion into the root zone by the proposed development. See Appendix 6
Tree Comments	Tree to be removed as per the demolition plan in appendix 7

Tree Number	6
Species	<i>Cinnamomum camphora</i>
Common Name	Camphorlaurel
Vigour	Normal Vigour- Ability of a tree to maintain and sustain its life processes. This may be evident by the typical growth of leaves, crown cover and crown density, branches, roots and trunk and resistance to predation. This is independent of the condition of a tree but may impact upon it , and especially the ability of a tree but may impact upon it , and especially the ability of a tree to sustain itself against predation
Condition	Fair Condition - tree is of good habit or misshapen, a form not severely restricted for space and light has some physical indication of decline due to the early effects of predation by pests and diseases, fungal, bacterial, or insect infestation, or has suffered physical injury to itself that may be contributing to instability or structural weaknesses, or its basic survival. Such a tree may recover with remedial works where appropriate, or without intervention may stabilise or improve over time where appropriate, or without intervention may stabilise or improve over time, or in response to the implementation of beneficial changes to its local environment. This may be independent from, or contributed to by vigour.
Height (M)	20
Crown Spread and (M)	10
Diameter at Brest Height (MM) Tree Root Zone (M)	750 9
Diameter at Base Height (MM) Structural Root Zone (M)	890 3.2
Age Class	Mature- Tree aged 20-80% of life expectancy
Estimated Life Expectancy Sule Landscape Significance Overall Significance See Attachment 3	3b- Trees that may live for more than 15 years but would be removed for safety or nuisance reasons. Overall Significance. Medium –Tree not suitable for Preservation See Appendix 3 SULE and Significance of a Tree Assessment Rating System IACA Australia SULE and Significance of a Tree Assessment Rating System IACA Australia
Heritage/Cultural	Tree does not have a Heritage or Cultural Significance
Ecological and Habitat Matters	Tree has no Ecological or Habitat matters
Location to Site Features	The tree will be required to be removed for the development to be constructed on the site; There is a 50% incursion into the root zone by the proposed development. See Appendix 6
Tree Comments	Tree to be removed as per the demolition plan in appendix 7

Tree Number	7
Species	<i>Cinnamomum camphora</i>
Common Name	Camphorlaurel
Vigour	Normal Vigour- Ability of a tree to maintain and sustain its life processes. This may be evident by the typical growth of leaves, crown cover and crown density, branches, roots and trunk and resistance to predation. This is independent of the condition of a tree but may impact upon it , and especially the ability of a tree but may impact upon it , and especially the ability of a tree to sustain itself against predation
Condition	Fair Condition - tree is of good habit or misshapen, a form not severely restricted for space and light has some physical indication of decline due to the early effects of predation by pests and diseases, fungal, bacterial, or insect infestation, or has suffered physical injury to itself that may be contributing to instability or structural weaknesses, or its basic survival. Such a tree may recover with remedial works where appropriate, or without intervention may stabilise or improve over time where appropriate, or without intervention may stabilise or improve over time, or in response to the implementation of beneficial changes to its local environment. This may be independent from, or contributed to by vigour.
Height (M)	20
Crown Spread and (M)	10
Diameter at Brest Height (MM) Tree Root Zone (M)	700 8.4
Diameter at Base Height (MM) Structural Root Zone (M)	840 3.1
Age Class	Mature- Tree aged 20-80% of life expectancy
Estimated Life Expectancy Sule Landscape Significance Overall Significance See Attachment 3	3b- Trees that may live for more than 15 years but would be removed for safety or nuisance reasons. Overall Significance. Medium –Tree not suitable for Preservation See Appendix 3 SULE and Significance of a Tree Assessment Rating System IACA Australia SULE and Significance of a Tree Assessment Rating System IACA Australia
Heritage/Cultural	Tree does not have a Heritage or Cultural Significance
Ecological and Habitat Matters	Tree has no Ecological or Habitat matters
Location to Site Features	The tree will be required to be removed for the development to be constructed on the site; There is a 50% incursion into the root zone by the proposed development. See Appendix 6
Tree Comments	Tree to be removed as per the demolition plan in appendix 7

Tree Number	8
Species	<i>Callistemon viminalis</i>
Common Name	Weeping Bottlebrush
Vigour	Normal Vigour- Ability of a tree to maintain and sustain its life processes. This may be evident by the typical growth of leaves, crown cover and crown density, branches, roots and trunk and resistance to predation. This is independent of the condition of a tree but may impact upon it , and especially the ability of a tree but may impact upon it , and especially the ability of a tree to sustain itself against predation
Condition	Fair Condition - tree is of good habit or misshapen, a form not severely restricted for space and light has some physical indication of decline due to the early effects of predation by pests and diseases, fungal, bacterial, or insect infestation, or has suffered physical injury to itself that may be contributing to instability or structural weaknesses, or its basic survival. Such a tree may recover with remedial works where appropriate, or without intervention may stabilise or improve over time where appropriate, or without intervention may stabilise or improve over time, or in response to the implementation of beneficial changes to its local environment. This may be independent from, or contributed to by vigour.
Height (M)	5
Crown Spread and (M)	4
Diameter at Brest Height (MM) Tree Root Zone (M)	200 2.4
Diameter at Base Height (MM) Structural Root Zone (M)	200 1.7
Age Class	Mature- Tree aged 20-80% of life expectancy
Estimated Life Expectancy Sule Landscape Significance Overall Significance See Attachment 3	3b- Trees that may live for more than 15 years but would be removed for safety or nuisance reasons. Overall Significance. Medium –Tree not suitable for Preservation See Appendix 3 SULE and Significance of a Tree Assessment Rating System IACA Australia SULE and Significance of a Tree Assessment Rating System IACA Australia
Heritage/Cultural	Tree does not have a Heritage or Cultural Significance
Ecological and Habitat Matters	Tree has no Ecological or Habitat matters
Location to Site Features	The tree will be required to be removed for the development to be constructed on the site; There is a 50% incursion into the root zone by the proposed development. See Appendix 6
Tree Comments	Tree to be removed as per the demolition plan in appendix 7

Tree Number	9
Species	<i>Jacaranda mimosifolia</i>
Common Name	Jacaranda
Vigour	Normal Vigour- Ability of a tree to maintain and sustain its life processes. This may be evident by the typical growth of leaves, crown cover and crown density, branches, roots and trunk and resistance to predation. This is independent of the condition of a tree but may impact upon it , and especially the ability of a tree to sustain itself against predation
Condition	Fair Condition - tree is of good habit or misshapen, a form not severely restricted for space and light has some physical indication of decline due to the early effects of predation by pests and diseases, fungal, bacterial, or insect infestation, or has suffered physical injury to itself that may be contributing to instability or structural weaknesses, or its basic survival. Such a tree may recover with remedial works where appropriate, or without intervention may stabilise or improve over time where appropriate, or without intervention may stabilise or improve over time, or in response to the implementation of beneficial changes to its local environment. This may be independent from, or contributed to by vigour.
Height (M)	15
Crown Spread and (M)	10
Diameter at Brest Height (MM) Tree Root Zone (M)	610 7.3
Diameter at Base Height (MM) Structural Root Zone (M)	740 2.9
Age Class	Mature- Tree aged 20-80% of life expectancy
Estimated Life Expectancy Sule Landscape Significance Overall Significance See Attachment 3	3b- Trees that may live for more than 15 years but would be removed for safety or nuisance reasons. Overall Significance. Medium –Tree not suitable for Preservation See Appendix 3 SULE and Significance of a Tree Assessment Rating System IACA Australia SULE and Significance of a Tree Assessment Rating System IACA Australia
Heritage/Cultural	Tree does not have a Heritage or Cultural Significance
Ecological and Habitat Matters	Tree has no Ecological or Habitat matters
Location to Site Features	The tree will be required to be removed for the development to be constructed on the site; There is a 50% incursion into the root zone by the proposed development. See Appendix 6
Tree Comments	Tree to be removed as per the demolition plan in appendix 7

Tree Number	10
Species	<i>Eucalyptus paniculata</i>
Common Name	Grey Ironbark
Vigour	N/A Stump
Condition	N/A Stump
Height (M)	N/A
Crown Spread and (M)	N/A
Diameter at Brest Height (MM) Tree Root Zone (M)	N/A
Diameter at Base Height (MM) Structural Root Zone (M)	N/A
Age Class	Over Mature- Tree aged 100% of life expectancy
Estimated Life Expectancy Sule Landscape Significance Overall Significance See Attachment 3	N/A
Heritage/Cultural	N/A
Ecological and Habitat Matters	N/A
Location to Site Features	N/A
Tree Comments	N/A

Tree Number	11
Species	<i>Pittosporum undulatum</i>
Common Name	Sweet Pittosporum
Vigour	Normal Vigour- Ability of a tree to maintain and sustain its life processes. This may be evident by the typical growth of leaves, crown cover and crown density, branches, roots and trunk and resistance to predation. This is independent of the condition of a tree but may impact upon it , and especially the ability of a tree but may impact upon it , and especially the ability of a tree to sustain itself against predation
Condition	Fair Condition - tree is of good habit or misshapen, a form not severely restricted for space and light has some physical indication of decline due to the early effects of predation by pests and diseases, fungal, bacterial, or insect infestation, or has suffered physical injury to itself that may be contributing to instability or structural weaknesses, or its basic survival. Such a tree may recover with remedial works where appropriate, or without intervention may stabilise or improve over time where appropriate, or without intervention may stabilise or improve over time, or in response to the implementation of beneficial changes to its local environment. This may be independent from, or contributed to by vigour.
Height (M)	7
Crown Spread and (M)	5
Diameter at Brest Height (MM) Tree Root Zone (M)	300 3.6
Diameter at Base Height (MM) Structural Root Zone (M)	300 2
Age Class	Mature- Tree aged 20-80% of life expectancy
Estimated Life Expectancy Sule Landscape Significance Overall Significance See Attachment 3	3b- Trees that may live for more than 15 years but would be removed for safety or nuisance reasons. Overall Significance. Medium –Tree not suitable for Preservation See Appendix 3 SULE and Significance of a Tree Assessment Rating System IACA Australia SULE and Significance of a Tree Assessment Rating System IACA Australia
Heritage/Cultural	Tree does not have a Heritage or Cultural Significance
Ecological and Habitat Matters	Tree has no Ecological or Habitat matters
Location to Site Features	The tree will be required to be removed for the development to be constructed on the site; There is a 50% incursion into the root zone by the proposed development. See Appendix 6
Tree Comments	Tree to be removed as per the demolition plan in appendix 7

Tree Number	12
Species	<i>Eucalyptus paniculata</i>
Common Name	Grey Ironbark
Vigour	Normal Vigour- Ability of a tree to maintain and sustain its life processes. This may be evident by the typical growth of leaves, crown cover and crown density, branches, roots and trunk and resistance to predation. This is independent of the condition of a tree but may impact upon it , and especially the ability of a tree but may impact upon it , and especially the ability of a tree to sustain itself against predation
Condition	Fair Condition - tree is of good habit or misshapen, a form not severely restricted for space and light has some physical indication of decline due to the early effects of predation by pests and diseases, fungal, bacterial, or insect infestation, or has suffered physical injury to itself that may be contributing to instability or structural weaknesses, or its basic survival. Such a tree may recover with remedial works where appropriate, or without intervention may stabilise or improve over time where appropriate, or without intervention may stabilise or improve over time, or in response to the implementation of beneficial changes to its local environment. This may be independent from, or contributed to by vigour.
Height (M)	20
Crown Spread and (M)	10
Diameter at Brest Height (MM) Tree Root Zone (M)	480 5.8
Diameter at Base Height (MM) Structural Root Zone (M)	620 2.7
Age Class	Mature- Tree aged 20-80% of life expectancy
Estimated Life Expectancy Sule Landscape Significance Overall Significance See Attachment 3	3b- Trees that may live for more than 15 years but would be removed for safety or nuisance reasons. Overall Significance. Medium –Tree not suitable for Preservation See Appendix 3 SULE and Significance of a Tree Assessment Rating System IACA Australia SULE and Significance of a Tree Assessment Rating System IACA Australia
Heritage/Cultural	Tree does not have a Heritage or Cultural Significance
Ecological and Habitat Matters	Tree has no Ecological or Habitat matters
Location to Site Features	The tree will be required to be removed for the development to be constructed on the site; There is a 50% incursion into the root zone by the proposed development. See Appendix 6
Tree Comments	Tree to be removed as per the demolition plan in appendix 7

Tree Number	13
Species	<i>Jacaranda mimosifolia</i>
Common Name	Jacaranda
Vigour	Normal Vigour- Ability of a tree to maintain and sustain its life processes. This may be evident by the typical growth of leaves, crown cover and crown density, branches, roots and trunk and resistance to predation. This is independent of the condition of a tree but may impact upon it , and especially the ability of a tree but may impact upon it , and especially the ability of a tree to sustain itself against predation
Condition	Fair Condition - tree is of good habit or misshapen, a form not severely restricted for space and light has some physical indication of decline due to the early effects of predation by pests and diseases, fungal, bacterial, or insect infestation, or has suffered physical injury to itself that may be contributing to instability or structural weaknesses, or its basic survival. Such a tree may recover with remedial works where appropriate, or without intervention may stabilise or improve over time where appropriate, or without intervention may stabilise or improve over time, or in response to the implementation of beneficial changes to its local environment. This may be independent from, or contributed to by vigour.
Height (M)	20
Crown Spread and (M)	15
Diameter at Brest Height (MM) Tree Root Zone (M)	650 7.8
Diameter at Base Height (MM) Structural Root Zone (M)	810 3
Age Class	Mature- Tree aged 20-80% of life expectancy
Estimated Life Expectancy Sule Landscape Significance Overall Significance See Attachment 3	3b- Trees that may live for more than 15 years but would be removed for safety or nuisance reasons. Overall Significance. Medium –Tree not suitable for Preservation See Appendix 3 SULE and Significance of a Tree Assessment Rating System IACA Australia SULE and Significance of a Tree Assessment Rating System IACA Australia
Heritage/Cultural	Tree does not have a Heritage or Cultural Significance
Ecological and Habitat Matters	Tree has no Ecological or Habitat matters
Location to Site Features	The tree will be required to be removed for the development to be constructed on the site; There is a 50% incursion into the root zone by the proposed development. See Appendix 6
Tree Comments	Tree to be removed as per the demolition plan in appendix 7

Tree Number	14
Species	<i>Unknown Species</i> Non indigenous
Common Name	
Vigour	Normal Vigour- Ability of a tree to maintain and sustain its life processes. This may be evident by the typical growth of leaves, crown cover and crown density, branches, roots and trunk and resistance to predation. This is independent of the condition of a tree but may impact upon it , and especially the ability of a tree but may impact upon it , and especially the ability of a tree to sustain itself against predation
Condition	Fair Condition - tree is of good habit or misshapen, a form not severely restricted for space and light has some physical indication of decline due to the early effects of predation by pests and diseases, fungal, bacterial, or insect infestation, or has suffered physical injury to itself that may be contributing to instability or structural weaknesses, or its basic survival. Such a tree may recover with remedial works where appropriate, or without intervention may stabilise or improve over time where appropriate, or without intervention may stabilise or improve over time, or in response to the implementation of beneficial changes to its local environment. This may be independent from, or contributed to by vigour.
Height (M)	20
Crown Spread and (M)	10
Diameter at Brest Height (MM) Tree Root Zone (M)	780 9.4
Diameter at Base Height (MM) Structural Root Zone (M)	950 3.2
Age Class	Mature- Tree aged 20-80% of life expectancy
Estimated Life Expectancy Sule Landscape Significance Overall Significance See Attachment 3	3b- Trees that may live for more than 15 years but would be removed for safety or nuisance reasons. Overall Significance. Medium –Tree not suitable for Preservation See Appendix 3 SULE and Significance of a Tree Assessment Rating System IACA Australia SULE and Significance of a Tree Assessment Rating System IACA Australia
Heritage/Cultural	Tree does not have a Heritage or Cultural Significance
Ecological and Habitat Matters	Tree has no Ecological or Habitat matters
Location to Site Features	The tree will be required to be removed for the development to be constructed on the site; There is a 50% incursion into the root zone by the proposed development. See Appendix 6
Tree Comments	Tree to be removed as per the demolition plan in appendix 7

Tree Number	15
Species	<i>Liquidambar styraciflua</i>
Common Name	Liquidamber
Vigour	Normal Vigour- Ability of a tree to maintain and sustain its life processes. This may be evident by the typical growth of leaves, crown cover and crown density, branches, roots and trunk and resistance to predation. This is independent of the condition of a tree but may impact upon it , and especially the ability of a tree to sustain itself against predation
Condition	Fair Condition - tree is of good habit or misshapen, a form not severely restricted for space and light has some physical indication of decline due to the early effects of predation by pests and diseases, fungal, bacterial, or insect infestation, or has suffered physical injury to itself that may be contributing to instability or structural weaknesses, or its basic survival. Such a tree may recover with remedial works where appropriate, or without intervention may stabilise or improve over time where appropriate, or without intervention may stabilise or improve over time, or in response to the implementation of beneficial changes to its local environment. This may be independent from, or contributed to by vigour.
Height (M)	10
Crown Spread and (M)	10
Diameter at Brest Height (MM) Tree Root Zone (M)	450 5.4
Diameter at Base Height (MM) Structural Root Zone (M)	510 2.5
Age Class	Mature- Tree aged 20-80% of life expectancy
Estimated Life Expectancy Sule Landscape Significance Overall Significance See Attachment 3	3b- Trees that may live for more than 15 years but would be removed for safety or nuisance reasons. Overall Significance. Medium –Tree not suitable for Preservation See Appendix 3 SULE and Significance of a Tree Assessment Rating System IACA Australia SULE and Significance of a Tree Assessment Rating System IACA Australia
Heritage/Cultural	Tree does not have a Heritage or Cultural Significance
Ecological and Habitat Matters	Tree has no Ecological or Habitat matters
Location to Site Features	The tree will be required to be removed for the development to be constructed on the site; There is a 50% incursion into the root zone by the proposed development. See Appendix 6
Tree Comments	Tree to be removed as per the demolition plan in appendix 7

Tree Number	16
Species	<i>Casuarina glauca</i>
Common Name	Swamp Oak
Vigour	Normal Vigour- Ability of a tree to maintain and sustain its life processes. This may be evident by the typical growth of leaves, crown cover and crown density, branches, roots and trunk and resistance to predation. This is independent of the condition of a tree but may impact upon it , and especially the ability of a tree but may impact upon it , and especially the ability of a tree to sustain itself against predation
Condition	Fair Condition - tree is of good habit or misshapen, a form not severely restricted for space and light has some physical indication of decline due to the early effects of predation by pests and diseases, fungal, bacterial, or insect infestation, or has suffered physical injury to itself that may be contributing to instability or structural weaknesses, or its basic survival. Such a tree may recover with remedial works where appropriate, or without intervention may stabilise or improve over time where appropriate, or without intervention may stabilise or improve over time, or in response to the implementation of beneficial changes to its local environment. This may be independent from, or contributed to by vigour.
Height (M)	18
Crown Spread and (M)	10
Diameter at Brest Height (MM) Tree Root Zone (M)	500 6
Diameter at Base Height (MM) Structural Root Zone (M)	610 2.7
Age Class	Mature- Tree aged 20-80% of life expectancy
Estimated Life Expectancy Sule Landscape Significance Overall Significance See Attachment 3	3b- Trees that may live for more than 15 years but would be removed for safety or nuisance reasons. Overall Significance. Medium –Tree not suitable for Preservation See Appendix 3 SULE and Significance of a Tree Assessment Rating System IACA Australia SULE and Significance of a Tree Assessment Rating System IACA Australia
Heritage/Cultural	Tree does not have a Heritage or Cultural Significance
Ecological and Habitat Matters	Tree has no Ecological or Habitat matters
Location to Site Features	The tree will be required to be removed for the development to be constructed on the site; There is a 50% incursion into the root zone by the proposed development. See Appendix 6
Tree Comments	Tree to be removed as per the demolition plan in appendix 7

Tree Number	17
Species	<i>Schinus areira</i>
Common Name	Peppercorn
Vigour	Normal Vigour- Ability of a tree to maintain and sustain its life processes. This may be evident by the typical growth of leaves, crown cover and crown density, branches, roots and trunk and resistance to predation. This is independent of the condition of a tree but may impact upon it , and especially the ability of a tree but may impact upon it , and especially the ability of a tree to sustain itself against predation
Condition	Fair Condition - tree is of good habit or misshapen, a form not severely restricted for space and light has some physical indication of decline due to the early effects of predation by pests and diseases, fungal, bacterial, or insect infestation, or has suffered physical injury to itself that may be contributing to instability or structural weaknesses, or its basic survival. Such a tree may recover with remedial works where appropriate, or without intervention may stabilise or improve over time where appropriate, or without intervention may stabilise or improve over time, or in response to the implementation of beneficial changes to its local environment. This may be independent from, or contributed to by vigour.
Height (M)	20
Crown Spread and (M)	15
Diameter at Brest Height (MM) Tree Root Zone (M)	2000 15
Diameter at Base Height (MM) Structural Root Zone (M)	2490 4.9
Age Class	Mature- Tree aged 20-80% of life expectancy
Estimated Life Expectancy Sule Landscape Significance Overall Significance See Attachment 3	3b- Trees that may live for more than 15 years but would be removed for safety or nuisance reasons. Overall Significance. Medium –Tree not suitable for Preservation See Appendix 3 SULE and Significance of a Tree Assessment Rating System IACA Australia SULE and Significance of a Tree Assessment Rating System IACA Australia
Heritage/Cultural	Tree does not have a Heritage or Cultural Significance
Ecological and Habitat Matters	Tree has no Ecological or Habitat matters
Location to Site Features	The tree will be required to be removed for the development to be constructed on the site; There is a 50% incursion into the root zone by the proposed development. See Appendix 6
Tree Comments	Tree to be removed as per the demolition plan in appendix 7

Tree Number	18
Species	<i>Liquidambar styraciflua</i>
Common Name	Liquidamber
Vigour	Normal Vigour- Ability of a tree to maintain and sustain its life processes. This may be evident by the typical growth of leaves, crown cover and crown density, branches, roots and trunk and resistance to predation. This is independent of the condition of a tree but may impact upon it , and especially the ability of a tree but may impact upon it , and especially the ability of a tree to sustain itself against predation
Condition	Fair Condition - tree is of good habit or misshapen, a form not severely restricted for space and light has some physical indication of decline due to the early effects of predation by pests and diseases, fungal, bacterial, or insect infestation, or has suffered physical injury to itself that may be contributing to instability or structural weaknesses, or its basic survival. Such a tree may recover with remedial works where appropriate, or without intervention may stabilise or improve over time where appropriate, or without intervention may stabilise or improve over time, or in response to the implementation of beneficial changes to its local environment. This may be independent from, or contributed to by vigour.
Height (M)	20
Crown Spread and (M)	15
Diameter at Brest Height (MM) Tree Root Zone (M)	780 9.4
Diameter at Base Height (MM) Structural Root Zone (M)	950 3.2
Age Class	Mature- Tree aged 20-80% of life expectancy
Estimated Life Expectancy Sule Landscape Significance Overall Significance See Attachment 3	3b- Trees that may live for more than 15 years but would be removed for safety or nuisance reasons. Overall Significance. Medium –Tree not suitable for Preservation See Appendix 3 SULE and Significance of a Tree Assessment Rating System IACA Australia SULE and Significance of a Tree Assessment Rating System IACA Australia
Heritage/Cultural	Tree does not have a Heritage or Cultural Significance
Ecological and Habitat Matters	Tree has no Ecological or Habitat matters
Location to Site Features	The tree will be required to be removed for the development to be constructed on the site; There is a 50% incursion into the root zone by the proposed development. See Appendix 6
Tree Comments	Tree to be removed as per the demolition plan in appendix 7

Tree Number	19
Species	<i>Melia azedarach</i>
Common Name	White Cedar
Vigour	Normal Vigour- Ability of a tree to maintain and sustain its life processes. This may be evident by the typical growth of leaves, crown cover and crown density, branches, roots and trunk and resistance to predation. This is independent of the condition of a tree but may impact upon it , and especially the ability of a tree but may impact upon it , and especially the ability of a tree to sustain itself against predation
Condition	Fair Condition - tree is of good habit or misshapen, a form not severely restricted for space and light has some physical indication of decline due to the early effects of predation by pests and diseases, fungal, bacterial, or insect infestation, or has suffered physical injury to itself that may be contributing to instability or structural weaknesses, or its basic survival. Such a tree may recover with remedial works where appropriate, or without intervention may stabilise or improve over time where appropriate, or without intervention may stabilise or improve over time, or in response to the implementation of beneficial changes to its local environment. This may be independent from, or contributed to by vigour.
Height (M)	5
Crown Spread and (M)	5
Diameter at Brest Height (MM) Tree Root Zone (M)	300 3.6
Diameter at Base Height (MM) Structural Root Zone (M)	300 2
Age Class	Mature- Tree aged 20-80% of life expectancy
Estimated Life Expectancy Sule Landscape Significance Overall Significance See Attachment 3	3b- Trees that may live for more than 15 years but would be removed for safety or nuisance reasons. Overall Significance. Medium –Tree not suitable for Preservation See Appendix 3 SULE and Significance of a Tree Assessment Rating System IACA Australia SULE and Significance of a Tree Assessment Rating System IACA Australia
Heritage/Cultural	Tree does not have a Heritage or Cultural Significance
Ecological and Habitat Matters	Tree has no Ecological or Habitat matters
Location to Site Features	The tree will be required to be removed for the development to be constructed on the site; There is a 50% incursion into the root zone by the proposed development. See Appendix 6
Tree Comments	Tree to be removed as per the demolition plan in appendix 7

Tree Number	20
Species	<i>Melaleuca bracteata</i>
Common Name	Revolution Green
Vigour	Normal Vigour- Ability of a tree to maintain and sustain its life processes. This may be evident by the typical growth of leaves, crown cover and crown density, branches, roots and trunk and resistance to predation. This is independent of the condition of a tree but may impact upon it , and especially the ability of a tree but may impact upon it , and especially the ability of a tree to sustain itself against predation
Condition	Fair Condition - tree is of good habit or misshapen, a form not severely restricted for space and light has some physical indication of decline due to the early effects of predation by pests and diseases, fungal, bacterial, or insect infestation, or has suffered physical injury to itself that may be contributing to instability or structural weaknesses, or its basic survival. Such a tree may recover with remedial works where appropriate, or without intervention may stabilise or improve over time where appropriate, or without intervention may stabilise or improve over time, or in response to the implementation of beneficial changes to its local environment. This may be independent from, or contributed to by vigour.
Height (M)	20
Crown Spread and (M)	15
Diameter at Brest Height (MM) Tree Root Zone (M)	780 9.4
Diameter at Base Height (MM) Structural Root Zone (M)	950 3.2
Age Class	Mature- Tree aged 20-80% of life expectancy
Estimated Life Expectancy Sule Landscape Significance Overall Significance See Attachment 3	3b- Trees that may live for more than 15 years but would be removed for safety or nuisance reasons. Overall Significance. Medium –Tree not suitable for Preservation See Appendix 3 SULE and Significance of a Tree Assessment Rating System IACA Australia SULE and Significance of a Tree Assessment Rating System IACA Australia
Heritage/Cultural	Tree does not have a Heritage or Cultural Significance
Ecological and Habitat Matters	Tree has no Ecological or Habitat matters
Location to Site Features	The tree will be required to be removed for the development to be constructed on the site; There is a 50% incursion into the root zone by the proposed development. See Appendix 6
Tree Comments	Tree to be removed as per the demolition plan in appendix 7

Tree Number	21
Species	<i>Liquidambar styraciflua</i>
Common Name	Liquidamber
Vigour	Normal Vigour- Ability of a tree to maintain and sustain its life processes. This may be evident by the typical growth of leaves, crown cover and crown density, branches, roots and trunk and resistance to predation. This is independent of the condition of a tree but may impact upon it , and especially the ability of a tree but may impact upon it , and especially the ability of a tree to sustain itself against predation
Condition	Fair Condition - tree is of good habit or misshapen, a form not severely restricted for space and light has some physical indication of decline due to the early effects of predation by pests and diseases, fungal, bacterial, or insect infestation, or has suffered physical injury to itself that may be contributing to instability or structural weaknesses, or its basic survival. Such a tree may recover with remedial works where appropriate, or without intervention may stabilise or improve over time where appropriate, or without intervention may stabilise or improve over time, or in response to the implementation of beneficial changes to its local environment. This may be independent from, or contributed to by vigour.
Height (M)	25
Crown Spread and (M)	15
Diameter at Brest Height (MM) Tree Root Zone (M)	600 7.2
Diameter at Base Height (MM) Structural Root Zone (M)	710 2.9
Age Class	Mature- Tree aged 20-80% of life expectancy
Estimated Life Expectancy Sule Landscape Significance Overall Significance See Attachment 3	3b- Trees that may live for more than 15 years but would be removed for safety or nuisance reasons. Overall Significance. Medium –Tree not suitable for Preservation See Appendix 3 SULE and Significance of a Tree Assessment Rating System IACA Australia SULE and Significance of a Tree Assessment Rating System IACA Australia
Heritage/Cultural	Tree does not have a Heritage or Cultural Significance
Ecological and Habitat Matters	Tree has no Ecological or Habitat matters
Location to Site Features	The tree will be required to be removed for the development to be constructed on the site; There is a 50% incursion into the root zone by the proposed development. See Appendix 6
Tree Comments	Tree to be removed as per the demolition plan in appendix 7

Tree Number	22
Species	<i>Archontophoenix cunninghamiana</i>
Common Name	Bangalow Palm
Vigour	Normal Vigour- Ability of a tree to maintain and sustain its life processes. This may be evident by the typical growth of leaves, crown cover and crown density, branches, roots and trunk and resistance to predation. This is independent of the condition of a tree but may impact upon it , and especially the ability of a tree but may impact upon it , and especially the ability of a tree to sustain itself against predation
Condition	Fair Condition - tree is of good habit or misshapen, a form not severely restricted for space and light has some physical indication of decline due to the early effects of predation by pests and diseases, fungal, bacterial, or insect infestation, or has suffered physical injury to itself that may be contributing to instability or structural weaknesses, or its basic survival. Such a tree may recover with remedial works where appropriate, or without intervention may stabilise or improve over time where appropriate, or without intervention may stabilise or improve over time, or in response to the implementation of beneficial changes to its local environment. This may be independent from, or contributed to by vigour.
Height (M)	10
Crown Spread and (M)	2
Diameter at Brest Height (MM) Tree Root Zone (M)	200 2.4
Diameter at Base Height (MM) Structural Root Zone (M)	N/A
Age Class	Mature- Tree aged 20-80% of life expectancy
Estimated Life Expectancy Sule Landscape Significance Overall Significance See Attachment 3	3b- Trees that may live for more than 15 years but would be removed for safety or nuisance reasons. Overall Significance. Medium –Tree not suitable for Preservation See Appendix 3 SULE and Significance of a Tree Assessment Rating System IACA Australia SULE and Significance of a Tree Assessment Rating System IACA Australia
Heritage/Cultural	Tree does not have a Heritage or Cultural Significance
Ecological and Habitat Matters	Tree has no Ecological or Habitat matters
Location to Site Features	The tree will be required to be removed for the development to be constructed on the site; There is a 50% incursion into the root zone by the proposed development. See Appendix 6
Tree Comments	Tree to be removed as per the demolition plan in appendix 7

Tree Number	23
Species	<i>Eucalyptus nicholii</i>
Common Name	Small Leaved Peppermint
Vigour	Normal Vigour- Ability of a tree to maintain and sustain its life processes. This may be evident by the typical growth of leaves, crown cover and crown density, branches, roots and trunk and resistance to predation. This is independent of the condition of a tree but may impact upon it , and especially the ability of a tree but may impact upon it , and especially the ability of a tree to sustain itself against predation
Condition	Fair Condition - tree is of good habit or misshapen, a form not severely restricted for space and light has some physical indication of decline due to the early effects of predation by pests and diseases, fungal, bacterial, or insect infestation, or has suffered physical injury to itself that may be contributing to instability or structural weaknesses, or its basic survival. Such a tree may recover with remedial works where appropriate, or without intervention may stabilise or improve over time where appropriate, or without intervention may stabilise or improve over time, or in response to the implementation of beneficial changes to its local environment. This may be independent from, or contributed to by vigour.
Height (M)	20
Crown Spread and (M)	10
Diameter at Brest Height (MM) Tree Root Zone (M)	500 6
Diameter at Base Height (MM) Structural Root Zone (M)	660 2.8
Age Class	Mature- Tree aged 20-80% of life expectancy
Estimated Life Expectancy Sule Landscape Significance Overall Significance See Attachment 3	3b- Trees that may live for more than 15 years but would be removed for safety or nuisance reasons. Overall Significance. Medium –Tree not suitable for Preservation See Appendix 3 SULE and Significance of a Tree Assessment Rating System IACA Australia SULE and Significance of a Tree Assessment Rating System IACA Australia
Heritage/Cultural	Tree does not have a Heritage or Cultural Significance
Ecological and Habitat Matters	Tree has no Ecological or Habitat matters
Location to Site Features	The tree will be required to be removed for the development to be constructed on the site; There is a 50% incursion into the root zone by the proposed development. See Appendix 6
Tree Comments	Tree to be removed as per the demolition plan in appendix 7

Tree Number	24
Species	<i>Callistemon viminalis</i>
Common Name	Weeping Bottlebrush
Vigour	Normal Vigour- Ability of a tree to maintain and sustain its life processes. This may be evident by the typical growth of leaves, crown cover and crown density, branches, roots and trunk and resistance to predation. This is independent of the condition of a tree but may impact upon it , and especially the ability of a tree but may impact upon it , and especially the ability of a tree to sustain itself against predation
Condition	Fair Condition - tree is of good habit or misshapen, a form not severely restricted for space and light has some physical indication of decline due to the early effects of predation by pests and diseases, fungal, bacterial, or insect infestation, or has suffered physical injury to itself that may be contributing to instability or structural weaknesses, or its basic survival. Such a tree may recover with remedial works where appropriate, or without intervention may stabilise or improve over time where appropriate, or without intervention may stabilise or improve over time, or in response to the implementation of beneficial changes to its local environment. This may be independent from, or contributed to by vigour.
Height (M)	10
Crown Spread and (M)	10
Diameter at Brest Height (MM) Tree Root Zone (M)	400 4.8
Diameter at Base Height (MM) Structural Root Zone (M)	500 2.5
Age Class	Mature- Tree aged 20-80% of life expectancy
Estimated Life Expectancy Sule Landscape Significance Overall Significance See Attachment 3	3b- Trees that may live for more than 15 years but would be removed for safety or nuisance reasons. Overall Significance. Medium –Tree not suitable for Preservation See Appendix 3 SULE and Significance of a Tree Assessment Rating System IACA Australia SULE and Significance of a Tree Assessment Rating System IACA Australia
Heritage/Cultural	Tree does not have a Heritage or Cultural Significance
Ecological and Habitat Matters	Tree has no Ecological or Habitat matters
Location to Site Features	The tree will be required to be removed for the development to be constructed on the site; There is a 50% incursion into the root zone by the proposed development. See Appendix 6
Tree Comments	Tree to be removed as per the demolition plan in appendix 7

Tree Number	25
Species	<i>Jacaranda mimosifolia</i>
Common Name	Jacaranda
Vigour	Normal Vigour- Ability of a tree to maintain and sustain its life processes. This may be evident by the typical growth of leaves, crown cover and crown density, branches, roots and trunk and resistance to predation. This is independent of the condition of a tree but may impact upon it , and especially the ability of a tree but may impact upon it , and especially the ability of a tree to sustain itself against predation
Condition	Fair Condition - tree is of good habit or misshapen, a form not severely restricted for space and light has some physical indication of decline due to the early effects of predation by pests and diseases, fungal, bacterial, or insect infestation, or has suffered physical injury to itself that may be contributing to instability or structural weaknesses, or its basic survival. Such a tree may recover with remedial works where appropriate, or without intervention may stabilise or improve over time where appropriate, or without intervention may stabilise or improve over time, or in response to the implementation of beneficial changes to its local environment. This may be independent from, or contributed to by vigour.
Height (M)	20
Crown Spread and (M)	10
Diameter at Brest Height (MM) Tree Root Zone (M)	600 7.2
Diameter at Base Height (MM) Structural Root Zone (M)	950 3.2
Age Class	Mature- Tree aged 20-80% of life expectancy
Estimated Life Expectancy Sule Landscape Significance Overall Significance See Attachment 3	3b- Trees that may live for more than 15 years but would be removed for safety or nuisance reasons. Overall Significance. Medium –Tree not suitable for Preservation See Appendix 3 SULE and Significance of a Tree Assessment Rating System IACA Australia SULE and Significance of a Tree Assessment Rating System IACA Australia
Heritage/Cultural	Tree does not have a Heritage or Cultural Significance
Ecological and Habitat Matters	Tree has no Ecological or Habitat matters
Location to Site Features	The tree will be required to be removed for the development to be constructed on the site; There is a 50% incursion into the root zone by the proposed development. See Appendix 6
Tree Comments	Tree to be removed as per the demolition plan in appendix 7


Tree Number	26
Species	<i>Harpephyllum caffrum</i>
Common Name	Kaffir Plum
Vigour	Normal Vigour- Ability of a tree to maintain and sustain its life processes. This may be evident by the typical growth of leaves, crown cover and crown density, branches, roots and trunk and resistance to predation. This is independent of the condition of a tree but may impact upon it , and especially the ability of a tree but may impact upon it , and especially the ability of a tree to sustain itself against predation
Condition	Fair Condition - tree is of good habit or misshapen, a form not severely restricted for space and light has some physical indication of decline due to the early effects of predation by pests and diseases, fungal, bacterial, or insect infestation, or has suffered physical injury to itself that may be contributing to instability or structural weaknesses, or its basic survival. Such a tree may recover with remedial works where appropriate, or without intervention may stabilise or improve over time where appropriate, or without intervention may stabilise or improve over time, or in response to the implementation of beneficial changes to its local environment. This may be independent from, or contributed to by vigour.
Height (M)	10
Crown Spread and (M)	10
Diameter at Brest Height (MM) Tree Root Zone (M)	500 6
Diameter at Base Height (MM) Structural Root Zone (M)	500 2.5
Age Class	Mature- Tree aged 20-80% of life expectancy
Estimated Life Expectancy Sule Landscape Significance Overall Significance See Attachment 3	3b- Trees that may live for more than 15 years but would be removed for safety or nuisance reasons. Overall Significance. Medium –Tree not suitable for Preservation See Appendix 3 SULE and Significance of a Tree Assessment Rating System IACA Australia SULE and Significance of a Tree Assessment Rating System IACA Australia
Heritage/Cultural	Tree does not have a Heritage or Cultural Significance
Ecological and Habitat Matters	Tree has no Ecological or Habitat matters
Location to Site Features	The tree will be required to be removed for the development to be constructed on the site; There is a 50% incursion into the root zone by the proposed development. See Appendix 6
Tree Comments	Tree to be removed as per the demolition plan in appendix 7

Tree Number	27
Species	<i>Grevillea robusta</i>
Common Name	Silky Oak
Vigour	Normal Vigour- Ability of a tree to maintain and sustain its life processes. This may be evident by the typical growth of leaves, crown cover and crown density, branches, roots and trunk and resistance to predation. This is independent of the condition of a tree but may impact upon it , and especially the ability of a tree but may impact upon it , and especially the ability of a tree to sustain itself against predation
Condition	Fair Condition - tree is of good habit or misshapen, a form not severely restricted for space and light has some physical indication of decline due to the early effects of predation by pests and diseases, fungal, bacterial, or insect infestation, or has suffered physical injury to itself that may be contributing to instability or structural weaknesses, or its basic survival. Such a tree may recover with remedial works where appropriate, or without intervention may stabilise or improve over time where appropriate, or without intervention may stabilise or improve over time, or in response to the implementation of beneficial changes to its local environment. This may be independent from, or contributed to by vigour.
Height (M)	20
Crown Spread and (M)	15
Diameter at Brest Height (MM) Tree Root Zone (M)	680 8.2
Diameter at Base Height (MM) Structural Root Zone (M)	950 3.2
Age Class	Mature- Tree aged 20-80% of life expectancy
Estimated Life Expectancy Sule Landscape Significance Overall Significance See Attachment 3	3b- Trees that may live for more than 15 years but would be removed for safety or nuisance reasons. Overall Significance. Medium –Tree not suitable for Preservation See Appendix 3 SULE and Significance of a Tree Assessment Rating System IACA Australia SULE and Significance of a Tree Assessment Rating System IACA Australia
Heritage/Cultural	Tree does not have a Heritage or Cultural Significance
Ecological and Habitat Matters	Tree has no Ecological or Habitat matters
Location to Site Features	The tree will be required to be removed for the development to be constructed on the site; There is a 50% incursion into the root zone by the proposed development. See Appendix 6
Tree Comments	Tree to be removed as per the demolition plan in appendix 7


Tree Number	28
Species	<i>Morus nigra</i>
Common Name	Mulberry Tree
Vigour	Normal Vigour- Ability of a tree to maintain and sustain its life processes. This may be evident by the typical growth of leaves, crown cover and crown density, branches, roots and trunk and resistance to predation. This is independent of the condition of a tree but may impact upon it , and especially the ability of a tree but may impact upon it , and especially the ability of a tree to sustain itself against predation
Condition	Fair Condition - tree is of good habit or misshapen, a form not severely restricted for space and light has some physical indication of decline due to the early effects of predation by pests and diseases, fungal, bacterial, or insect infestation, or has suffered physical injury to itself that may be contributing to instability or structural weaknesses, or its basic survival. Such a tree may recover with remedial works where appropriate, or without intervention may stabilise or improve over time where appropriate, or without intervention may stabilise or improve over time, or in response to the implementation of beneficial changes to its local environment. This may be independent from, or contributed to by vigour.
Height (M)	4
Crown Spread and (M)	3
Diameter at Brest Height (MM) Tree Root Zone (M)	100 2
Diameter at Base Height (MM) Structural Root Zone (M)	100 1.5
Age Class	Mature- Tree aged 20-80% of life expectancy
Estimated Life Expectancy Sule Landscape Significance Overall Significance See Attachment 3	3b- Trees that may live for more than 15 years but would be removed for safety or nuisance reasons. Overall Significance. Medium –Tree not suitable for Preservation See Appendix 3 SULE and Significance of a Tree Assessment Rating System IACA Australia SULE and Significance of a Tree Assessment Rating System IACA Australia
Heritage/Cultural	Tree does not have a Heritage or Cultural Significance
Ecological and Habitat Matters	Tree has no Ecological or Habitat matters
Location to Site Features	The tree will be required to be removed for the development to be constructed on the site; There is a 50% incursion into the root zone by the proposed development. See Appendix 6
Tree Comments	Tree to be removed as per the demolition plan in appendix 7

Site Photographs

Tree 1
*Eucalyptus
paniculata*
Grey Ironbark

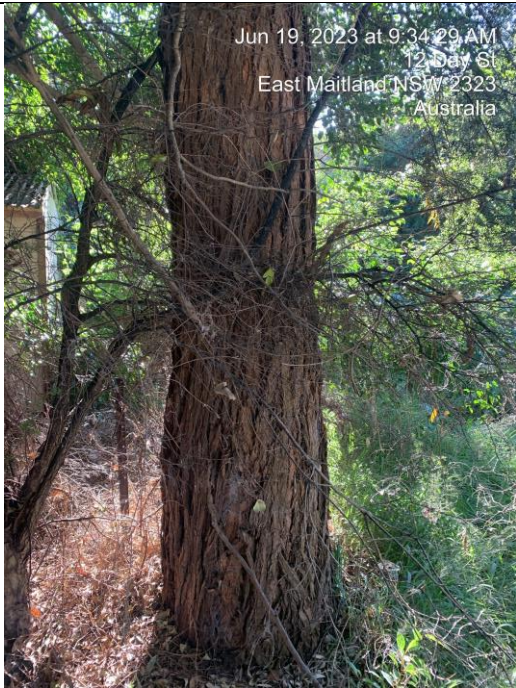

Tree 2
Ficus benjamina
Weeping Fig

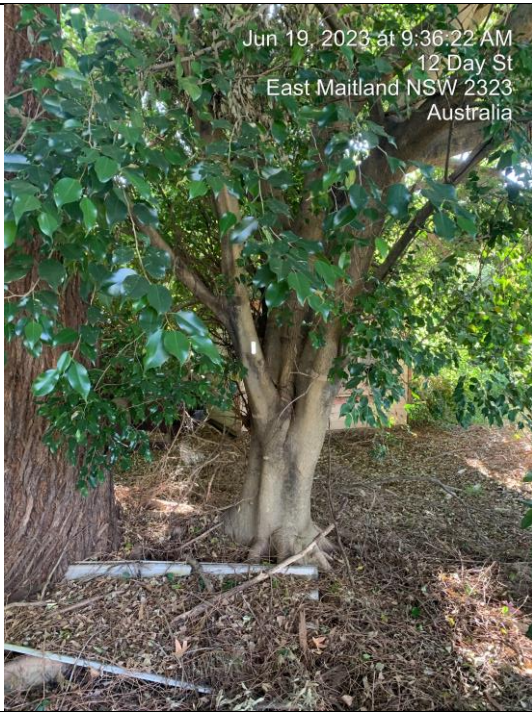


Tree 3
*Eucalyptus
paniculata*
Grey Ironbark



Tree 4
*Jacaranda
mimosifolia*
Jacaranda




Tree 5
Jacaranda
mimosifolia
Jacaranda

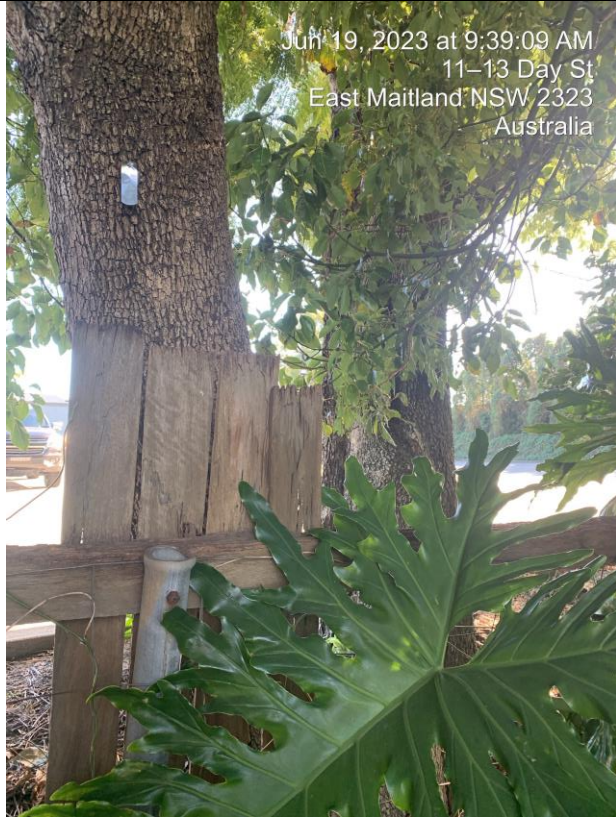


Tree 6
Cinnamomum
camphora
Camphorlaurel



Tree 7
*Cinnamomum
camphora*
Camphorlaurel

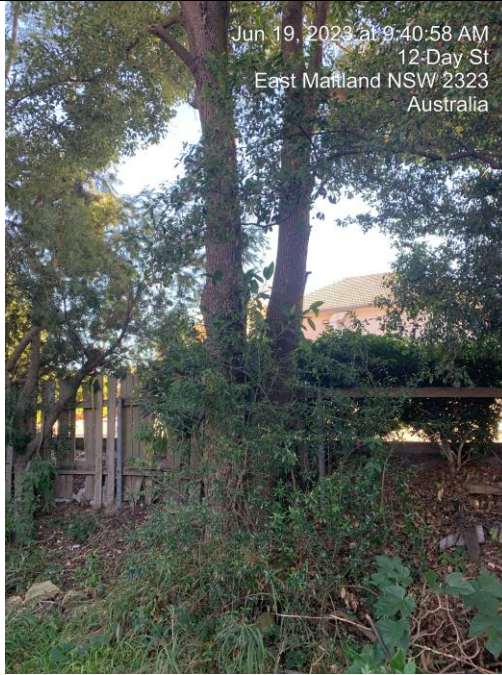

Tree 8
*Callistemon
viminalis*
Weeping
Bottlebrush

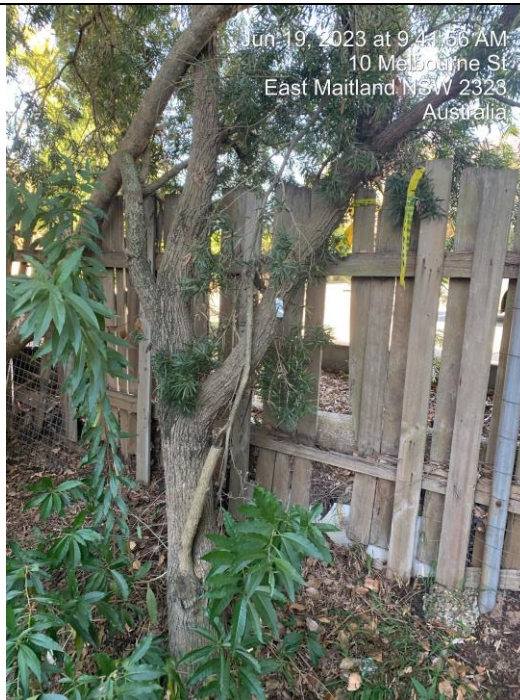


Tree 9
Jacaranda
mimosifolia
Jacaranda



Tree 10
Eucalyptus
paniculata
Grey Ironbark




Tree 11
Pittosporum undulatum
Sweet Pittosporum

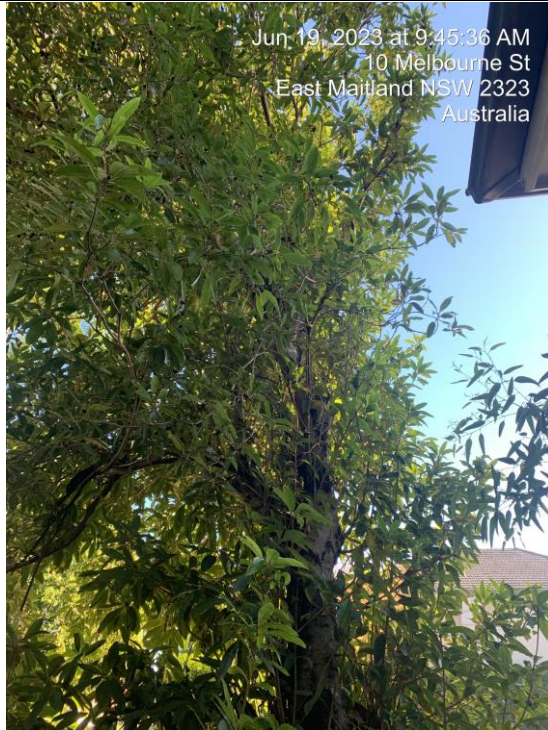


Jun 19, 2023 at 9:45:36 AM
10 Melbourne St
East Maitland NSW 2323
Australia

Tree 12
Eucalyptus paniculata
Grey Ironbark

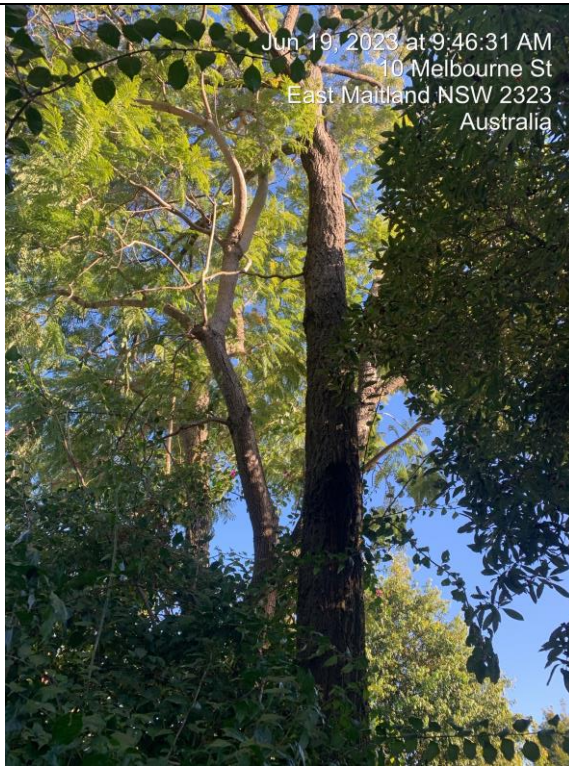


Jun 19, 2023 at 9:46:31 AM
10 Melbourne St
East Maitland NSW 2323
Australia


Tree 13
Jacaranda
mimosifolia
Jacaranda

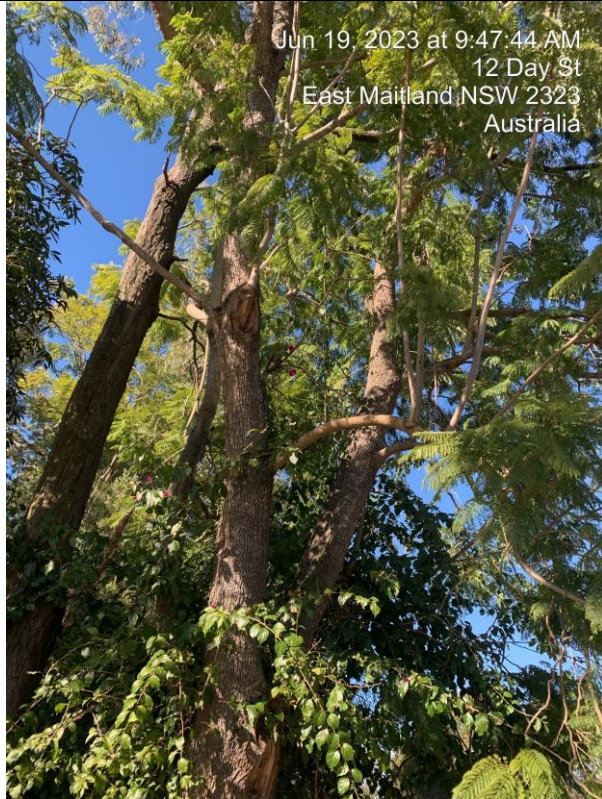

Tree 14
Unknown
Species
Non indigenous

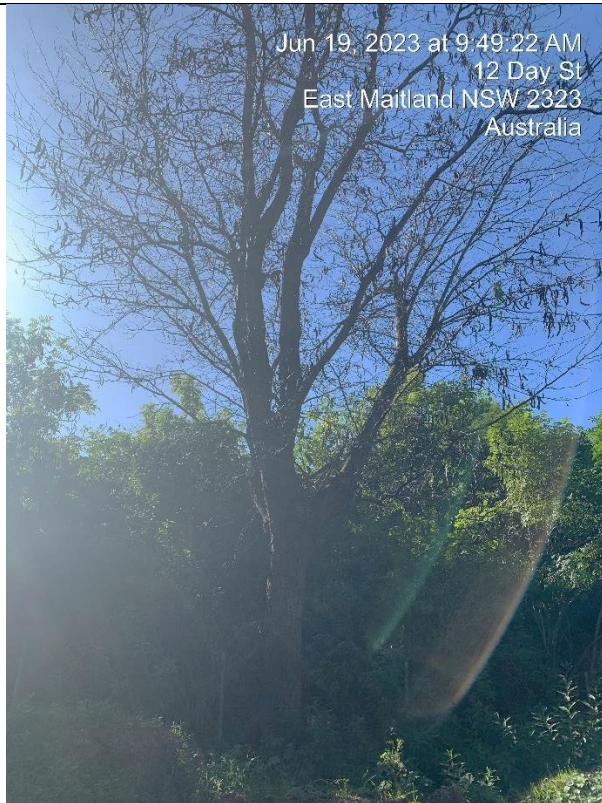

Tree 15
Liquidambar
Styraciflua
Liquidamber

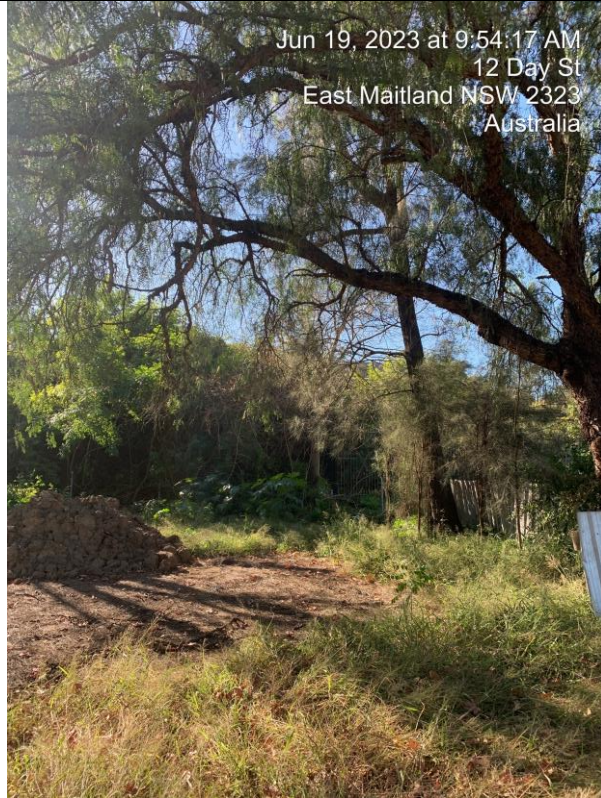

Jun 19, 2023 at 9:54:17 AM
12 Day St
East Maitland NSW 2323
Australia

Tree 16
Casuarina
glauca
Swamp Oak



Jun 19, 2023 at 9:49:47 AM
12 Day St
East Maitland NSW 2323
Australia


Tree 17
Schinus areira
Peppercorn



Tree 18
Liquidambar styraciflua
Liquidamber




Tree 19
Melia azedarach
White Cedar

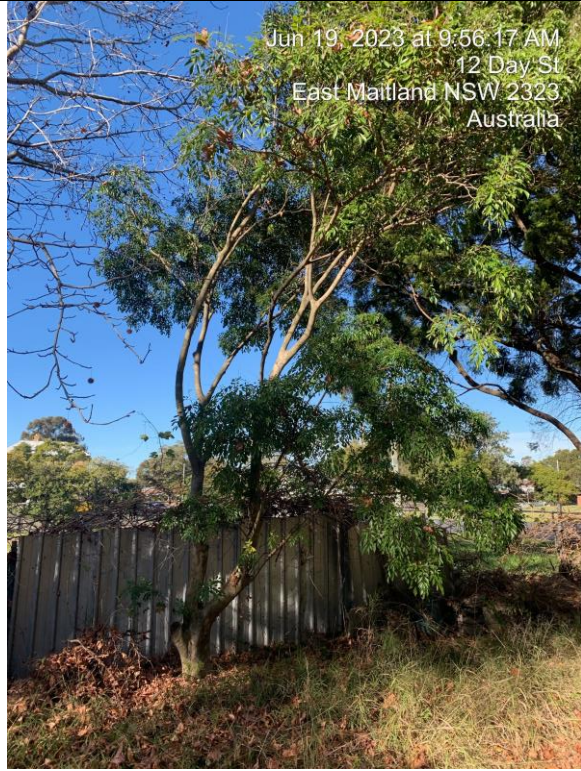

Tree 20
*Melaleuca
bracteata*
Revolution
Green



Tree 21
*Liquidambar
styraciflua*
Liquidamber

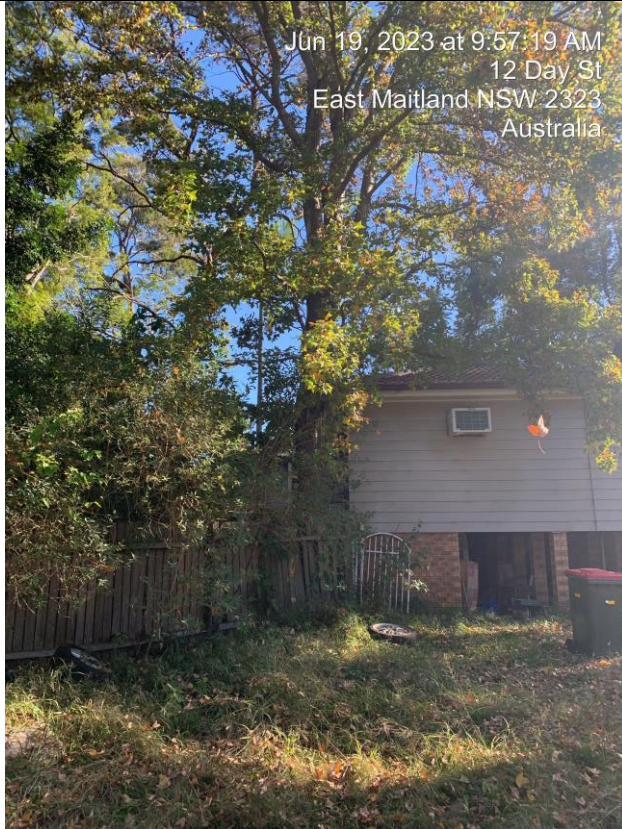


Tree 22
*Archontophoenix
Cunninghamiana*
Bangalow Palm




Tree 23
*Eucalyptus
nicholii*
Small Leaved
Peppermint




Tree 24
*Callistemon
viminalis*
Weeping
Bottlebrush

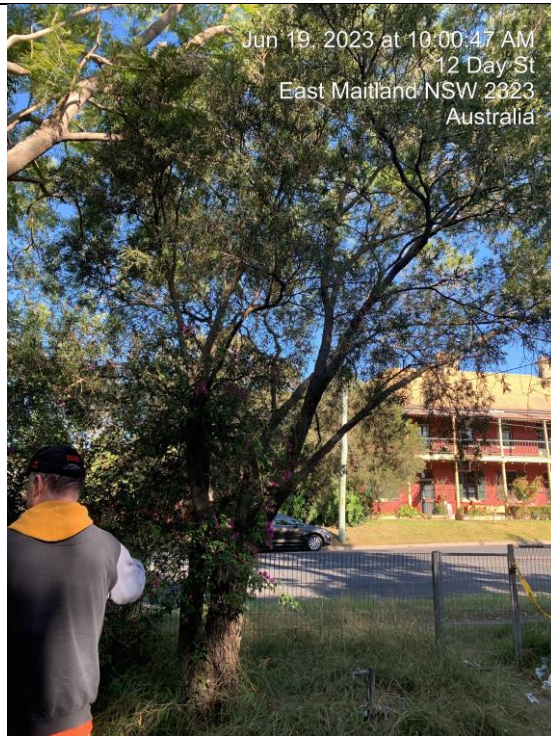

Tree 25
Jacaranda
mimosifolia
Jacaranda

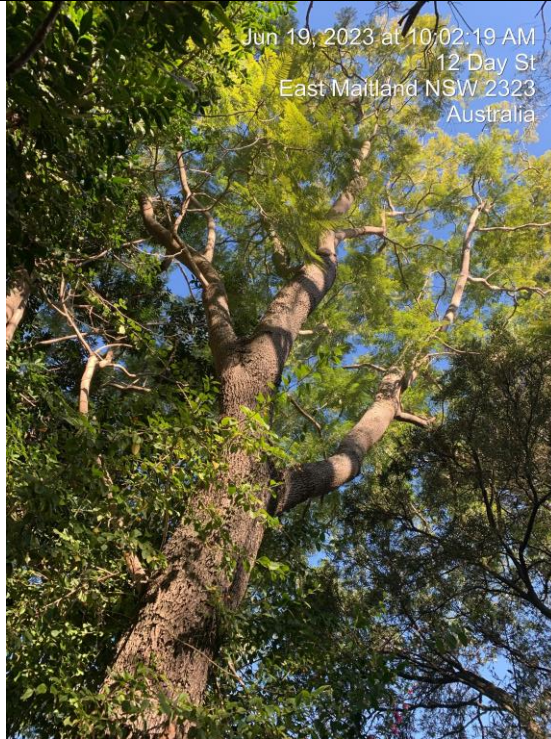


Tree 26
Harpephyllum
Caffrum
Kaffir Plum

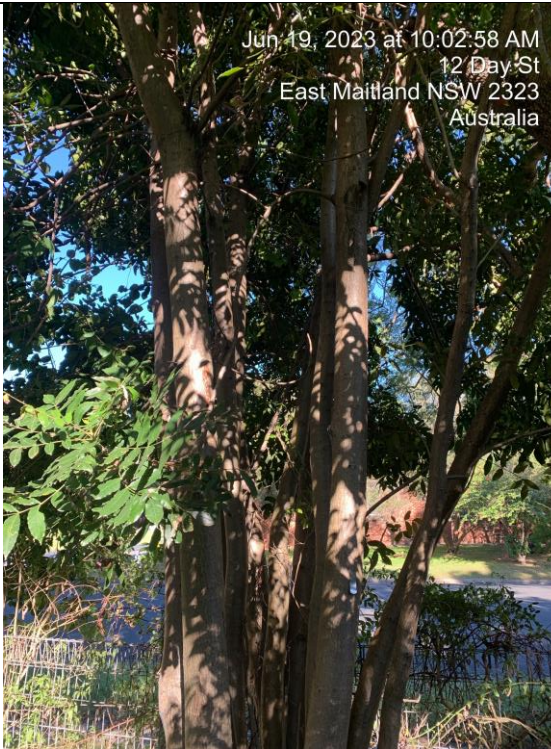

Tree 27
Grevillea robusta
Silky Oak



Tree 28
Morus nigra
Mulberry Tree

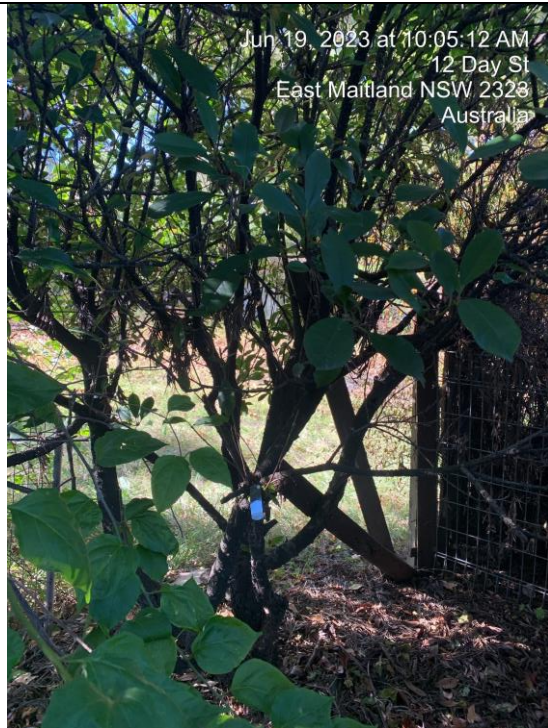

Appendix 3 - ULE Useful Life Expectancy (Barell 1995)

	1. Long	2. Medium	3. Short	4. Removal	5. Moved or replaced
	Trees that appeared to be retainable at the time of assessment for more than 40 years with an acceptable level of risk.	Trees that appeared to be retainable at the time of assessment for 15 - 40 years with an acceptable level of risk.	Trees that appeared to be retainable at the time of assessment for 5 - 15 years with an acceptable level of risk.	Trees that should be removed within the next 5 years	Trees, which can be reliably moved or replaced.
A	Structurally sound trees located in positions that can accommodate future growth.	Trees that may only live between 15 and 40 years.	Trees that may only live between 5 and 15 more years.	Dead, dying, suppressed or declining trees through disease or inhospitable conditions.	Small trees less than 5m in height.
B	Trees that could be made suitable for retention in the long term by remedial tree care.	Trees that may live for more than 40 years but would be removed for safety or nuisance reasons.	Trees that may live for more than 15 years but would be removed for safety or nuisance reasons.	Dangerous trees through instability or recent loss of adjacent trees.	Young trees less than 15 years old but over 5m in height.
C	Trees of special significance for historical, commemorative or rarity reasons that would warrant extraordinary efforts to secure their long-term retention.	Trees that may live for more than 40 years but would be removed to prevent interference with more suitable individuals or to provide space for new planting.	Trees that may live for more than 15 years but should be removed to prevent interference with more suitable individuals or to provide space for new planting.	Damaged trees through structural defects including cavities, decay, included bark, wounds or poor form.	Trees that have been pruned to artificially control growth.
D		Trees that could be made suitable for retention in the medium term by remedial tree care.	Trees that require substantial remedial tree care and are only suitable for retention in the short term.	Damaged trees that are clearly not safe to retain.	
E				Trees that may live for more than 5 years but should be removed to prevent interference with more suitable individuals or to provide space for new plantings.	
F				Trees that are damaging or may cause damage to existing structures within 5 years.	
G				Trees that will become dangerous after removal of other trees for reasons given in A) to F).	

Safe Use Life Expectancy (SULE)

SULE is the length of time an Arborist assesses an individual tree can be retained with an acceptable level of risk based on the information available at the time of inspection. SULE is not static and is closely related to tree health and the surrounding conditions. Alterations to the variables may result in changes in the SULE assessment. SULE may have to be reassessed if a significant amount of time passes from the initial inspection to the eventual development. Once a tree survey has been carried out (as described above) the Arborist would then estimate the remaining life expectancy. This can be difficult if it is not known how long a particular species may live for in a particular location, however, the exercise is very useful for categorising which trees have the best chance of long-term survival once construction is completed.

Categories for retention or removal.

The trees in each category could be colour coded both on site plans and on the ground. These categories are adapted and modified from BS5837:1991 and Barrell.

Category A:

Trees whose retention is most desirable; long safe useful life expectancy - retainable with an acceptable level of risk for more than 40 years+. Long category SULE.

- (i) Structurally sound trees of good form in positions that are compatible with the proposed development and where future growth can be accommodated.
- (ii) Trees for screening or softening the effect of existing structures in the near vicinity, or of particular visual importance to the locality.
- (iii) Trees of special significance for historical, commemorative or rarity reasons that would warrant extraordinary efforts to secure their long-term retention.

Category B:

Trees whose retention is desirable or that would be retainable with an acceptable level of risk for 15-40 years. Moderate category: Medium category SULE.

- (i) Trees that may only live for another 15-40 years.
- (ii) Trees that may live for more than 40 years but which have defects which may lead to their removal within this period.
- (iii) Trees which may live more than 40 years but which would be removed to allow the safe development of more suitable individuals.
- (iv) Storm damaged or defective trees which can be made suitable for retention in the medium term by remedial treatment.
- (v) Immature trees with potential to develop into the high category.

Category C:

Trees that could be retained or those with an acceptable level of risk for 5-15 years. Short category SULE.

- (i) Trees that may only live for 5-15 years.
- (ii) Trees that may live for more than 15 years but which have defects that would lead to their removal within this period.
- (iii) Trees that may live for more than 15 years but which would be removed to allow the safe development of more suitable individuals.
- (iv) Damaged or defective trees which warrant remedial work for their short-term retention.
- (v) Immature trees of no particular merit.

Category D:

Trees to be removed. Removal category SULE.

- (i) Dead trees.
- (ii) Unstable or structurally defective trees with a high hazard rating.
- (iii) Trees which will be impossible to retain or irreparably damaged by construction activities where no realistic compromise is possible.

Trees can be coded in reports and on-site plans e.g., Tree 15. *Ficus rubiginosa* Category B (ii).

Note: These assessments should be carried out by a suitable qualified and experienced Arborist. (Judy Fakes, 1996)

Survey:

Peter Castor and John Douglas have both made the point that some species deteriorate more quickly than others. That is, a SULE rating of 5-15 years might not be sensible for a species such as *Eucalyptus scoparia* which might only have a useful life of some 2 years from when it first shows signs of deterioration. *Eucalyptus nicholii* in Sydney might also fit into this category. Perhaps it is sensible to recommend the removal of a Chilean Willow as soon as it first displays borer damage. It would not be sensible to apply that standard to a *Eucalyptus saligna* (Sydney Blue Gum)

Safe Useful Lifespans

Depending on the pattern of decline (a distinction needs to be drawn between biological life and useful life).

<i>Acacia elata</i>	30-50, decline rapidly if lopped
<i>Acacia parramattensis / decurrens</i>	5-15 years
<i>Acacia binervia (glaucescens) (Costal Myall)</i>	30 – 50
<i>Acacia melanoxylon</i>	50-90 years
<i>Acer negundo</i>	30-50
<i>Acmena smithii</i>	40-70
<i>Agonis flexuosa</i>	30-50
<i>Angophora costata</i>	70-90 (400+ in the bush)
<i>Banksia integrifolia</i>	50-60
<i>Banksia serrata</i>	20-30
<i>Bauhinia galpini</i>	30-50
<i>Betula pendula</i>	7-15
<i>Brachychiton acerifolius</i>	50-70, 10 after lopping
<i>Callistemon viminalis</i>	25
<i>Calodendrum capense</i>	50-70
<i>Castanospermum australis</i>	70
<i>Celtis australis</i>	70
<i>Celtis occidentalis</i>	15
<i>Ceratopetalum gummiferum</i>	90 in the bush Rarely in gardens.
<i>Ceratopetalum apetalum</i>	20
<i>Cinnamomum camphora</i>	90
<i>Corimbya. maculata</i>	50-70
<i>Corimbya citriodora</i>	70-90
<i>Corimbya gummifera</i>	25, if in right location 50
<i>Corimbya. eximia</i>	25, if in right location 70
<i>Cupaniopsis anacardioides</i>	60
<i>Elaeocarpus reticulatus</i>	40
<i>Erythrina x sykesii</i>	15-60
<i>Erythrina crista-galli</i>	30-40
<i>Eucalyptus camaldulensis</i>	70-90
<i>Corimbya ficifolia</i>	15
<i>Eucalyptus globulus</i> subspecies <i>globulus</i>	15-35
<i>Eucalyptus globulus</i> subspecies <i>bicostata</i>	15.35
<i>Eucalyptus microcorys</i>	50-70
<i>Eucalyptus nicholii</i>	35 years
<i>Eucalyptus pilularis</i>	70-90 (100-200 In the bush)
<i>Eucalyptus saligna</i>	70-90 (100-200 In the bush)
<i>Eucalyptus tereticornis</i>	70-90 (150-200)
<i>Ficus macrophylla</i>	90-200
<i>Ficus microcarpa</i> var <i>hillii</i>	30-70 Plus
<i>Ficus rubiginosa</i>	70-200
<i>Fraxinus excelsior</i>	10-30
<i>Ginkgo Biloba</i>	10-30
<i>Grevillea robusta</i>	35 years, 50 occasionally
<i>Jacaranda mimosifolia</i>	50-70 Plus

Lagerstroemia indica	30-90
Lagunaria patersonia	30-90
Liquidambar styraciflua	30-90
Lophostemon confertus	70 plus
Magnolia grandiflora	70 plus
Melaleuca quinquenervia	70 plus
Melia azedarach	50
Metrosideros excelsior	5-30, 50
Michelia figo	10-20
Morus nigra	50
Olea africana	70
Pistacia chinensis	40
Pittosporum undulatum	25-50
Platanus x hybrida	90 plus
Populus nigra	40- 70 years
Prunus serratifolia	5-35 years
Pyrus calleryana	30-50
Quercus robur	70-160
Robinia pseudoacacia	25-50 years
Salix species	7 Chilean, 30-50 years babylonica, fragilis
Sapium sebiferum	Up to 60
Schinus areira	70
Stenocarpus sinuatus	50
Syncarpia glomulifera	90
Syzygium parvifolia	90
Ulmus	70
Virgilia hupehensis	7 years

References:

Barrell, J.D. (1993) Pre-planning Tree Surveys: Safe Useful Life expectancy in the Natural Progression. Arboricultural Journal 17:pp33-46

Barrell, J.D. (1995) Pre-development Tree Assessment in Trees and Building Sites, (Ed) G.W. Watson and D. Neely, International Society of Arboriculture, Savoy, Illinois.

British Standard 5837 (1991) Guide for Trees in relation to Construction, BSI.

Fakes J.A, (1996) Summary of SULE (unpublished)

Hewett P, (1996) Personal communication.

Matheny, N.P & Clark, J.R. (1994) A Photographic Guide to the evaluation of Hazard Trees in Urban Areas, 2nd edition, International Society of Arboriculture, Savoy, Illinois.

Appendix E - Significance of a Tree, Assessment Rating System

(STARS) IACA, Australia

1. High Significance in landscape

- The tree is in good condition and good vigour;
- The tree has a form typical for the species;
- The tree is a remnant or is a planted locally indigenous specimen and/or is rare or uncommon in the local area or of botanical interest or of substantial age;
- The tree is listed as a Heritage Item, Threatened Species or part of an Endangered ecological community or listed on Councils significant Tree Register;
- The tree is visually prominent and visible from a considerable distance when viewed from most directions within the landscape due to its size and scale and makes a positive contribution to the local amenity;
- The tree supports social and cultural sentiments or spiritual associations, reflected by the broader population or community group or has commemorative values;
- The tree's growth is unrestricted by above and below ground influences, supporting its ability to reach dimensions typical for the taxa in situ - tree is appropriate to the site conditions.

2. Medium Significance in landscape

- The tree is in fair-good condition and good or low vigour;
- The tree has form typical or atypical of the species;
- The tree is a planted locally indigenous or a common species with its taxa commonly planted in the local area
- The tree is visible from surrounding properties, although not visually prominent as partially obstructed by other vegetation or buildings when viewed from the street,
- The tree provides a fair contribution to the visual character and amenity of the local area,
- The tree's growth is moderately restricted by above or below ground influences, reducing its ability to reach dimensions typical for the taxa in situ.

3. Low Significance in landscape

- The tree is in fair-poor condition and good or low vigour;
- The tree has form atypical of the species;
- The tree is not visible or is partly visible from surrounding properties as obstructed by other vegetation or buildings,
- The tree provides a minor contribution or has a negative impact on the visual character and amenity of the local area,
- The tree is a young specimen which may or may not have reached dimension to be protected by local Tree Preservation orders or similar protection mechanisms and can easily be replaced with a suitable specimen,
- The tree's growth is severely restricted by above or below ground influences, unlikely to reach dimensions typical for the taxa in situ - tree is inappropriate to the site conditions,
- The tree is listed as exempt under the provisions of the local Council Tree Preservation Order or similar protection mechanisms,
- The tree has a wound or defect that has potential to become structurally unsound.
- Environmental Pest / Noxious Weed Species
- The tree is an Environmental Pest Species due to its invasiveness or poisonous/ allergenic properties,
- The tree is a declared noxious weed by legislation.
- Hazardous/Irreversible Decline
- The tree is structurally unsound and/or unstable and is considered potentially dangerous,
- The tree is dead, or is in irreversible decline, or has the potential to fail or collapse in full or part in the immediate to short term.

The tree is to have a minimum of three (3) criteria in a category to be classified in that group.

Note: The assessment criteria are for individual trees only, however, can be applied to a monocultural stand in its entirety e.g.

Significance of a Tree, Assessment Rating System cont.

Landscape Significance						
		1. High	2. Medium	3. Low		
		Significance in landscape			Environmental Pest / Noxious Weed Species	Hazardous / Irreversible Decline
Estimated Life Expectancy	1. Long >40 years					
	2. Medium 15-40 years					
	3. Short <1-15 years					
	Dead					
Legend For Matrix Assessment						
	<p>Priority for Retention (High) – These trees are considered important for retention and should be retained and protected. Design modification or re-location of building/s should be considered to accommodate the setbacks as prescribed by the Australian Standard AS4980 Protection of trees on development sites. Tree sensitive construction measures must be implemented e.g. pier and beam etc if works are to proceed within the Tree Protection Zone.</p>					
	<p>Consider for Retention (Medium) – These trees may be retained and protected. These are considered less critical; however their retention should remain priority with removal considered only if adversely affecting the proposed building/works and all other alternatives have been considered and exhausted.</p>					
	<p>Consider for Removal (Low) – These trees are not considered important for retention, nor require special works or design modification to be implemented for their retention.</p>					
	<p>Priority for Removal – These trees are considered hazardous, or in irreversible decline, or weeds and should be removed irrespective of development.</p>					



PROPOSED COMMERCIAL DEVELOPMENT
 AT 10-14 DAY STREET, EAST MAITLAND
 CLIENT: LANTREY
 TITLE: SITE PLAN
 DATE: 23/03/2024
 SHEET 2 OF 2
 1027 DP 1207496

SORENSEN
 DESIGN & PLANNING

CONTACT US
 111-2283374
 111-2283374
 111-2283374

7015 DP 9395

PROPOSED SITE PLAN
 1:200

4i Design Meters

bdaa NATIONAL DESIGN AWARDS
 BUILDING DESIGNERS ASSOCIATION OF AUSTRALIA

HIA HIA NSW

AWARDS 2022 BUILDING DESIGNERS ASSOCIATION OF AUSTRALIA

Appendix 5 - Brief Qualifications and Experience of Mark Bury

- 1. Qualifications:** Diploma of Horticulture/Arboriculture 2005, Advanced Certificate of Management 1995, Graduate Certificate in Parks Management UTS 2001. Advanced Certificate Horticulture TAFE 1986, Hadlington Certificate of Tree Care 1995 Licensed QTRA Practitioner since 2006. International Society of Arboriculture Tree Risk Assessment Qualification 2014, Completed refresher Course in 2018 and Licensed till 2024 International Society of Arboriculture Certified Arborist 2014 Licensed till 2020, International Society of Arboriculture Certified Municipal Specialist 2015 Licensed till 2020, currently studying International Society of Arboriculture Board Master Arborist Course
- 2. Practical experience:** Twenty-Seven (27) years' experience as a consulting arborist, 20 years' experience in Local Government as a consulting arborist. A Founding member of the Institute of Australian Consulting Arborist (Resigned 2006) and The Local Government Tree Resources Group which I was Secretary of in 1995.
- 3. Continuing professional development:** Member of International Society of Arboriculture (AU0345A). Member of Australian Institute of Horticulture (MXB0615), attended courses by Jeremy Barrell and Claus Mattek. I attended the update of QTRA certification March 2015 and completed course in Visual Tree Assessment in 2015 and Visual Tree Assessment and Estimating the probability of failure in 2015.
- 4. Relevant experience** Twenty-Seven (27) Years experience as a consulting arborist and Twenty years' experience in tree management in local government. Twenty (27) years' experience in Local Government assessing development applications in regards to tree management issues. (Councils; Warringah, North Sydney, Mosman, Manly, Ashfield, Pittwater, Marrickville and Hornsby).

With my qualifications and experience I am an AQF 5. Furthermore, I have written and published books on Trees and Asset Management, Trees and Real Estate, Planning and Trees and Inherent Failure Patterns of Trees in the Greater Sydney Area.

I have also been a high-Level Asset Manager in Local Government for 10 years and have carried out numerous courses in asset management and risk management and developed Council Budgets in this area for a number of years.

I also have lectured at UTS on Asset Management. I have worked in the Industry for 41 years and have carried out major Asset management inventories including trees for large Local Government Areas and developed financial and operations plans to manage assets. Furthermore, I have developed, written and implemented asset tree master plans for Ashfield, Pittwater, Hornsby and Marrickville Councils.

International Society of Arboriculture Continuing Education Units Completed 2014, 2015 and 2016

Tree Risk-Strategies for Preserving Heritage Trees
Tree Risk-Mitigation and Reporting
Tree Risk-Structural Defects and Conditions
Tree Risk-Tree Load: Concept
Tree Risk—Loads and Growth Response
Tree Risk-Levels of Tree Risk Assessment
Tree Risk- Sap Rot
Tree Risk- Anchorage: Root Plate Resistance to Failure
Tree Risk- Indicators of Decay in Urban Trees
Tree Risk- Visual Inspection Prior to Dismantling
Urban Forestry-Wildfire and the Role of the Arborist
Urban Forestry-Managing Trees during Construction Part 1 and 2
Urban Forestry-Tree Risk Assessment: A Foundation
Urban Forestry-Tree Inventories Part 1 and Part 2
Trees & Their Environment- Fertilizing Trees & Shrubs Part 1 and Part 2
Urban Forestry-Root Management Challenges on Urban Sites
Urban Forestry-Challenges for the Built Environment
Urban Forestry - The Benefit of Trees
Urban Forestry- Root Planting Friendly Site Design
Urban Forestry- Root Management Challenges on Urban Sites
Urban Forestry- Tree Inventories Part 1
Urban Forestry- Tree Inventories Part 2
Urban Forestry- Tree Risk Assessment a Foundation
Urban Forestry- Managing Trees during Construction Parts 1 and 2
Urban Forestry- Wildfire and the Role of the Arborist
Trees & Their Environment- Soil Properties: Part 1 and Part 2
Trees & Their Environment- Fertilizing Trees & Shrubs Part 1 and Part 2
Trees & Their Environment- Analyse Before You Fertilize
Trees & Their Environment- Back to Basics: Tree Fertilization
Trees & Their Environment- Slow or Controlled Release Fertilizers
Tree Maintenance- Trees & Lightning
Tree Maintenance- Cabling
Tree Maintenance- Pollarding: What Was Old Is New Again
Tree Maintenance- Why Utilities "V-Out" Trees
Tree Maintenance- Pruning Trees Part 1: Principles, Objectives & Pruning Types
Tree Maintenance- Pruning Trees Part 2: How, Where and How Much
Plant Health Care- Plant Health Care
Plant Health Care- Maintaining Tree and Turf Associations
Plant Health Care- Preserving Trees during the Construction Process
Plant Health Care- Mulch
Plant Health Care- Preserving trees during the Construction Process
Plant Health Care- Trees v Turf
Plant Health Care- Resource Allocation Trade Off
Plant Health Care- Root System Care
Safe Working Practices –Innovations in Climbing Techniques and Equipment
Safe Working Practices- Basic Chain Saw Maintenance
Safe Working Practices- Felling Techniques
Safe Working Practices- Engineering Concepts for Arborists
Safe Working Practices- Tree Removals
Safe Working Practices- Chain Saw Cutting Techniques
Tree Science-Palms just not for the Tropics
Tree Science-Damage and Diagnosis Steps to Proper Diagnosis
Tree Science- Plant Traits that Resemble Abiotic Disorders
Tree Science- Adventitious Roots Occurrence and Management in Trees
Tree Science- Cool Trees Surviving Cold Temperatures
Tree Science- Identifying Wood Decay and Wood Decay Fungi in Urban Trees
Tree Science- How Pests use Bark or Wood as Food
Tree Science- How trees get to fat

Tree Science- Kissing under the Mistletoe
Biology-Tree Failure Risk Evaluations
Biology-Tree Growth Rings Formation and Form
Biology- Regulating Tree Growth Keeping the Green Side Up
Biology- How Wind Affects Trees
Biology- Allelopathy in Trees
Biology- Fantasy Facts and Fall Colour
Biology- Blowing in the Wind
Biology-Tree Physiology
Biology-Basic Woody Plant Biology
Diagnosis and Treatment- Plant Health Care and the Diagnostic Process
Diagnosis and Treatment- Want to be a Better Plant Diagnostician
Diagnosis and Treatment- Diagnosing Disease Problems on Trees
Diagnosis and Treatment- How Weather Influences Insect and Mite Populations
Diagnosis and Treatment- Understanding and Diagnosing Scale Insects
Diagnosis and Treatment- Surefire Rules of Diagnosis
Diagnosis and Treatment- Diagnosing Abiotic Disorders
Tree Selection and Planting- A plant by any Other Name
Tree Selection and Planting- Installation and Establishment of Trees and Shrubs
Tree Selection and Planting- Ten Keys to Plant and Site Selection
Tree Selection and Planting- Tree Transplanting
Tree Selection and Planting- Tree Transplanting and Establishment
Tree Selection and Planting- Post Planting Maintenance of Trees and Shrubs
Tree Selection and Planting- Tree Trunk Protection
Tree Selection and Planting- Siting Selecting and Planting Problems
Tree Selection and Planting- Girdling Root Formation in Landscape Trees
Tree Selection and Planting- Right Tree, Right Location
Tree Selection and Planting- Dendrology and Taxonomy
Tree and Development
The Landscape below Ground
General- Arborist Equipment Study Program

**International Society of Arboriculture
Continuing Education Units Completed 2017**

Root Pruning Part 2
Palms: Woody Giants of the Monocots Part 2
Biology and Assessment of Callus and Woundwood
Managing Soils That Support Urban Trees Part 1
Palms: Woody Giants of the Monocots Part 1
Tree Injection Part 1
Plant Health Care and Diagnostics
Root Management: An Introduction
Bark Traits are Important to Tree health and Survival
The Cost of Not Maintaining the Urban Forest
Flood Tolerant Trees in the Urban Sphere
Integrated Vegetation Management
Advanced Twig Anatomy
Tree Lightning Protection Systems Part 2
Tree Safety

Continuing Education Units Completed 2018

Managing Soils That Support Urban Trees Part Two
Preserving Trees During Construction
Arborists and Wildlife Retaining Trees for Wildlife Habitat
Understanding Tree Responses to Abiotic and Biotic Stress Complexes
Storm Response Part 1 Types of Storms and Their Effects on Trees
Storm Response Part 2 Preparing for Safe and Effective Responses to Storms
Storm Response Part 3 Effective Response to Large and Small –Scale Storm Emergencies
Storm Response Part 4 Unique Aspects :Keeping Employees Safe, Talking to the Media, Saving Damaged Trees, Winding Down, and Lessons Learned
Tree Inventories
Understanding Tree Responses to Stress
Tree Lightning Protection Systems (Part One)
Root Management Challenges on Urban Sites Achieving a Healthy Root Crown Balance
Root Management Challenges on Urban Sites Human Intervention in Root Development
Tree Risk Assessment Structural Defects and Conditions that Affect the Likelihood of Failure
Basic Tree Plumbing Translocation
Tree Injection (Part 2)
Advanced Twig Anatomy Starting Little to Get Big (Part 1)
Biology and Identification of Fungi
Urban Tree Inventory Data
Comparison of Tree Conditions
Roadside Soil Enhancement
Tree Species as Tools for Biodiversity and Phytoremediation
Homeowner Interactions with Residential Trees In Urban Areas
Does Modulus of Elasticity Vary
Long Term Fluctuations in Water Status and Crown Die Back
Maximum Size Expectations in Designed Space
The Arboricultural and Economic Benefits of Formative Pruning
Protecting Your Assets
The Management of Tree Roots in Urban and Suburban Settings
The Costs on Not Maintaining and Maintaining Urban Forest
Tree Performance during Early Years and Future Performance
Effects of Urbanisation on Tree Species Composition and Structure
Things Arborist Should Know about Soil Microbes
Wood Chips and Compost Improve Compacted Urban Soil
The Linear Index of Tree Appraisal Model
The Influence of Abiotic factors on street tree condition and mortality in a commercial retail Streetscape
Water Management Strategies in Dry Environments
Comparison of Shading Effectiveness
Vines and Utility Arboriculture
Vegetation and Storm Water Run Off

International Society of Arboriculture Continuing Education Units Completed 2021

Wood Decay Fungi Identification and Management

Nursery Production Systems

Core Concepts of Plant Appraisal

Plant Appraisal Data Collection (Part One)

Plant Appraisal Data Collection (Part Two)

The Cost Approach: Methods, Techniques, and Depreciation

Pruning Systems: Best Management Practices

Pruning Cuts: Best Management Practices—Tree Pruning, 3rd Edition

Applications of Biochar for Arboriculture

Arboricultural Operation Safety Standards: A Global Perspective, Part 2

Reducing the Tension Between Promoting Tree Diversity Versus Planting Natives

The Surprising Benefits of Biodiversity

Tree Defect Identification

The Case of the Lamentable

Reports: The Write Way

The Case of the Ailing Avenues

The Case of the Plane Plan

The Case of the Eloquent Elephant

The Case of the Redwood Roots

The Case of the Defiant Ficus

New Zealand Tree Project

The Case of the Movie Star Trees

The Case of the Mysterious Sugar Maple

Understanding Fall Protection

What Does Science Say About Pruning Mature Trees

The Case of the Beach House Beech

The Case of the Perished Pine

Tree-Size Variables for Appraisal Methods

Insect Vectors and Their Role in Disease Transmission Part II

The Case of the Curious Conifer

The Case of the Confounding Clues

The Case of the Frizzled Fronds

The Case of the Lonely Lashing Leader

The Case of the Lamentable Maples

The Reforestation of Chihuahua Mexico

The Case of Justine's Junipers

Wildlife Retention

The Case of the Quercus Calamity

The Case of the Rooftop Restaurant

The Case of the Avocado Aficionado

The Case of the Midsummer Misery

The Case of the Baffling Butternut

The Case of the Beach House Beech

The Case of the Terrifying Twister

The Case of the Perished Pine

Appendix 6 - Construction Impact Statement

(Trees that are less than 100mm in both Diameter at Breast Height and Diameter at Base Height have a standard TPZ of 2 metres and SRZ of 1.5 metres) All calculations were calculated using the

Tree World online calculator. Tree incursions were calculated using CAD tools.



Online Calculator for TPZs and SRZs as per AS4970-2009

Calculate the TPZs (tree protection zones) and SRZs (structural root zones) as per the Australian Standard AS4970 quickly and easily using this calculator.
Ensure all values entered are in metres (m), for example 6.25m is entered not 250cm.
TPZs enter the DBH (diameter at breast height) which is the diameter of the tree at 1.4m above grade.
SRZs enter the diameter just above the trunk flare or buttresses.

Tree 1 – *Eucalyptus paniculata* Grey Ironbark

The proposed excavations will impact the (TPZ) Tree Protection Zone of the tree

The tree has a dbh of 700 mm

Tree Protection Zone = 12 X DBH (700mm) = 8.4 Metres

Tree has a diameter at base height of 850mm

Structural Root Zone SRZ Radius = $(850 \times 70) 0.42 \times 64 = 3.1$ Metres

Incursion 8.4 Metres

Radius 8.4 Metres

The tree will be affected by the proposed excavation for the development. The tree's TPZ will have an inclusion of 50% (Segment Area (110.83m²) / Total Circle Area (221.67m²) Area x 100 which is not acceptable as the largest inclusion allowed for is normally 10%, for the proposed development on the site.

The tree will be affected by the proposed excavation for the development. The overland water flow patterns of the tree on the site will change significantly and the soil environment of the tree will be significantly affected. The tree will have to be removed to establish a bushfire tree protection zone

Gradient of Impacts

Significant Level of Impact

0% of root zone impacted – no impact of significance

0 to 10% of root zone impacted – low level of impact

10 to 15% of root zone impacted – low to moderate level of impact

15 to 20% of root zone impacted – moderate level of impact
20 to 25% of root zone impacted – moderate to high level of impact
25 to 35% of root zone impacted – high level of impact
>35% of root zone impacted – significant level of impact

Used with permission of Landscape Matrix Pty Ltd.

Significance for Visual Effects - Large Small

Significance Matrix for effects on Landscape Character and Features- Large Local

Tree 2 – *Ficus benjamina* Weeping Fig

The proposed excavations will impact the (TPZ) Tree Protection Zone of the tree

The tree has a dbh of 850 mm

Tree Protection Zone = 12 X DBH (850mm) = 10.2 Metres

Tree has a diameter at base height of 980mm

Structural Root Zone SRZ Radius = $(980 \times 70)^{0.42} \times 0.64 = 3.3$ Metres

Incursion 10.2 Metres

Radius 10.2 Metres

The tree will be affected by the proposed excavation for the development. The tree's TPZ will have an inclusion of 50% (Segment Area (163.43m²) / Total Circle Area (326.85m²) Area x 100 which is not acceptable as the largest inclusion allowed for is normally 10%, for the proposed development on the site.

The tree will be affected by the proposed excavation for the development. The overland water flow patterns of the tree on the site will change significantly and the soil environment of the tree will be significantly affected. The tree will have to be removed to establish a bushfire tree protection zone

Gradient of Impacts

Significant Level of Impact

0% of root zone impacted – no impact of significance

0 to 10% of root zone impacted – low level of impact

10 to 15% of root zone impacted – low to moderate level of impact

15 to 20% of root zone impacted – moderate level of impact

20 to 25% of root zone impacted – moderate to high level of impact

25 to 35% of root zone impacted – high level of impact

>35% of root zone impacted – significant level of impact

Used with permission of Landscape Matrix Pty Ltd.

Significance for Visual Effects - Large Small

Significance Matrix for effects on Landscape Character and Features- Large Local

Tree 3– *Eucalyptus paniculata* Grey Ironbark

The proposed excavations will impact the (TPZ) Tree Protection Zone of the tree

The tree has a dbh of 900 mm

Tree Protection Zone = 12 X DBH (900mm) = 10.8 Metres

Tree has a diameter at base height of 1100mm

Structural Root Zone SRZ Radius = $(1100 \times 70)^{0.42} \times 0.64 = 3.2$ Metres

Incursion 10.8 Metres

Radius 10.8 Metres

The tree will be affected by the proposed excavation for the development. The tree's TPZ will have an inclusion of 50% (Segment Area (183.22m²) / Total Circle Area (366.44m²) Area x 100 which is not acceptable as the largest inclusion allowed for is normally 10%, for the proposed development on the site.

The tree will be affected by the proposed excavation for the development. The overland water flow patterns of the tree on the site will change significantly and the soil environment of the tree will be significantly affected. The tree will have to be removed to establish a bushfire tree protection zone

Gradient of Impacts

Significant Level of Impact

- 0% of root zone impacted – no impact of significance
- 0 to 10% of root zone impacted – low level of impact
- 10 to 15% of root zone impacted – low to moderate level of impact
- 15 to 20% of root zone impacted – moderate level of impact
- 20 to 25% of root zone impacted – moderate to high level of impact
- 25 to 35% of root zone impacted – high level of impact
- >35% of root zone impacted – significant level of impact

Used with permission of Landscape Matrix Pty Ltd.

Significance for Visual Effects - Large Small

Significance Matrix for effects on Landscape Character and Features- Large Local

Tree 4– *Jacaranda mimosifolia* Jacaranda

The proposed excavations will impact the (TPZ) Tree Protection Zone of the tree

The tree has a dbh of 600 mm

Tree Protection Zone = 12 X DBH (600mm) = 7.2 Metres

Tree has a diameter at base height of 660mm

Structural Root Zone SRZ Radius = $(660 \times 70)^{0.42} \times 0.64 = 2.7$ Metres

Incursion 7.2 Metres

Radius 7.2 Metres

The tree will be affected by the proposed excavation for the development. The tree's TPZ will have an inclusion of 50% (Segment Area (81.43m²) / Total Circle Area (162.86m²) Area x 100 which is not acceptable as the largest inclusion allowed for is normally 10%, for the proposed development on the site.

The tree will be affected by the proposed excavation for the development. The overland water flow patterns of the tree on the site will change significantly and the soil environment of the tree will be significantly affected. The tree will have to be removed to establish a bushfire tree protection zone

Gradient of Impacts

Significant Level of Impact

- 0% of root zone impacted – no impact of significance
- 0 to 10% of root zone impacted – low level of impact
- 10 to 15% of root zone impacted – low to moderate level of impact
- 15 to 20% of root zone impacted – moderate level of impact
- 20 to 25% of root zone impacted – moderate to high level of impact
- 25 to 35% of root zone impacted – high level of impact
- >35% of root zone impacted – significant level of impact

Used with permission of Landscape Matrix Pty Ltd.

Significance for Visual Effects - Large Small

Significance Matrix for effects on Landscape Character and Features- Large Local

Tree 5– *Jacaranda mimosifolia* Jacaranda

The proposed excavations will impact the (TPZ) Tree Protection Zone of the tree

The tree has a dbh of 750 mm

Tree Protection Zone = 12 X DBH (750mm) = 9 Metres

Tree has a diameter at base height of 810mm

Structural Root Zone SRZ Radius = $(810 \times 70)^{0.42} \times 0.64 = 3$ Metres

Incursion 9 Metres

Radius 9 Metres

The tree will be affected by the proposed excavation for the development. The tree's TPZ will have an inclusion of 50% (Segment Area (121.64m²) / Total Circle Area (243.28m²) Area x 100 which is not acceptable as the largest inclusion allowed for is normally 10%, for the proposed development on the site.

The tree will be affected by the proposed excavation for the development. The overland water flow patterns of the tree on the site will change significantly and the soil environment of the tree will be significantly affected. The tree will have to be removed to establish a bushfire tree protection zone

Gradient of Impacts

Significant Level of Impact

- 0% of root zone impacted – no impact of significance
- 0 to 10% of root zone impacted – low level of impact
- 10 to 15% of root zone impacted – low to moderate level of impact
- 15 to 20% of root zone impacted – moderate level of impact
- 20 to 25% of root zone impacted – moderate to high level of impact
- 25 to 35% of root zone impacted – high level of impact
- >35% of root zone impacted – significant level of impact

Used with permission of Landscape Matrix Pty Ltd.

Significance for Visual Effects - Large Small

Significance Matrix for effects on Landscape Character and Features- Large Local

Tree 6 – *Cinnamomum camphora* Camphorlaurel

The proposed excavations will impact the (TPZ) Tree Protection Zone of the tree

The tree has a dbh of 750 mm

Tree Protection Zone = 12 X DBH (750mm) = 9 Metres

Tree has a diameter at base height of 890mm

Structural Root Zone SRZ Radius = $(890 \times 70)^{0.42} \times 0.64 = 5.2$ Metres

Incursion 9 Metres

Radius 9 Metres

The tree will be affected by the proposed excavation for the development. The tree's TPZ will have an inclusion of 50% (Segment Area (127.24m²) / Total Circle Area (254.47m²) Area x 100 which is not acceptable as the largest inclusion allowed for is normally 10%, for the proposed development on the site.

The tree will be affected by the proposed excavation for the development. The overland water flow patterns of the tree on the site will change significantly and the soil environment of the tree will be significantly affected. The tree will have to be removed to establish a bushfire tree protection zone

Gradient of Impacts

Significant Level of Impact

- 0% of root zone impacted – no impact of significance
- 0 to 10% of root zone impacted – low level of impact
- 10 to 15% of root zone impacted – low to moderate level of impact
- 15 to 20% of root zone impacted – moderate level of impact
- 20 to 25% of root zone impacted – moderate to high level of impact
- 25 to 35% of root zone impacted – high level of impact
- >35% of root zone impacted – significant level of impact

Used with permission of Landscape Matrix Pty Ltd.

Significance for Visual Effects - Large Small

Significance Matrix for effects on Landscape Character and Features- Large Local

Tree 7 – *Cinnamomum camphora* Camphorlaurel

The proposed excavations will impact the (TPZ) Tree Protection Zone of the tree

The tree has a dbh of 700 mm

Tree Protection Zone = 12 X DBH (700mm) = 8.4 Metres

Tree has a diameter at base height of 840mm

Structural Root Zone SRZ Radius = $(840 \times 70) \times 0.42 \times 0.64 = 3.1$ Metres

Incursion 9.4 Metres

Radius 9.4 Metres

The tree will be affected by the proposed excavation for the development. The tree's TPZ will have an inclusion of 50% (Segment Area (110.84m²) / Total Circle Area (221.67m²) Area x 100 which is not acceptable as the largest inclusion allowed for is normally 10%, for the proposed development on the site.

The tree will be affected by the proposed excavation for the development. The overland water flow patterns of the tree on the site will change significantly and the soil environment of the tree will be significantly affected. The tree will have to be removed to establish a bushfire tree protection zone

Gradient of Impacts

Significant Level of Impact

- 0% of root zone impacted – no impact of significance
- 0 to 10% of root zone impacted – low level of impact
- 10 to 15% of root zone impacted – low to moderate level of impact
- 15 to 20% of root zone impacted – moderate level of impact
- 20 to 25% of root zone impacted – moderate to high level of impact
- 25 to 35% of root zone impacted – high level of impact
- >35% of root zone impacted – significant level of impact

Used with permission of Landscape Matrix Pty Ltd.

Significance for Visual Effects - Large Small

Significance Matrix for effects on Landscape Character and Features- Large Local

Tree 8– *Callistemon viminalis* Weeping Bottlebrush

The proposed excavations will impact the (TPZ) Tree Protection Zone of the tree

The tree has a dbh of 200 mm

Tree Protection Zone = 12 X DBH (200mm) = 2.4 Metres

Tree has a diameter at base height of 200mm

Structural Root Zone SRZ Radius = $(200 \times 70)^{0.42} \times 0.64 = 1.7$ Metres

Incursion 2.4 Metres

Radius 2.4 Metres

The tree will be affected by the proposed excavation for the development. The tree's TPZ will have an inclusion of 50% (Segment Area (9.05m²) / Total Circle Area (18.10m²) Area x 100 which is not acceptable as the largest inclusion allowed for is normally 10%, for the proposed development on the site.

The tree will be affected by the proposed excavation for the development. The overland water flow patterns of the tree on the site will change significantly and the soil environment of the tree will be significantly affected. The tree will have to be removed to establish a bushfire tree protection zone

Gradient of Impacts

Significant Level of Impact

- 0% of root zone impacted – no impact of significance
- 0 to 10% of root zone impacted – low level of impact
- 10 to 15% of root zone impacted – low to moderate level of impact
- 15 to 20% of root zone impacted – moderate level of impact
- 20 to 25% of root zone impacted – moderate to high level of impact
- 25 to 35% of root zone impacted – high level of impact
- >35% of root zone impacted – significant level of impact

Used with permission of Landscape Matrix Pty Ltd.

Significance for Visual Effects - Small Small

Significance Matrix for effects on Landscape Character and Features- Small Local

Trees 9 – *Jacaranda mimosifolia* Jacaranda

The proposed excavations will impact the (TPZ) Tree Protection Zone of the tree

The tree has a dbh of 610 mm

Tree Protection Zone = 12 X DBH (610mm) = 7.3 Metres

Tree has a diameter at base height of 740mm

Structural Root Zone SRZ Radius = $(740 \times 70) \times 0.42 \times 0.64 = 2.9$ Metres

Incursion 7.3 Metres

Radius 7.3 Metres

The tree will be affected by the proposed excavation for the development. The tree's TPZ will have an inclusion of 50% (Segment Area (83.71m²) / Total Circle Area (167.42m²) Area x 100 which is not acceptable as the largest inclusion allowed for is normally 10%, for the proposed development on the site.

The tree will be affected by the proposed excavation for the development. The overland water flow patterns of the tree on the site will change significantly and the soil environment of the tree will be significantly affected. The tree will have to be removed to establish a bushfire tree protection zone

Gradient of Impacts

Significant Level of Impact

0% of root zone impacted – no impact of significance

0 to 10% of root zone impacted – low level of impact

10 to 15% of root zone impacted – low to moderate level of impact

15 to 20% of root zone impacted – moderate level of impact

20 to 25% of root zone impacted – moderate to high level of impact

25 to 35% of root zone impacted – high level of impact

>35% of root zone impacted – significant level of impact

Used with permission of Landscape Matrix Pty Ltd.

Significance for Visual Effects - Large Small

Significance Matrix for effects on Landscape Character and Features- Large Local

Tree 10 - *Eucalyptus paniculata* Grey Ironbark

N/A Regrown Stump

Tree 11 – *Pittosporum undulatum* Sweet Pittosporum

The proposed excavations will impact the (TPZ) Tree Protection Zone of the tree

The tree has a dbh of 300 mm

Tree Protection Zone = 12 X DBH (300mm) = 3.6 Metres

Tree has a diameter at base height of 300mm

Structural Root Zone SRZ Radius = $(300 \times 70)^{0.42} \times 0.64 = 2$ Metres

Incursion 3.6 Metres

Radius 3.6 Metres

The tree will be affected by the proposed excavation for the development. The tree's TPZ will have an inclusion of 50% (Segment Area (20.38m²) / Total Circle Area (40.72m²) Area x 100 which is not acceptable as the largest inclusion allowed for is normally 10%, for the proposed development on the site.

The tree will be affected by the proposed excavation for the development. The overland water flow patterns of the tree on the site will change significantly and the soil environment of the tree will be significantly affected. The tree will have to be removed to establish a bushfire tree protection zone

Gradient of Impacts

Significant Level of Impact

- 0% of root zone impacted – no impact of significance
- 0 to 10% of root zone impacted – low level of impact
- 10 to 15% of root zone impacted – low to moderate level of impact
- 15 to 20% of root zone impacted – moderate level of impact
- 20 to 25% of root zone impacted – moderate to high level of impact
- 25 to 35% of root zone impacted – high level of impact
- >35% of root zone impacted – significant level of impact

Used with permission of Landscape Matrix Pty Ltd.

Significance for Visual Effects - Small Small

Significance Matrix for effects on Landscape Character and Features- Small Local

Tree 12 - *Eucalyptus paniculata* Grey Ironbark

The proposed excavations will impact the (TPZ) Tree Protection Zone of the tree

The tree has a dbh of 480 mm

Tree Protection Zone = 12 X DBH (480mm) = 5.8 Metres

Tree has a diameter at base height of 620mm

Structural Root Zone SRZ Radius = $(620 \times 70) \times 0.42 \times 0.64 = 2.7$ Metres

Incursion 5.8 Metres

Radius 5.8 Metres

The tree will be affected by the proposed excavation for the development. The tree's TPZ will have an inclusion of 50% (Segment Area (52.84m²) / Total Circle Area (105.68m²) Area x 100 which is not acceptable as the largest inclusion allowed for is normally 10%, for the proposed development on the site.

The tree will be affected by the proposed excavation for the development. The overland water flow patterns of the tree on the site will change significantly and the soil environment of the tree will be significantly affected. The tree will have to be removed to establish a bushfire tree protection zone

Gradient of Impacts

Significant Level of Impact

- 0% of root zone impacted – no impact of significance
- 0 to 10% of root zone impacted – low level of impact
- 10 to 15% of root zone impacted – low to moderate level of impact
- 15 to 20% of root zone impacted – moderate level of impact
- 20 to 25% of root zone impacted – moderate to high level of impact
- 25 to 35% of root zone impacted – high level of impact
- >35% of root zone impacted – significant level of impact

Used with permission of Landscape Matrix Pty Ltd.

Significance for Visual Effects - Large Small

Significance Matrix for effects on Landscape Character and Features- Large Local

Trees 13 – *Jacaranda mimosifolia* Jacaranda

The proposed excavations will impact the (TPZ) Tree Protection Zone of the tree

The tree has a dbh of 650 mm

Tree Protection Zone = 12 X DBH (650mm) = 7.8 Metres

Tree has a diameter at base height of 950mm

Structural Root Zone SRZ Radius = $(950 \times 70) \times 0.42 \times 0.64 = 3.2$ Metres

Incursion 7.8 Metres

Radius 7.8 Metres

The tree will be affected by the proposed excavation for the development. The tree's TPZ will have an inclusion of 50% (Segment Area (95.57m²) / Total Circle Area (191.13m²) Area x 100 which is not acceptable as the largest inclusion allowed for is normally 10%, for the proposed development on the site.

The tree will be affected by the proposed excavation for the development. The overland water flow patterns of the tree on the site will change significantly and the soil environment of the tree will be significantly affected. The tree will have to be removed to establish a bushfire tree protection zone

Gradient of Impacts

Significant Level of Impact

0% of root zone impacted – no impact of significance

0 to 10% of root zone impacted – low level of impact

10 to 15% of root zone impacted – low to moderate level of impact

15 to 20% of root zone impacted – moderate level of impact

20 to 25% of root zone impacted – moderate to high level of impact

25 to 35% of root zone impacted – high level of impact

>35% of root zone impacted – significant level of impact

Used with permission of Landscape Matrix Pty Ltd.

Significance for Visual Effects - Large Small

Significance Matrix for effects on Landscape Character and Features- Large Local

Trees 14 – Unknown Species Non indigenous

The proposed excavations will impact the (TPZ) Tree Protection Zone of the tree

The tree has a dbh of 780 mm

Tree Protection Zone = 12 X DBH (780mm) = 9.4 Metres

Tree has a diameter at base height of 950mm

Structural Root Zone SRZ Radius = $(950 \times 70) \times 0.42 \times 0.64 = 3.2$ Metres

Incursion 9.4 Metres

Radius 9.4 Metres

The tree will be affected by the proposed excavation for the development. The tree's TPZ will have an inclusion of 50% (Segment Area (138.80m²) / Total Circle Area (277.59m²) Area x 100 which is not acceptable as the largest inclusion allowed for is normally 10%, for the proposed development on the site.

The tree will be affected by the proposed excavation for the development. The overland water flow patterns of the tree on the site will change significantly and the soil environment of the tree will be significantly affected. The tree will have to be removed to establish a bushfire tree protection zone

Gradient of Impacts

Significant Level of Impact

- 0% of root zone impacted – no impact of significance
- 0 to 10% of root zone impacted – low level of impact
- 10 to 15% of root zone impacted – low to moderate level of impact
- 15 to 20% of root zone impacted – moderate level of impact
- 20 to 25% of root zone impacted – moderate to high level of impact
- 25 to 35% of root zone impacted – high level of impact
- >35% of root zone impacted – significant level of impact

Used with permission of Landscape Matrix Pty Ltd.

Significance for Visual Effects - Large Small

Significance Matrix for effects on Landscape Character and Features- Large Local

Trees 15 –*Liquidambar styraciflua* Liquidamber

The proposed excavations will impact the (TPZ) Tree Protection Zone of the tree

The tree has a dbh of 450 mm

Tree Protection Zone = 12 X DBH (450mm) = 5.4 Metres

Tree has a diameter at base height of 510mm

Structural Root Zone SRZ Radius = $(510 \times 70) \times 0.42 \times 0.64 = 2.5$ Metres

Incursion 5.4 Metres

Radius 5.4 Metres

The tree will be affected by the proposed excavation for the development. The tree's TPZ will have an inclusion of 50% (Segment Area (45.9m²) / Total Circle Area (91.61m²) Area x 100 which is not acceptable as the largest inclusion allowed for is normally 10%, for the proposed development on the site.

The tree will be affected by the proposed excavation for the development. The overland water flow patterns of the tree on the site will change significantly and the soil environment of the tree will be significantly affected. The tree will have to be removed to establish a bushfire tree protection zone

Gradient of Impacts

Significant Level of Impact

0% of root zone impacted – no impact of significance

0 to 10% of root zone impacted – low level of impact

10 to 15% of root zone impacted – low to moderate level of impact

15 to 20% of root zone impacted – moderate level of impact

20 to 25% of root zone impacted – moderate to high level of impact

25 to 35% of root zone impacted – high level of impact

>35% of root zone impacted – significant level of impact

Used with permission of Landscape Matrix Pty Ltd.

Significance for Visual Effects - Medium Small

Significance Matrix for effects on Landscape Character and Features- Medium Local

Trees 16 – *Casuarina glauca* Swamp Oak

The proposed excavations will impact the (TPZ) Tree Protection Zone of the tree

The tree has a dbh of 500mm

Tree Protection Zone = 12 X DBH (500mm) = 6 Metres

Tree has a diameter at base height of 610mm

Structural Root Zone SRZ Radius = $(610 \times 70)^{0.42} \times 0.64 = 2.7$ Metres

Incursion 6 Metres

Radius 6 Metres

The tree will be affected by the proposed excavation for the development. The tree's TPZ will have an inclusion of 50% (Segment Area (56.55m²) / Total Circle Area (113.10m²) Area x 100 which is not acceptable as the largest inclusion allowed for is normally 10%, for the proposed development on the site.

The tree will be affected by the proposed excavation for the development. The overland water flow patterns of the tree on the site will change significantly and the soil environment of the tree will be significantly affected. The tree will have to be removed to establish a bushfire tree protection zone

Gradient of Impacts

Significant Level of Impact

0% of root zone impacted – no impact of significance

0 to 10% of root zone impacted – low level of impact

10 to 15% of root zone impacted – low to moderate level of impact

15 to 20% of root zone impacted – moderate level of impact

20 to 25% of root zone impacted – moderate to high level of impact

25 to 35% of root zone impacted – high level of impact

>35% of root zone impacted – significant level of impact

Used with permission of Landscape Matrix Pty Ltd.

Significance for Visual Effects - Medium Small

Significance Matrix for effects on Landscape Character and Features- Medium Local

Trees 17 – *Schinus areira* Peppercorn Tree

The proposed excavations will impact the (TPZ) Tree Protection Zone of the tree

The tree has a dbh of 2000 mm

Tree Protection Zone = 12 X DBH (2000mm) = 15 Metres

Tree has a diameter at base height of 2450mm

Structural Root Zone SRZ Radius = $(2450 \times 70) \times 0.42 \times 0.64 = 4.9$ Metres

Incursion 15 Metres

Radius 15 Metres

The tree will be affected by the proposed excavation for the development. The tree's TPZ will have an inclusion of 50% (Segment Area (353.44m²) / Total Circle Area (706.88m²) Area x 100 which is not acceptable as the largest inclusion allowed for is normally 10%, for the proposed development on the site.

The tree will be affected by the proposed excavation for the development. The overland water flow patterns of the tree on the site will change significantly and the soil environment of the tree will be significantly affected. The tree will have to be removed to establish a bushfire tree protection zone

Gradient of Impacts

Significant Level of Impact

0% of root zone impacted – no impact of significance

0 to 10% of root zone impacted – low level of impact

10 to 15% of root zone impacted – low to moderate level of impact

15 to 20% of root zone impacted – moderate level of impact

20 to 25% of root zone impacted – moderate to high level of impact

25 to 35% of root zone impacted – high level of impact

>35% of root zone impacted – significant level of impact

Used with permission of Landscape Matrix Pty Ltd.

Significance for Visual Effects - Large Small

Significance Matrix for effects on Landscape Character and Features- Large Local

Tree 18 – *Liquidambar styraciflua* Liquidamber

The proposed excavations will impact the (TPZ) Tree Protection Zone of the tree

The tree has a dbh of 780 mm

Tree Protection Zone = 12 X DBH (780mm) = 9.4 Metres

Tree has a diameter at base height of 950mm

Structural Root Zone SRZ Radius = $(950 \times 70)^{0.42} \times 0.64 = 3.2$ Metres

Incursion 9.4 Metres

Radius 9.4 Metres

The tree will be affected by the proposed excavation for the development. The tree's TPZ will have an inclusion of 50% (Segment Area (138.80m²) / Total Circle Area (277.59m²) Area x 100 which is not acceptable as the largest inclusion allowed for is normally 10%, for the proposed development on the site.

The tree will be affected by the proposed excavation for the development. The overland water flow patterns of the tree on the site will change significantly and the soil environment of the tree will be significantly affected. The tree will have to be removed to establish a bushfire tree protection zone

Gradient of Impacts

Significant Level of Impact

- 0% of root zone impacted – no impact of significance
- 0 to 10% of root zone impacted – low level of impact
- 10 to 15% of root zone impacted – low to moderate level of impact
- 15 to 20% of root zone impacted – moderate level of impact
- 20 to 25% of root zone impacted – moderate to high level of impact
- 25 to 35% of root zone impacted – high level of impact
- >35% of root zone impacted – significant level of impact

Used with permission of Landscape Matrix Pty Ltd.

Significance for Visual Effects - Large Small

Significance Matrix for effects on Landscape Character and Features- Large Local

Tree 19 – *Melia azedarach* White Cedar

The proposed excavations will impact the (TPZ) Tree Protection Zone of the tree

The tree has a dbh of 300 mm

Tree Protection Zone = 12 X DBH (300mm) = 3.6 Metres

Tree has a diameter at base height of 300mm

Structural Root Zone SRZ Radius = $(300 \times 70)^{0.42} \times 0.64 = 2$ Metres

Incursion 3.6 Metres

Radius 3.6 Metres

The tree will be affected by the proposed excavation for the development. The tree's TPZ will have an inclusion of 50% (Segment Area (20.86m²) / Total Circle Area (40.72m²) Area x 100 which is not acceptable as the largest inclusion allowed for is normally 10%, for the proposed development on the site.

The tree will be affected by the proposed excavation for the development. The overland water flow patterns of the tree on the site will change significantly and the soil environment of the tree will be significantly affected. The tree will have to be removed to establish a bushfire tree protection zone

Gradient of Impacts

Significant Level of Impact

- 0% of root zone impacted – no impact of significance
- 0 to 10% of root zone impacted – low level of impact
- 10 to 15% of root zone impacted – low to moderate level of impact
- 15 to 20% of root zone impacted – moderate level of impact
- 20 to 25% of root zone impacted – moderate to high level of impact
- 25 to 35% of root zone impacted – high level of impact
- >35% of root zone impacted – significant level of impact

Used with permission of Landscape Matrix Pty Ltd.

Significance for Visual Effects - Small Small

Significance Matrix for effects on Landscape Character and Features- Small Local

Tree 20 – Melaleuca bracteata Revolution Green

The proposed excavations will impact the (TPZ) Tree Protection Zone of the tree

The tree has a dbh of 780 mm

Tree Protection Zone = 12 X DBH (780mm) = 9.4 Metres

Tree has a diameter at base height of 950mm

Structural Root Zone SRZ Radius = $(950 \times 70) \times 0.42 \times 0.64 = 3.2$ Metres

Incursion 9.4 Metres

Radius 9.4 Metres

The tree will be affected by the proposed excavation for the development. The tree's TPZ will have an inclusion of 50% (Segment Area (138.80m²) / Total Circle Area (277.59m²) Area x 100 which is not acceptable as the largest inclusion allowed for is normally 10%, for the proposed development on the site.

The tree will be affected by the proposed excavation for the development. The overland water flow patterns of the tree on the site will change significantly and the soil environment of the tree will be significantly affected. The tree will have to be removed to establish a bushfire tree protection zone

Gradient of Impacts

Significant Level of Impact

- 0% of root zone impacted – no impact of significance
- 0 to 10% of root zone impacted – low level of impact
- 10 to 15% of root zone impacted – low to moderate level of impact
- 15 to 20% of root zone impacted – moderate level of impact
- 20 to 25% of root zone impacted – moderate to high level of impact
- 25 to 35% of root zone impacted – high level of impact
- >35% of root zone impacted – significant level of impact

Used with permission of Landscape Matrix Pty Ltd.

Significance for Visual Effects - Large Small

Significance Matrix for effects on Landscape Character and Features- Large Local

Tree 21 – *Liquidamber styraciflua* Liquidamber

The proposed excavations will impact the (TPZ) Tree Protection Zone of the tree

The tree has a dbh of 600 mm

Tree Protection Zone = 12 X DBH (600mm) = 7.2 Metres

Tree has a diameter at base height of 710mm

Structural Root Zone SRZ Radius = $(710 \times 70)^{0.42} \times 0.64 = 2.9$ Metres

Incursion 7.2 Metres

Radius 7.2 Metres

The tree will be affected by the proposed excavation for the development. The tree's TPZ will have an inclusion of 50% (Segment Area (81.43m²) / Total Circle Area (162.86m²) Area x 100 which is not acceptable as the largest inclusion allowed for is normally 10%, for the proposed development on the site.

The tree will be affected by the proposed excavation for the development. The overland water flow patterns of the tree on the site will change significantly and the soil environment of the tree will be significantly affected. The tree will have to be removed to establish a bushfire tree protection zone

Gradient of Impacts

Significant Level of Impact

- 0% of root zone impacted – no impact of significance
- 0 to 10% of root zone impacted – low level of impact
- 10 to 15% of root zone impacted – low to moderate level of impact
- 15 to 20% of root zone impacted – moderate level of impact
- 20 to 25% of root zone impacted – moderate to high level of impact
- 25 to 35% of root zone impacted – high level of impact
- >35% of root zone impacted – significant level of impact

Used with permission of Landscape Matrix Pty Ltd.

Significance for Visual Effects - Large Small

Significance Matrix for effects on Landscape Character and Features- Large Local

Tree 22 – *Archontophoenix cunninghamiana* Bangalow Palm

The proposed excavations will impact the (TPZ) Tree Protection Zone of the tree

The tree has a dbh of 200 mm

Tree Protection Zone = 12 X DBH (200mm) = 2.4 Metres

Incursion 2.4 Metres

Radius 2.4 Metres

The tree will be affected by the proposed excavation for the development. The tree's TPZ will have an inclusion of 50% (Segment Area (9.05m²) / Total Circle Area (18/10m²) Area x 100 which is not acceptable as the largest inclusion allowed for is normally 10%, for the proposed development on the site.

The tree will be affected by the proposed excavation for the development. The overland water flow patterns of the tree on the site will change significantly and the soil environment of the tree will be significantly affected. The tree will have to be removed to establish a bushfire tree protection zone

Gradient of Impacts

Significant Level of Impact

- 0% of root zone impacted – no impact of significance
- 0 to 10% of root zone impacted – low level of impact
- 10 to 15% of root zone impacted – low to moderate level of impact
- 15 to 20% of root zone impacted – moderate level of impact
- 20 to 25% of root zone impacted – moderate to high level of impact
- 25 to 35% of root zone impacted – high level of impact
- >35% of root zone impacted – significant level of impact

Used with permission of Landscape Matrix Pty Ltd.

Significance for Visual Effects - Small Small

Significance Matrix for effects on Landscape Character and Features- Small Local

Tree 23 – *Eucalyptus nicholii* Small Leaved Peppermint

The proposed excavations will impact the (TPZ) Tree Protection Zone of the tree

The tree has a dbh of 500 mm

Tree Protection Zone = 12 X DBH (500mm) = 6 Metres

Tree has a diameter at base height of 660mm

Structural Root Zone SRZ Radius = $(660 \times 70)^{0.42} \times 0.64 = 2.8$ Metres

Incursion 6 Metres

Radius 6 Metres

The tree will be affected by the proposed excavation for the development. The tree's TPZ will have an inclusion of 50% (Segment Area (56.55m²) / Total Circle Area (113.10m²) Area x 100 which is not acceptable as the largest inclusion allowed for is normally 10%, for the proposed development on the site.

The tree will be affected by the proposed excavation for the development. The overland water flow patterns of the tree on the site will change significantly and the soil environment of the tree will be significantly affected. The tree will have to be removed to establish a bushfire tree protection zone

Gradient of Impacts

Significant Level of Impact

- 0% of root zone impacted – no impact of significance
- 0 to 10% of root zone impacted – low level of impact
- 10 to 15% of root zone impacted – low to moderate level of impact
- 15 to 20% of root zone impacted – moderate level of impact
- 20 to 25% of root zone impacted – moderate to high level of impact
- 25 to 35% of root zone impacted – high level of impact
- >35% of root zone impacted – significant level of impact

Used with permission of Landscape Matrix Pty Ltd.

Significance for Visual Effects - Medium Small
Significance Matrix for effects on Landscape Character and Features- Large Local

Tree 24 – *Callistemon viminalis* Weeping Bottlebrush

The proposed excavations will impact the (TPZ) Tree Protection Zone of the tree

The tree has a dbh of 400 mm

Tree Protection Zone = 12 X DBH (400mm) = 4.8 Metres

Tree has a diameter at base height of 500mm

Structural Root Zone SRZ Radius = $(500 \times 70) \times 0.42 \times 0.64 = 2.5$ Metres

Incursion 4.8 Metres

Radius 4.8 Metres

The tree will be affected by the proposed excavation for the development. The tree's TPZ will have an inclusion of 50% (Segment Area (36.19m²) / Total Circle Area (72.38m²) Area x 100 which is not acceptable as the largest inclusion allowed for is normally 10%, for the proposed development on the site.

The tree will be affected by the proposed excavation for the development. The overland water flow patterns of the tree on the site will change significantly and the soil environment of the tree will be significantly affected. The tree will have to be removed to establish a bushfire tree protection zone

Gradient of Impacts

Significant Level of Impact

- 0% of root zone impacted – no impact of significance
- 0 to 10% of root zone impacted – low level of impact
- 10 to 15% of root zone impacted – low to moderate level of impact
- 15 to 20% of root zone impacted – moderate level of impact
- 20 to 25% of root zone impacted – moderate to high level of impact
- 25 to 35% of root zone impacted – high level of impact
- >35% of root zone impacted – significant level of impact

Used with permission of Landscape Matrix Pty Ltd.

Significance for Visual Effects - Medium Small

Significance Matrix for effects on Landscape Character and Features- Medium Local

Tree 25 – *Jacaranda mimosifolia* Jacaranda

The proposed excavations will impact the (TPZ) Tree Protection Zone of the tree

The tree has a dbh of 600 mm

Tree Protection Zone = 12 X DBH (600mm) = 7.2 Metres

Tree has a diameter at base height of 950mm

Structural Root Zone SRZ Radius = $(950 \times 70) \times 0.42 \times 0.64 = 3.2$ Metres

Incursion 9.4 Metres

Radius 9.4 Metres

The tree will be affected by the proposed excavation for the development. The tree's TPZ will have an inclusion of 50% (Segment Area (81.43m²) / Total Circle Area 162.86m²) Area x 100 which is not acceptable as the largest inclusion allowed for is normally 10%, for the proposed development on the site.

The tree will be affected by the proposed excavation for the development. The overland water flow patterns of the tree on the site will change significantly and the soil environment of the tree will be significantly affected. The tree will have to be removed to establish a bushfire tree protection zone

Gradient of Impacts

Significant Level of Impact

- 0% of root zone impacted – no impact of significance
- 0 to 10% of root zone impacted – low level of impact
- 10 to 15% of root zone impacted – low to moderate level of impact
- 15 to 20% of root zone impacted – moderate level of impact
- 20 to 25% of root zone impacted – moderate to high level of impact
- 25 to 35% of root zone impacted – high level of impact
- >35% of root zone impacted – significant level of impact

Used with permission of Landscape Matrix Pty Ltd.

Significance for Visual Effects - Medium Small

Significance Matrix for effects on Landscape Character and Features- Medium Local

Trees 26 – *Harpephyllum caffrum* Kafir Plum

The proposed excavations will impact the (TPZ) Tree Protection Zone of the tree

The tree has a dbh of 500 mm

Tree Protection Zone = 12 X DBH (500mm) = 6 Metres

Tree has a diameter at base height of 500mm

Structural Root Zone SRZ Radius = $(500 \times 70) 0.42 \times 64 = 2.5$ Metres

Incursion 6 Metres

Radius 6 Metres

The tree will be affected by the proposed excavation for the development. The tree's TPZ will have an inclusion of 50% (Segment Area (55.06m²) / Total Circle Area (113.10m²) Area x 100 which is not acceptable as the largest inclusion allowed for is normally 10%, for the proposed development on the site.

The tree will be affected by the proposed excavation for the development. The overland water flow patterns of the tree on the site will change significantly and the soil environment of the tree will be significantly affected. The tree will have to be removed to establish a bushfire tree protection zone

Gradient of Impacts

Significant Level of Impact

0% of root zone impacted – no impact of significance

0 to 10% of root zone impacted – low level of impact

10 to 15% of root zone impacted – low to moderate level of impact

15 to 20% of root zone impacted – moderate level of impact

20 to 25% of root zone impacted – moderate to high level of impact

25 to 35% of root zone impacted – high level of impact

>35% of root zone impacted – significant level of impact

Used with permission of Landscape Matrix Pty Ltd.

Significance for Visual Effects - Large Small

Significance Matrix for effects on Landscape Character and Features- Large Local

Tree 27 – *Grevillea robusta* Silky Oak

The proposed excavations will impact the (TPZ) Tree Protection Zone of the tree

The tree has a dbh of 680 mm

Tree Protection Zone = 12 X DBH (680mm) = 6.2 Metres

Tree has a diameter at base height of 900mm

Structural Root Zone SRZ Radius = $(900 \times 70)^{0.42} \times 0.64 = 3.2$ Metres

Incursion 6.2 Metres

Radius 6.2 Metres

The tree will be affected by the proposed excavation for the development. The tree's TPZ will have an inclusion of 50% (Segment Area (60.38m²) / Total Circle Area (120.76m²) Area x 100 which is not acceptable as the largest inclusion allowed for is normally 10%, for the proposed development on the site.

The tree will be affected by the proposed excavation for the development. The overland water flow patterns of the tree on the site will change significantly and the soil environment of the tree will be significantly affected. The tree will have to be removed to establish a bushfire tree protection zone

Gradient of Impacts

Significant Level of Impact

0% of root zone impacted – no impact of significance

0 to 10% of root zone impacted – low level of impact

10 to 15% of root zone impacted – low to moderate level of impact

15 to 20% of root zone impacted – moderate level of impact

20 to 25% of root zone impacted – moderate to high level of impact

25 to 35% of root zone impacted – high level of impact

>35% of root zone impacted – significant level of impact

Used with permission of Landscape Matrix Pty Ltd.

Significance for Visual Effects - Large Small

Significance Matrix for effects on Landscape Character and Features- Large Local

Tree 28 *Morus nigra* Mulberry Tree

The proposed excavations will impact the (TPZ) Tree Protection Zone of the tree

The tree has a dbh of 100 mm

Tree Protection Zone = 12 X DBH (100mm) = 2 Metres

Tree has a diameter at base height of 100mm

Structural Root Zone SRZ Radius = $(100 \times 70)^{0.42} \times 0.64 = 1.5$ Metres

Incursion 2 Metres

Radius 2 Metres

The tree will be affected by the proposed excavation for the development. The tree's TPZ will have an inclusion of 50% (Segment Area (6.3m²) / Total Circle Area (12.57m²) Area x 100 which is not acceptable as the largest inclusion allowed for is normally 10%, for the proposed development on the site.

The tree will be affected by the proposed excavation for the development. The overland water flow patterns of the tree on the site will change significantly and the soil environment of the tree will be significantly affected. The tree will have to be removed to establish a bushfire tree protection zone

Gradient of Impacts

Significant Level of Impact

- 0% of root zone impacted – no impact of significance
- 0 to 10% of root zone impacted – low level of impact
- 10 to 15% of root zone impacted – low to moderate level of impact
- 15 to 20% of root zone impacted – moderate level of impact
- 20 to 25% of root zone impacted – moderate to high level of impact
- 25 to 35% of root zone impacted – high level of impact
- >35% of root zone impacted – significant level of impact

Used with permission of Landscape Matrix Pty Ltd.

Significance for Visual Effects - Small Small

Significance Matrix for effects on Landscape Character and Features- Small Local

3.2 DETERMINING THE TPZ

The radius of the TPZ is calculated for each tree by multiplying its DBH \times 12.

$$\text{TPZ} = \text{DBH} \times 12$$

where

DBH = trunk diameter measured at 1.4 m above ground

Radius is measured from the centre of the stem at ground level.

A TPZ should not be less than 2 m nor greater than 15 m (except where crown protection is required). Clause 3.3 covers variations to the TPZ.

The TPZ of palms, other monocots, cycads and tree ferns should not be less than 1 m outside the crown projection.

3.3 VARIATIONS TO THE TPZ

3.3.1 General

It may be possible to encroach into or make variations to the standard TPZ. Encroachment includes excavation, compacted fill and machine trenching.

3.3.2 Minor encroachment

If the proposed encroachment is less than 10% of the area of the TPZ and is outside the SRZ (see Clause 3.3.5), detailed root investigations should not be required. The area lost to this encroachment should be compensated for elsewhere and contiguous with the TPZ. Variations must be made by the project arborist considering relevant factors listed in Clause 3.3.4. The figures in Appendix D demonstrate some examples of possible encroachment into the TPZ up to 10% of the area.


3.3.3 Major encroachment

If the proposed encroachment is greater than 10% of the TPZ or inside the SRZ (see Clause 3.3.5), the project arborist must demonstrate that the tree(s) would remain viable. The area lost to this encroachment should be compensated for elsewhere and contiguous with the TPZ. This may require root investigation by non-destructive methods and consideration of relevant factors listed in Clause 3.3.4.

ENCROACHMENT INTO TREE PROTECTION ZONE


(Informative)

Encroachment into the tree protection zone (TPZ) is sometimes unavoidable. Figure D1 provides examples of TPZ encroachment by area, to assist in reducing the impact of such incursions.

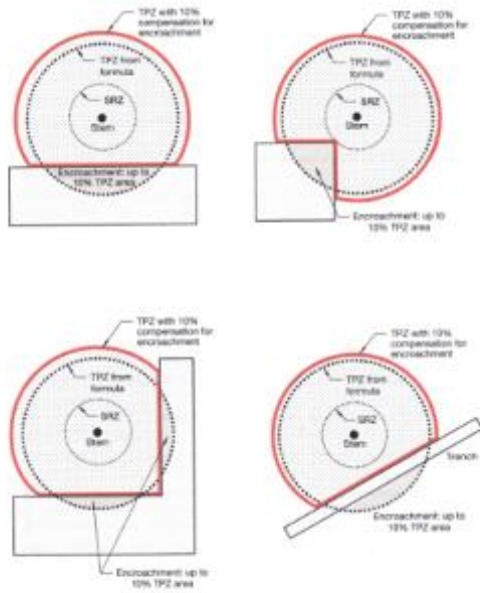

NOTE: Less than 10% TPZ area and outside SRZ. Any loss of TPZ compensated for elsewhere.

FIGURE D1 EXAMPLES OF MINOR ENCROACHMENT INTO TPZ

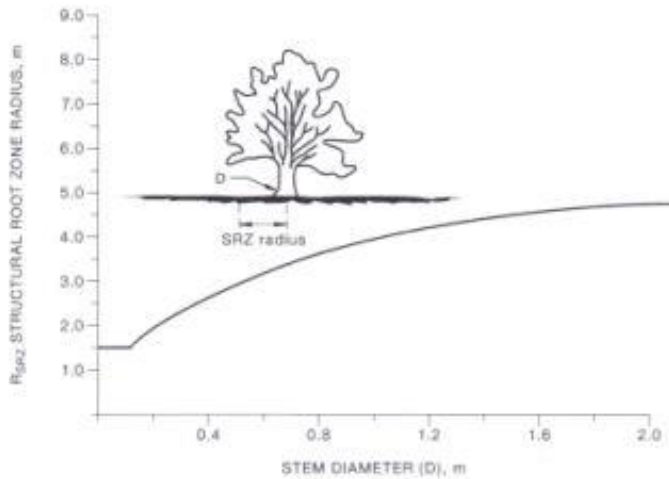

The curve can be expressed by the following formula:
 $R_{SRZ} = (D \times 50)^{0.42} \times 0.64$

NOTES:

1. R_{SRZ} is the structural root zone radius.
2. D is the stem diameter measured immediately above root buttress.
3. The SRZ for trees less than 0.15 m diameter is 1.5 m.
4. The SRZ formula and graph do not apply to palms, other monocots, cycads and tree ferns.
5. This does not apply to trees with an asymmetrical root plate.

FIGURE 1 STRUCTURAL ROOT ZONE

SIGNIFICANCE MATRIX FOR EFFECTS ON LANDSCAPE CHARACTER AND FEATURES

(Receptor/observer only, professional judgement of individual officer required)

Magnitude of Change lies along a continuum from very Large to none, with an overlap between each defined category. This is determined by assessing the amount of the element in landscape type or feature affected within the context of the site and the permeability of the fence.

	Very Large	Large	Medium	Small	Negligible / None
	At complete variance with the landscape, scale and pattern of the landscape	A significant deterioration (or improvement) in landscape character or loss of features over an extensive area	A noticeable deterioration (or improvement) in landscape character and landscape elements	A barely perceptible deterioration (or improvement) in elements or character	No discernible change to any landscape elements or character
Significance of Landscape Character and Landscape Features for those a confirm depending on the issue importance - from international to low local importance - with overlap between each defined category. The sensitivity of these depends upon the level of existing degradation and/or the state of quality and condition of the landscape character and/or feature	Substantial	Substantial	Substantial	Substantial/ Moderate	No Effect
International design feature or landscape element susceptible to relatively small changes	Substantial	Substantial	Substantial	Substantial/ Moderate	No Effect
Nationally designed feature or landscape element susceptible to relatively small changes	Substantial	Substantial	Substantial	Substantial/ Moderate	No Effect
County design feature or landscape element susceptible to change	Substantial	Substantial	Substantial	Substantial/ Moderate	No Effect
A landscape or feature of national value with international or nationally defined features	Substantial	Substantial	Substantial	Substantial/ Moderate	No Effect
A landscape or feature of national value with international or nationally defined features	Substantial	Substantial	Substantial	Substantial/ Moderate	No Effect
Locally valued landscape element or feature with nationally defined features	Moderate	Moderate	Moderate	Moderate/ Slight	No Effect
A non-designated landscape element or feature, the nature of which is primarily related to landscape change	Moderate	Moderate	Moderate	Moderate/ Slight	No Effect

SIGNIFICANCE MATRIX FOR VISUAL EFFECTS

(For guidance only; professional interpretation of individual effects is vital)

Magnitude of Change lies along a continuum from very large to none, with an overlap between each defined category. This will depend on the amount of a view affected, the number of viewers affected and the duration of the impact.

	Negligible / None No discernible change in view	Small A barely perceptible change in view	Medium A noticeably deterioration (or improvement) in view	Large Changes are evident and would significantly impair (or improve) views of the area	Very Large Proposals are highly visible disruptive (or creating) valued views into and across the area
<p>Activity of / viewers (recipient) lies along a continuum from very high to negligible, depending on where the view is from (the nature of the place) and the activities of the viewer</p> <p>Very High Including events with internationally designed facilities (national parks, AONBs, the setting of scheduled ancient monuments or Grade I listed buildings)</p> <p>High Including viewers with public rights of way, regional landscape, landscape or the setting of Grade II* listed buildings, towns and views from residential properties</p> <p>Medium Including views from people engaged in outdoor sports or recreation, including people walking and those driving on local roads.</p> <p>Low People using major transport corridors.</p> <p>Negligible Including people working inside for business and industry.</p>	No Effect	No Effect	No Effect	No Effect	No Effect
	Medium	Medium	Medium	Medium	Medium
	Substantial	Substantial	Substantial	Substantial	Substantial
	Substantial	Substantial	Substantial	Substantial	Substantial
	Substantial	Substantial	Substantial	Substantial	Substantial

Appendix 7 - Arboricultural Management Plan (Tree Protection Plan) for 12 Day Street East Maitland NSW

Contents

1. Pre-Construction Inspection	101
Construction Procedure for Trees to be preserved	101
Pruning Specifications for Trees Recommended for Preservation	102
Construction Procedure for Trees during works	102
Construction Phase Monitoring	103
Post Construction Management.....	103

Pre-Construction Inspection

The pre construction inspection will be carried out prior to the commencement of any excavation or building works on the proposed development site.

Compliance with the following items will be required before authorization to commence construction will be consented.

Construction Procedure for Trees to be preserved

1. Before beginning work, the contractor is required to meet with the consultant at the site to review all work procedures, access routes, storage areas, and tree protection measures.
2. Fences have been erected to protect tree to be preserved. Fences define a specific protection zone for the tree. Fences are to remain until all site work has been completed. Fences may not be relocated or removed without the written permission of the consultant.
3. Construction trailers and traffic and storage areas must remain outside fenced areas at all times.
4. All underground utilities and drain or irrigation lines shall be routed outside the tree protection zone. If lines must traverse the protection area, they shall be tunneled or bored under the tree. The site arborist should be present during any such works.
5. No materials, equipment, spoil, or waste or washout water may be deposited, stored, or parked within the tree protection zone (fenced area).
6. Additional tree pruning required for clearance during construction must be performed by a qualified arborist and not by construction personnel.
7. Any herbicides placed under paving materials must be safe for use around trees and labeled for that use. Any pesticides used on site must be tree-safe and not easily transported by water.

Pruning Specifications for Trees Recommended for Preservation

1. All trees within the project area shall be pruned to:

- a. Clear the crown of diseased, crossing, weak, and dead wood
 - b. Provide 5 metres of vertical clearance over streets and 3 metres over Sidewalks;
 - c. Remove stubs, cutting outside the wound wood tissue that has Formed around the branch;
 - d. Reduce end weight on heavy, horizontal branches by selectively removing small diameter branches, no greater than 50-100mm near the ends of the scaffolds.
2. Where temporary clearance is needed for access, branches shall be tied back to hold them out of the clearance zone. All pruning shall be performed by a qualified arborist with a minimum of 10 Million Dollars public liability insurance. That all tree pruning works are carried out as per the Australian Standard AS 4373-2007 Pruning of amenity trees and as per the Code of Practice Amenity Tree Industry August 1998. Interior branches shall not be stripped out.
 3. Pruning cuts larger than 100mm in diameter, except for dead wood, shall be avoided.
 4. Pruning cuts that expose heartwood shall be avoided whenever possible.
 5. No more than 20 percent of live foliage shall be removed within the tree to be preserved.
 6. While in the tree, the arborist shall perform an aerial inspection to identify defects that require treatment. Any additional work needed shall be reported to the consultant. The branches that require pruning have been identified and photographed on pages 14 and 20 of site photographs for the respective trees
 7. Brush shall be chipped and chips shall be spread underneath trees within the tree protection zone to a maximum depth of 200mm, leaving the trunk clear of mulch.

Construction Procedure for Trees during works

1. The site arborist is to be present during any excavation works adjacent any trees on the site. This is required to specify and supervise any horticultural works that should be carried out to any nominated tree for retention.
2. If injury should occur to any tree during construction, it should be evaluated as soon as possible by the site arborist so that appropriate treatments can be applied.
3. Any grading, construction, demolition, or other work that is expected to encounter tree roots must be monitored by the consulting arborist.
4. The tree shall be irrigated on a schedule to be determined by the consultant. Each irrigation shall wet the soil within the tree protection zone to a depth of 100mm.
5. Erosion control devices such as silt fencing, debris basins, and Water diversion structures shall be installed to prevent siltation and or erosion within the tree protection zone.
6. Before grading, pad preparation, or excavation for foundations, footings, walls, or

trenching, they shall be 300mm outside the tree protection zone by cutting all roots cleanly to a depth of 800mm. Roots shall be cut by manually digging a trench and cutting exposed roots with a saw, vibrating knife, rock saw, and narrow trencher with sharp blades, or other approved root-pruning equipment.

7. Any roots damaged during grading or construction shall be exposed to sound tissue and cut cleanly with a saw.
8. Spoil from trenches, basements, or other excavations shall not be placed within the tree protection zone either temporarily or permanently.
9. No burn piles or debris pits shall be placed within the tree protection zone. No ashes, debris, or garbage maybe dumped or buried within the tree protection zone.
10. Maintain fire-safe areas around fenced areas. Also, no heat sources, flames, Ignition sources or smoking is allowed near mulch or trees.

These inspections will be carried out on an as needed requirement. It recommended that all excavations near trees be carried out together to reduce costs for the client and that the site arborist is present to determine any root pruning treatments that might be required to be carried out at the time of excavation.

Construction Phase Monitoring

Fortnightly inspections will be required to observe six major areas during the construction phase.

- **Maintain the tree protection zone.** Maintaining the integrity of the tree protection zone is the single most important factor in protecting trees from excessive damage. Space often is at a premium on construction sites and the open areas denied by the tree protection zone are attractive locations for all types of activities that can cause damage to trees, including storing materials, Parking vehicles and dumping waste.
- **Assist with changes in the field.** Few projects proceed without changes in the field. This occurs for a variety of reasons. Plans and field situations may not match, and work must occur closer to the tree than planned. Alternatively, an item may have escaped notice or was not discovered until construction. The Consultant must participate in the decisions that could affect trees.
- **Monitor tree health and conditions and specifying appropriate treatments.** Sometimes, even with a comprehensive tree protection plan, trees are accidentally damaged. The consultant must be available to recommend mitigations and appropriate actions when damage has occurred. Similarly, changes in water status, pest populations, etc. must be identified early so treatments can be applied.
- **Communicate with the project superintendent and contractors.** In our experience, one of the most critical factors in the success of a tree preservation project is the commitment of the project superintendent who manages all on-site construction activity. The superintendent's interest and willingness to support tree preservation actions (for example, honouring the tree protection zone) is vital. The consultant must acknowledge the range of demands for time and money facing the superintendent in completing the project and establish an effective means of communication and cooperation at the site.

- **Help identify appropriate work procedures around trees.** The arborist should talk with the project superintendent and contractors to identify work Procedures that are effective for all parties and minimize impacts to trees. The Consultant can help identify locations for haul roads that avoid trees while providing adequate turn and back-up zones for equipment.
- **Facilitate completion of the project.** Once a project is approved and Construction begun, one of the consultant's responsibilities is to help complete the project in a timely manner. This is not done at the expense of adequate tree protection, but in a spirit of cooperation.

Post Construction Management

Tree Maintenance program: Care of trees following construction

The management of preserved trees following construction must encompass the needs of both individual trees and the forest remnants they comprise. The following Tree Maintenance areas will be inspected for compliance on an annual basis following the completion of works for 2 years.

Caring for Individual Trees

The program of post construction care for individual trees focuses on the normal goals of any tree management effort such as maintenance of vigour and structural stability. For trees to remain assets to the community, they must remain in good condition with low potential for failure. We address these goals by treating the tree itself (pruning, pest management) and the environment around the tree (mulch, irrigation). Overall, we strive to avoid any factors that predispose the tree to attack by pests and loss of wood through decay.

The most common remedial actions recommended for trees impacted by construction include the treatments described below.

Irrigation

Trees that have suffered loss of roots may not be able to exploit as large a soil volume as they did before injury. Alternatively, changed patterns of drainage across a site may divert water into new drainage patterns, away from trees. In either case, trees may benefit from supplemental irrigation. The following are general guidelines.

- The amount of water applied must be appropriate to the needs of the individual species.
- Light, frequent irrigations should be avoided. Irrigation should wet the entire root zone and be allowed to dry before another application.
- Excess irrigation from new landscapes should be avoided. Runoff from plantings should be minimized and/or directed away from trees.

- Wetting the trunk should be avoided.

Another approach is to reduce water loss by misting the canopy. In this technique, fine sprays of water are applied throughout the canopy on regular, relatively continuous intervals. The mist appears to raise humidity and reduce air temperature within the canopy, thereby reducing water loss. Shrader (1996) considered this treatment instrumental in the survival of transplanted oaks in Florida.

Pruning Specification further discussion

Trees on construction sites should be inspected annually to determine pruning requirements. Pruning may be required for one of two reasons. First, crowns may need to have dead, dying, diseased, broken, and otherwise structurally weak branches removed.


This pruning may also involve reducing the size of the crown where dieback is extensive. Second, crowns may be thinned to reduce the amount of canopy exposed to wind and to balance weight among branches.

Arborists have long debated the value of pruning the crown as a way of compensating for loss of roots; however, there is no scientific evidence to support this practice. Watson (1991) notes "... no research has been published to demonstrate the effectiveness (of crown reduction pruning) on mature trees." Harris (1992) notes, "As with most things, moderation would appear to be wise in caring for root-damaged trees."

Our recommendation is that arborists not attempt to balance root loss by reducing the size of the crown. Rather, we recommend that the health and structure of the tree be monitored and appropriate pruning actions be applied.

Where scaffolding is required, it should be erected outside the TPZ. Where it is essential for scaffolding to be erected within the TPZ branch removal should be minimized. This can be achieved by designing scaffolding to avoid branches or tying back branches. Ground below the scaffolding should be protected by boarding (e.g., scaffolding board or plywood sheeting as shown). Where access is required, a board walk or other surface material should be installed to minimise sheeting to prevent soil contamination. The boarding should be left in place until the scaffolding is removed.

- Notes:
- 1 For trunk and branch protection use boards and padding that will prevent damage to bark. Boards are to be strapped to trees, not nailed or screwed.
 - 2 Rumble boards should be a suitable thickness to prevent soil compaction and root damage.
- (Excerpt from AS4970:2009)

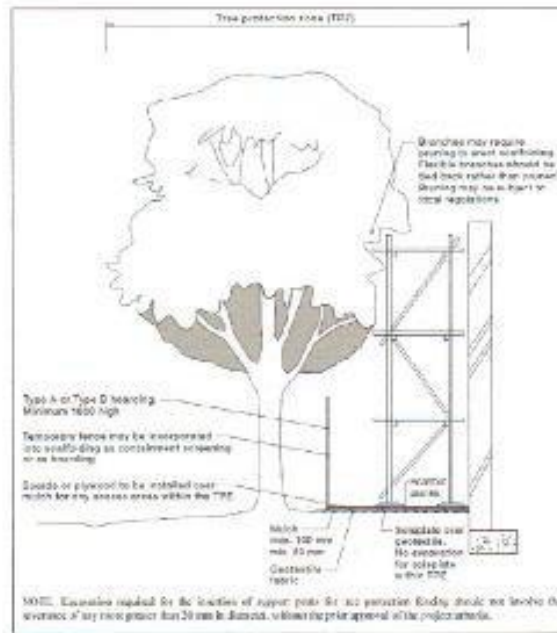

Mulch

Trees preserved on construction sites generally will benefit from having a 100- to -200 mm layer of organic mulch beneath the canopy. The mulch will reduce loss of moisture from the soil, protect against compaction, and moderate soil temperatures. It also has been demonstrated that the addition of mulch reduces soil compaction over time (see section on remedial soil treatment).

We normally specify that brush from pruning be chipped and spread under the crown. Mulch depth should be adjusted so that only 1 to 2 inches is placed against the trunk of the tree.

Fertilisation

Arborists are not in agreement about the value of supplemental fertilization to trees preserved on construction sites. A consistent benefit to such treatment has not been demonstrated by scientific research. Because trees growing in forests settings do not usually exhibit any symptoms of nutrient deficiency, we might surmise that mineral elements are not lacking in the soil and, therefore, supplementing those nutrients following root injury is not necessary. Although applications of supplemental fertilizer have resulted in increased growth of trees in forest stands, trees preserved on development sites are no longer strictly forest trees. Historical patterns of nutrient cycling are disrupted as soil, litter, and woody debris is removed; mycorrhizal associations are altered; and Patterns of water movement through the profile and across the site are changed. Moreover, we expect trees in landscape settings to be healthier than those in woodland environments.

In addition, there is significant anecdotal evidence regarding the benefits of supplemental fertilization. We assume that the ability of trees on construction sites to absorb water and mineral nutrients has been reduced due to injury and root compaction. Providing supplemental fertilization, therefore, allows the trees to absorb necessary elements with a limited root system. Trees that were previously growing in urban landscapes or without maintenance may benefit from fertilization.

Pest Management

Tree death often follows a pattern of weakening by predisposing stresses, such as injury from construction, followed by attack from opportunistic pests and pathogens. For example, the two lined chestnut borer attacks oak trees that have been weakened by biotic or environmental stress (Dunn et al. 1990). Oak trees that have been mechanically wounded are predisposed to attack by *Armillaria* (Svihra 1991). Construction activity has been associated with decline of white pine (Weaver and Stipes 1988) and with increased occurrence of oak wilt (Miller et al. 1993).

Pest Management is an important part of a post-construction maintenance program. Developing pest management programs for preserved trees involves:

- Knowledge of the tree species and its pattern(s) of decline and death
- Treating the tree to enhance vigour and/or avoid predisposition (e.g., Supplemental irrigation, timing of pruning)
- Monitoring for the presence of pests
- Applying preventive control treatments

Because trees impacted by construction are more susceptible to pests, managers need to be vigilant about pest management programs. Particular attention must be paid to monitoring for pest and to application of control procedures. Thresholds for treatment may be more conservative on infested trees than for undisturbed trees. Under normal circumstances, the action threshold for control procedures might be defoliation of 30 percent of the crown. For trees impacted by development activity, a threshold of 15 to 20 percent defoliation would be more appropriate.

Removing fill soil

In situations where grades have been raised within the dripline, the fill soil should be removed to original grade. If the entire root area cannot be cleared of fill, a minimum 1.5-foot radius around the trunk should be returned to natural grade. In some cases, a small retaining wall may be necessary. Drainage must be provided to ensure that water does not collect at the base of the trunk. Removal of fill soil should occur by hand, especially within 3 metres of the trunk.

Remediation of Soils Damaged During Construction

The structure of soils on development sites is often altered during the construction process. Soils are compacted to provide a stable base for structures, as vehicles move across the site, and when utilities and other improvements are installed. Miller (1996) noted, however, that “compaction” is often used as a catch-all term for soil disturbances including kneading, churning, rutting, and displacement. By whatever means it is accomplished, compaction results in increased soil density and decreased porosity. It is an unfavorable environment for roots as well as soil micro flora.

Consultants are frequently asked to recommend treatments that will quickly reduce compaction and improve structure. Rolf (1992a), Day and Bassuk (1994), and Smiley (1996) reviewed possible amelioration treatments. Solutions such as tillage and sub-soiling are not appropriate on development sites where large trees are already present. In post construction situations, four treatment options are available.

- Holes and fractures can be created to increase air space. This is accomplished by injecting high-pressure water or air and physically auguring openings. In some cases, voids are filled with porous material such as sand or gravel, a process known as vertical mulching.
- Soil is removed from radically oriented trenches and replaced with porous soil material. Removal may be achieved either by backhoe and other mechanical methods or by hydro excavation (Gross 1995).
- Organic mulch can be placed around the tree beneath the canopy.
- The tree can be treated with growth regulators such as paclobutrazol (Watson 1996).

The experimental results from examining the effectiveness of the numerous possible remediation treatments are ambiguous. However, three treatments appear to provide clear benefits. First, mulching the soil beneath the canopy with organic mulch is beneficial. Smiley (1996) notes “... the most dramatic results I have ever seen in a soil compaction experiment came from using mulch by itself.” Smiley (1996) also demonstrated improvements in trunk growth of Crepe Myrtle and Callery Pear trees in a compacted soil setting. Second, the soil removal and replacement technique has resulted in clear improvements in tree growth (Watson et al. 1996. Watson 1996, Smiley 1996). In Watson’s work, however, the soils involved were not described as compacted at the start of the project. Third, Watson (1996) demonstrated increased root development of declining white oak trees from application of paclobutrazol.

Other experiments using vertical mulching (drilling holes in the soil and filling them with mulch material) of all types, treatment with biostimulants, aeration, and other methods have yielded either inconsistent or negative results for either soil characteristics or tree health. The exception to this has been the work of Rolf (1992b and 1994), which focused on remediation treatments in improving growing conditions of new plantings. It is clear that prevention and avoidance are the key elements in dealing with soil compaction and related degradations in structure on development sites. Consultants have limited ability to provide effective long-lasting treatments. As Rolf (1992a) noted, “There are no perfect methods for aeration around trees in limited spaces and where vegetation is already established.”


Design and Documentation Considerations

Impacts to tree	Construction Activity	Methods/Treatments to minimise damage.
Root Loss	Stripping site of organic surface soil before grading; clearing unwanted vegetation; demolishing existing structures	<ul style="list-style-type: none"> • Restrict stripping of topsoil around trees • Install fences to protect trees from injury • Any woody vegetation to be removed adjacent to trees to remain should be cut at ground level and not pulled out by equipment; otherwise, root injury to remaining trees may result. Arborist may be needed for adjacent tree removal if crowns are intertwined.
	Lowering grade, scarifying, preparing sub grade for fill and structures	<ul style="list-style-type: none"> • Before grading, root prune tree at edge of excavation to depth required. • Spoil beyond cut face can be removed by equipment sitting outside the dripline of the tree • Use retaining walls with discontinuous footings to increase the distance that natural grade is maintained from trunk.
	Preparing sub grade for pavement	<ul style="list-style-type: none"> • Use paving section requiring a minimum amount of excavation (e.g., reinforced concrete instead of asphalt). • To minimize thickness of pavement section, design, traffic patterns to avoid heavy loads adjacent to trees. • Increase strength of pavement to reduce reliance on sub grade for strength (e.g., use extra reinforcement in concrete, geotextile under base material).

Impacts to tree	Construction Activity	Methods/Treatments to minimise damage.
	Excavations for footings, walls , foundations	<ul style="list-style-type: none"> • Avoid continuous footings adjacent to trees • Use pier foundations with grade beam above grade instead of slab foundations • Orient piers to avoid major roots. • Excavate by hand, bridging roots where possible. • Where roots must be removed, cut cleanly with appropriate equipment (e.g., rock saw). Do not use equipment that pulls and shatters roots (eg. Backhoe, trencher).
	Trenching for utilities, drains	<ul style="list-style-type: none"> • Where roots must be removed, cut cleanly with appropriate equipment (e.g., rock saw). Do not use equipment that pulls and shatters roots (eg. Backhoe, trencher). * Avoid open trenching in root area * Tunnel under roots, if possible. * If not, within root area, dig trench by hand, bridging roots greater than 250mm diameter. Consolidate utilities into one trench.
Wounding crown of tree	Injury from equipment	<ul style="list-style-type: none"> • Fence trees to enclose low branches and protect trunk. • Clean up wounds as soon as possible • Prune to minimum height required prior to construction.


Impacts to tree	Construction Activity	Methods/Treatments to minimise damage.
	Creating clearance for building, traffic, construction equipment	<ul style="list-style-type: none"> • Consider minimum height requirements of construction equipment and emergency vehicles over roads. • All pruning should be performed by a Certified arborist and conform to ANSI pruning standards.
Unfavorable conditions for root growth; chronic stress from reduced root systems	Compacted surface soils	<ul style="list-style-type: none"> • Fence trees to keep traffic and storage out of root area • Provide a storage yard and traffic areas for construction activity for construction activity well away from trees. • Where traffic cannot be diverted, protect soil surface with thick mulch or steel plates.
	Spills, waste disposal (e.g., paint, oil, fuel)	<ul style="list-style-type: none"> • Clean up accidental spills immediately.
	Soil Sterilants (herbicides) applied under pavement	<ul style="list-style-type: none"> • Use herbicides safe for use around trees. Adhere to label requirements
	Impervious pavement over soil surface	<ul style="list-style-type: none"> • Minimize use of pavement within dripline
Inadequate soil moisture	Rechannelization of stream flow; redirecting runoff, lowering water table; lowering grade	<ul style="list-style-type: none"> • Consider system to allow low flow through normal stream alignments and provide bypass into storm drains for peak flow. • Provide supplemental irrigation in similar volumes and seasonal distribution as would normally occur.

Impacts to tree	Construction Activity	Methods/Treatments to minimise damage.
Excess Soil Moisture	Underground Flow backup; raising water table	<ul style="list-style-type: none"> • Fills placed across drainage courses must have culverts placed at the bottom of the low flow so that water is not backed up upstream. • Study the geotechnical report for ground water characteristics to see that walls and fills will not intercept underground flow.
	Lack of Surface drainage away from tree	<ul style="list-style-type: none"> • Where surface grades are to be modified, make sure that water will flow away from the trunk (i.e., that the trunk is not the lowest point). If tree is in low point, design drain system with lest impact to roots.
	Irrigation of exotic landscape	<ul style="list-style-type: none"> • Match irrigation requirements of tree and understory landscape to avoid over irrigation.

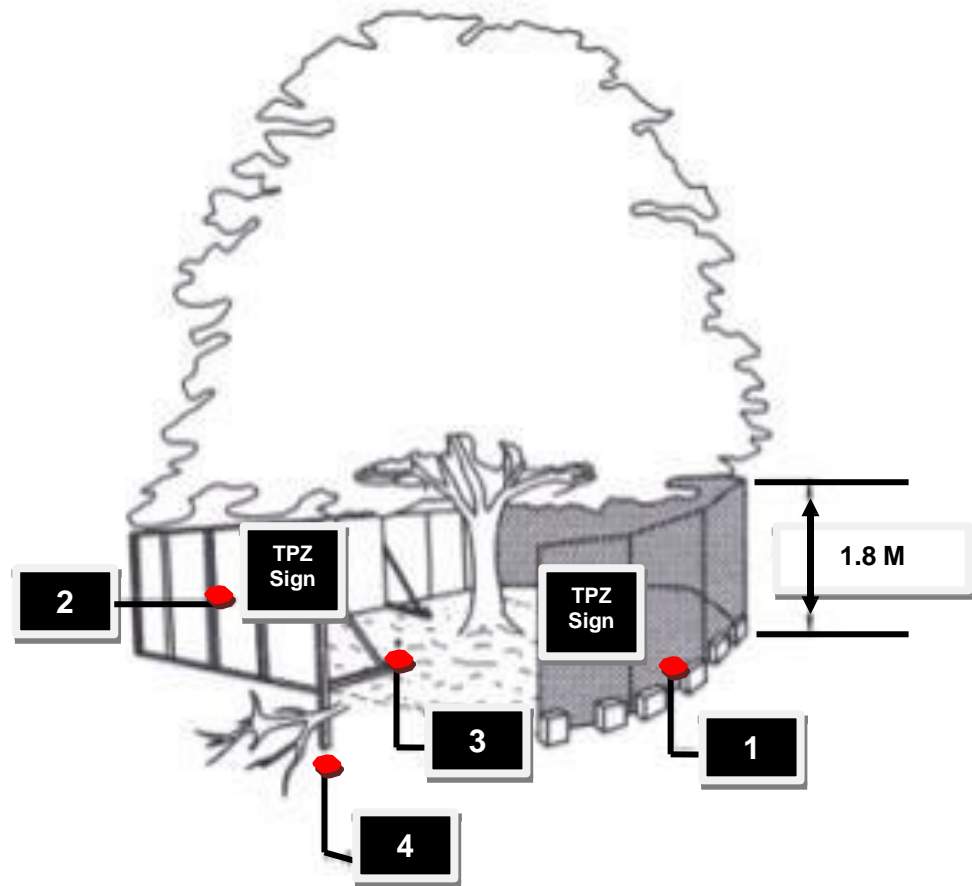

Legend

1. Chain wire mesh panels with shade cloth (if required) attached, held in place with concrete feet.
2. Alternative plywood or wooden paling fence panels. This fencing material also prevents building materials or soil entering the TPZ.
3. Mulch installation across surface of TPZ (at the discretion of the project arborist). No excavation construction activity, grade changes, surface treatment or storage of materials of any kind is permitted within the TPZ.
4. Bracing is permissible within the TPZ. Installation of supports should avoid damaging roots.

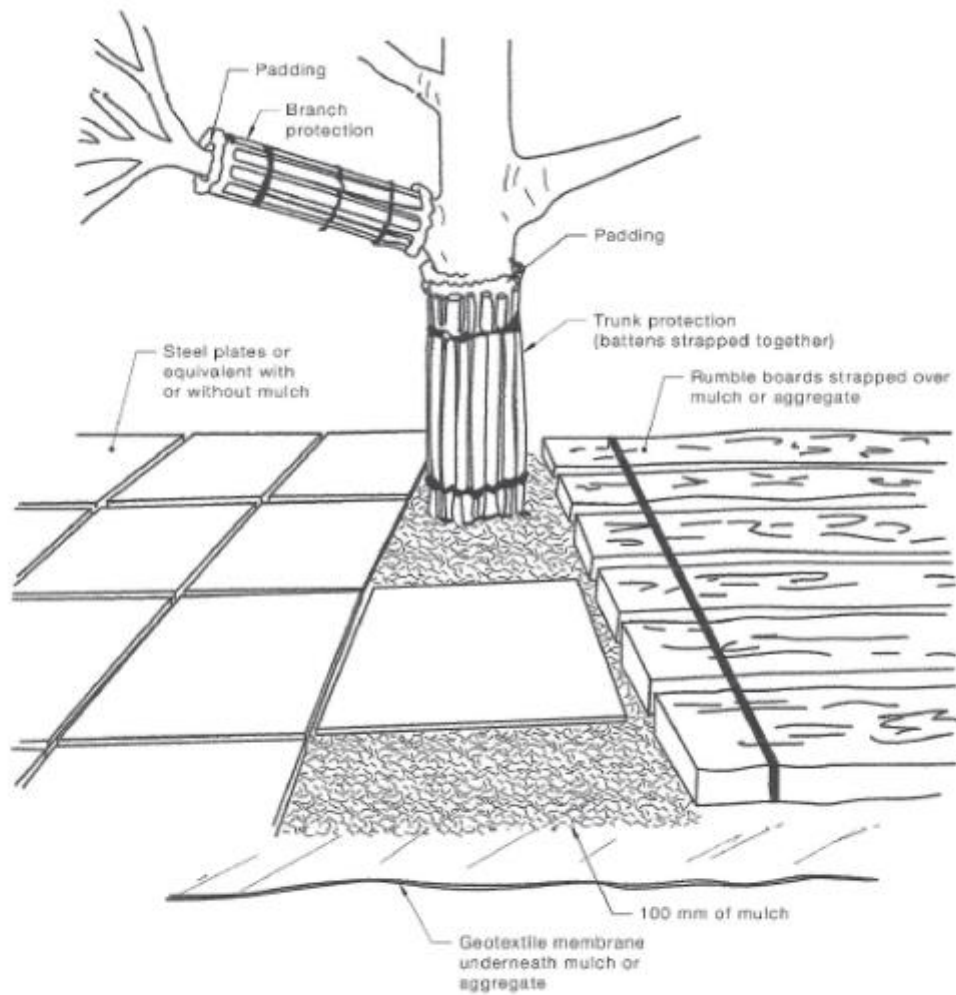

NOTES:

- 1 For trunk and branch protection use boards and padding that will prevent damage to bark. Boards are to be strapped to trees, not nailed or screwed.
- 2 Rumble boards should be of a suitable thickness to prevent soil compaction and root damage.

Boring Specifications

Trenching, boring and root pruning

Trenching for underground services, especially if carried out close to the trunk Can cause major damage to root systems. In some instances, underground services may have to pass through the protection zone around a tree. The closer the trench is to the tree the greater the impact on the tree. Table 1 gives the minimum distances from the trunk for the location of trenches, based on tree trunk diameter at breast height (dbh).

Under-boring (also known as directional boring, or auguring) can be used instead of or in conjunction with trenching and causes minimum damage to roots if the minimum distances in Table 1 are adhered to. This technology is now widely available.

Tree diameter (dbh) mm	Auger distance from trunk mm or metres
0-50	300mm
50-100	600mm
100-250	1.5m
250-400	3.0m
400-500	3.6m
over 500	4.5m

Table 1: The distance from the trunk (in any direction) at which trenching should cease and under-boring should commence. The depth should be at least 500mm. (After Morell (21) and Watson (34).

Note: Should the arborist consider, that trenching could damage roots of more

than 75 mm diameter at the limits suggested by Table 1, dig trenches by to locate the limits of trenching.


How Tunneling Works

Tunneling is an increasingly common tool used by electric, gas, telephone, cable TV, and other industries to install and maintain pipes and transmission lines. The highly mobile equipment can produce hole diameters of 2 to 47 inches. Terminology varies, but boring, muling, and trenchless technology are some of the other names used for tunneling. Regardless of name, the methods used fall into one or a combination of three basic procedures:

- COMPACTION** Pneumatic/hydraulic equipment forces a piercing tool through the soil, displacing or squeezing soil to form a void.
- EXCAVATION** This method has been around for more than 30 years. Tools are more sophisticated now but essentially involve a rotating auger that drills through the soil and pushes spoil material out behind it.
- WET BORING** In wet boring methods, water or some other fluid is either used as the cutting agent or to assist a mechanical cutting head.

The diagram illustrates a tunneling setup. On the left, an 'Access Pit' is shown with a 'Locator' being used to track a 'Cutting Tool' underground. A tree is positioned between the access pit and the machine. The 'Machine that produces thrust or torque' is connected to the cutting tool via 'Connecting Rods and/or Hose'. An 'Operator' is positioned at the machine, which is powered by a 'Field Power Unit'.

Tunneling equipment involves a cutting tool, connecting rods and/or hoses, a unit that provides thrust or torque, and a field power unit. In some cases, a hand-held locator tracks the cutting head. Operators can make adjustments ("steer") for both depth and direction as the tunneling proceeds. Accuracy of some methods is within inches of a target (usually an access pit) at the end of the tunneled span.

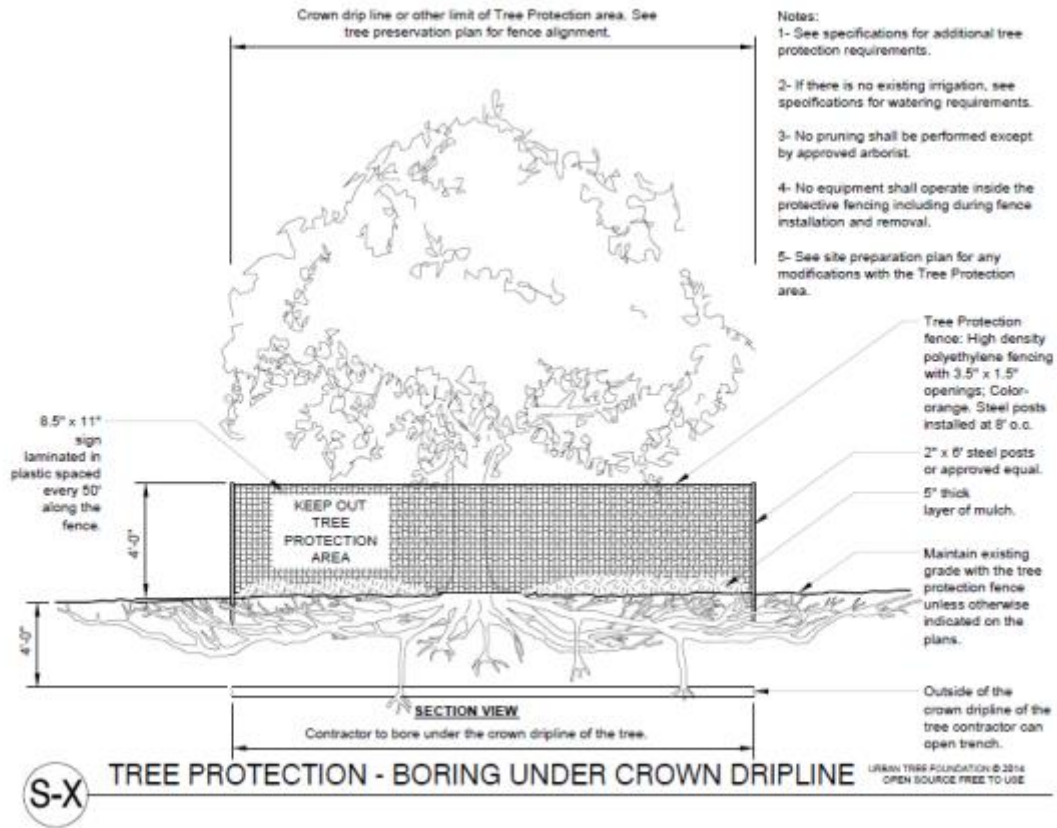

Tree Removal and Management Plan, Trees in Red to be removed,



Individual Tree Management Specifications

Tree 1 (*Eucalyptus paniculata* Grey Ironbark) is a tree in fair condition Appendix 1 (In Tree Impact Report) gives a description of the tree as per AS-4970-2009 Section 2. Appendix 2 (Tree Impact Report) shows a photograph of the tree; Appendix 4 (tree Impact Report) indicates the location of the tree on a survey plan of the site.

The tree will be severely affected by the proposed development works (See Appendix 1 Tree Impact Report). The hydrological and soil environments of the tree will be heavily impacted. The TPZ of the tree will have an unacceptable incursion of 50% from the proposed development works. The tree will require removal as part of the proposed development

Do not fell the tree with a single cut unless the tree will fall in an area not included in the Tree and Plant Protection Area. No tree to be removed within 15m of the Tree and Plant Protection Area shall be pushed over or up-rooted using a piece of grading equipment

Protect adjacent paving, soil, trees, shrubs, ground cover plantings and understory plants to remain from damage during all tree removal operations, and from construction operations. Protection shall include the root system, trunk, limbs, and crown from breakage or scarring, and the soil from compaction.

Remove stumps and immediate root plate from existing trees to be removed. Grind trunk bases and large buttress roots to a depth of the largest buttress root or at least 200mm below the top most roots whichever is less and over the area of three times the diameter of the trunk (DBH).

For trees where the stump will fall under new paved areas, grind roots to a total depth of 450mm below the existing grade. If the sides of the stump hole still have greater than approximately 20% wood visible, continue grinding operation deeper and or wider until the resulting hole has less than 20% wood.

Remove all wood chips produced by the grinding operation and back fill in 200mm layers with controlled fill of a quality acceptable to the site engineer for fill material under structures, compacted to 95% of the maximum dry density standard proctor. Project Arborist shall approve each hole at the end of the grinding operation.

In areas where the tree location is to be a planting bed or lawn, remove all woodchips and backfill stump holes with planting soil as defined in Specification Section Planting Soil, in maximum of 300mm layers and compact to 80 - 85% of the maximum dry density standard proctor.

Using a commercial, high-powered vacuum truck if required, remove the soil from the excavation produced by the Air Knife excavation. The vacuum truck should generally operate simultaneously with the hose operator, such that the soil produced is picked up from the excavation hole, and the exposed roots can be observed and not damaged by the ongoing operation. Do not drive the vacuum truck into the Tree and Plant Protection Area unless the area is protected from compaction as approved in advance by the Owner's Representative.

Remove all excavated soil and excavated Wood Chips, and contaminated soil at the end of the excavation.

Schedule the work so that foundations or utility work is completed immediately after the

excavation. Do not let the roots dry out. Mist the roots several times during the day. If the excavated area must remain open overnight, mist the roots and cover the excavation with black plastic.

Dispose of all soil in a manner that meets local laws and regulations.

Restore soil within the trench as soon as the work is completed. Utilize soil of similar texture to the removed soil and lightly compact with hand tools. Leave soil mounded over the trench to a height of approximately 10% of the trench depth to account for settlement.

Restore any Geogrids, Filter Fabric, Wood Chips or Mulch and or matting that was previously required for the area

Tree 2 (*Ficus benjamina* Weeping Fig) is a tree in fair condition Appendix 1 (In Tree Impact Report) gives a description of the tree as per AS-4970-2009 Section 2. Appendix 2 (Tree Impact Report) shows a photograph of the tree; Appendix 4 (tree Impact Report) indicates the location of the tree on a survey plan of the site.

The tree will be severely affected by the proposed development works (See Appendix 1 Tree Impact Report). The hydrological and soil environments of the tree will be heavily impacted. The TPZ of the tree will have an unacceptable incursion of 50% from the proposed development works. The tree will require removal as part of the proposed development

Do not fell the tree with a single cut unless the tree will fall in an area not included in the Tree and Plant Protection Area. No tree to be removed within 15m of the Tree and Plant Protection Area shall be pushed over or up-rooted using a piece of grading equipment

Protect adjacent paving, soil, trees, shrubs, ground cover plantings and understory plants to remain from damage during all tree removal operations, and from construction operations. Protection shall include the root system, trunk, limbs, and crown from breakage or scarring, and the soil from compaction.

Remove stumps and immediate root plate from existing trees to be removed. Grind trunk bases and large buttress roots to a depth of the largest buttress root or at least 200mm below the top most roots whichever is less and over the area of three times the diameter of the trunk (DBH).

For trees where the stump will fall under new paved areas, grind roots to a total depth of 450mm below the existing grade. If the sides of the stump hole still have greater than approximately 20% wood visible, continue grinding operation deeper and or wider until the resulting hole has less than 20% wood.

Remove all wood chips produced by the grinding operation and back fill in 200mm layers with controlled fill of a quality acceptable to the site engineer for fill material under structures, compacted to 95% of the maximum dry density standard proctor. Project Arborist shall approve each hole at the end of the grinding operation.

In areas where the tree location is to be a planting bed or lawn, remove all woodchips and backfill stump holes with planting soil as defined in Specification Section Planting Soil, in maximum of 300mm layers and compact to 80 - 85% of the maximum dry density standard proctor.

Using a commercial, high-powered vacuum truck if required, remove the soil from the excavation produced by the Air Knife excavation. The vacuum truck should generally operate simultaneously with the hose operator, such that the soil produced is picked up from the excavation hole, and the exposed roots can be observed and not damaged by the ongoing operation. Do not drive the vacuum truck into the Tree and Plant Protection Area unless the area is protected from compaction as approved in advance by the Owner's Representative.

Remove all excavated soil and excavated Wood Chips, and contaminated soil at the end of the excavation.

Schedule the work so that foundations or utility work is completed immediately after the excavation. Do not let the roots dry out. Mist the roots several times during the day. If the excavated area must remain open overnight, mist the roots and cover the excavation with

black plastic.

Dispose of all soil in a manner that meets local laws and regulations.

Restore soil within the trench as soon as the work is completed. Utilize soil of similar texture to the removed soil and lightly compact with hand tools. Leave soil mounded over the trench to a height of approximately 10% of the trench depth to account for settlement.

Restore any Geogrids, Filter Fabric, Wood Chips or Mulch and or matting that was previously required for the area

Tree 3 (*Eucalyptus paniculata* Grey Ironbark) is a tree in fair condition Appendix 1 (In Tree Impact Report) gives a description of the tree as per AS-4970-2009 Section 2. Appendix 2 (Tree Impact Report) shows a photograph of the tree; Appendix 4 (tree Impact Report) indicates the location of the tree on a survey plan of the site.

The tree will be severely affected by the proposed development works (See Appendix 1 Tree Impact Report). The hydrological and soil environments of the tree will be heavily impacted. The TPZ of the tree will have an unacceptable incursion of 50% from the proposed development works. The tree will require removal as part of the proposed development

Do not fell the tree with a single cut unless the tree will fall in an area not included in the Tree and Plant Protection Area. No tree to be removed within 15m of the Tree and Plant Protection Area shall be pushed over or up-rooted using a piece of grading equipment

Protect adjacent paving, soil, trees, shrubs, ground cover plantings and understory plants to remain from damage during all tree removal operations, and from construction operations. Protection shall include the root system, trunk, limbs, and crown from breakage or scarring, and the soil from compaction.

Remove stumps and immediate root plate from existing trees to be removed. Grind trunk bases and large buttress roots to a depth of the largest buttress root or at least 200mm below the top most roots whichever is less and over the area of three times the diameter of the trunk (DBH).

For trees where the stump will fall under new paved areas, grind roots to a total depth of 450mm below the existing grade. If the sides of the stump hole still have greater than approximately 20% wood visible, continue grinding operation deeper and or wider until the resulting hole has less than 20% wood.

Remove all wood chips produced by the grinding operation and back fill in 200mm layers with controlled fill of a quality acceptable to the site engineer for fill material under structures, compacted to 95% of the maximum dry density standard proctor. Project Arborist shall approve each hole at the end of the grinding operation.

In areas where the tree location is to be a planting bed or lawn, remove all woodchips and backfill stump holes with planting soil as defined in Specification Section Planting Soil, in maximum of 300mm layers and compact to 80 - 85% of the maximum dry density standard proctor.

Using a commercial, high-powered vacuum truck if required, remove the soil from the excavation produced by the Air Knife excavation. The vacuum truck should generally operate simultaneously with the hose operator, such that the soil produced is picked up from the excavation hole, and the exposed roots can be observed and not damaged by the ongoing operation. Do not drive the vacuum truck into the Tree and Plant Protection Area unless the area is protected from compaction as approved in advance by the Owner's Representative.

Remove all excavated soil and excavated Wood Chips, and contaminated soil at the end of the excavation.

Schedule the work so that foundations or utility work is completed immediately after the excavation. Do not let the roots dry out. Mist the roots several times during the day. If the excavated area must remain open overnight, mist the roots and cover the excavation with

black plastic.

Dispose of all soil in a manner that meets local laws and regulations.

Restore soil within the trench as soon as the work is completed. Utilize soil of similar texture to the removed soil and lightly compact with hand tools. Leave soil mounded over the trench to a height of approximately 10% of the trench depth to account for settlement.

Restore any Geogrids, Filter Fabric, Wood Chips or Mulch and or matting that was previously required for the area

Tree 4 (*Jacaranda mimosifolia* Jacaranda) is a tree in fair condition Appendix 1 (In Tree Impact Report) gives a description of the tree as per AS-4970-2009 Section 2. Appendix 2 (Tree Impact Report) shows a photograph of the tree; Appendix 4 (tree Impact Report) indicates the location of the tree on a survey plan of the site.

The tree will be severely affected by the proposed development works (See Appendix 1 Tree Impact Report). The hydrological and soil environments of the tree will be heavily impacted. The TPZ of the tree will have an unacceptable incursion of 50% from the proposed development works. The tree will require removal as part of the proposed development

Do not fell the tree with a single cut unless the tree will fall in an area not included in the Tree and Plant Protection Area. No tree to be removed within 15m of the Tree and Plant Protection Area shall be pushed over or up-rooted using a piece of grading equipment

Protect adjacent paving, soil, trees, shrubs, ground cover plantings and understory plants to remain from damage during all tree removal operations, and from construction operations. Protection shall include the root system, trunk, limbs, and crown from breakage or scarring, and the soil from compaction.

Remove stumps and immediate root plate from existing trees to be removed. Grind trunk bases and large buttress roots to a depth of the largest buttress root or at least 200mm below the top most roots whichever is less and over the area of three times the diameter of the trunk (DBH).

For trees where the stump will fall under new paved areas, grind roots to a total depth of 450mm below the existing grade. If the sides of the stump hole still have greater than approximately 20% wood visible, continue grinding operation deeper and or wider until the resulting hole has less than 20% wood.

Remove all wood chips produced by the grinding operation and back fill in 200mm layers with controlled fill of a quality acceptable to the site engineer for fill material under structures, compacted to 95% of the maximum dry density standard proctor. Project Arborist shall approve each hole at the end of the grinding operation.

In areas where the tree location is to be a planting bed or lawn, remove all woodchips and backfill stump holes with planting soil as defined in Specification Section Planting Soil, in maximum of 300mm layers and compact to 80 - 85% of the maximum dry density standard proctor.

Using a commercial, high-powered vacuum truck if required, remove the soil from the excavation produced by the Air Knife excavation. The vacuum truck should generally operate simultaneously with the hose operator, such that the soil produced is picked up from the excavation hole, and the exposed roots can be observed and not damaged by the ongoing operation. Do not drive the vacuum truck into the Tree and Plant Protection Area unless the area is protected from compaction as approved in advance by the Owner's Representative.

Remove all excavated soil and excavated Wood Chips, and contaminated soil at the end of the excavation.

Schedule the work so that foundations or utility work is completed immediately after the excavation. Do not let the roots dry out. Mist the roots several times during the day. If the excavated area must remain open overnight, mist the roots and cover the excavation with

black plastic.

Dispose of all soil in a manner that meets local laws and regulations.

Restore soil within the trench as soon as the work is completed. Utilize soil of similar texture to the removed soil and lightly compact with hand tools. Leave soil mounded over the trench to a height of approximately 10% of the trench depth to account for settlement.

Restore any Geogrids, Filter Fabric, Wood Chips or Mulch and or matting that was previously required for the area

Tree 5 (*Jacaranda mimosifolia* Jacaranda) is a tree in fair condition Appendix 1 (In Tree Impact Report) gives a description of the tree as per AS-4970-2009 Section 2. Appendix 2 (Tree Impact Report) shows a photograph of the tree; Appendix 4 (tree Impact Report) indicates the location of the tree on a survey plan of the site.

The tree will be severely affected by the proposed development works (See Appendix 1 Tree Impact Report). The hydrological and soil environments of the tree will be heavily impacted. The TPZ of the tree will have an unacceptable incursion of 50% from the proposed development works. The tree will require removal as part of the proposed development

Do not fell the tree with a single cut unless the tree will fall in an area not included in the Tree and Plant Protection Area. No tree to be removed within 15m of the Tree and Plant Protection Area shall be pushed over or up-rooted using a piece of grading equipment

Protect adjacent paving, soil, trees, shrubs, ground cover plantings and understory plants to remain from damage during all tree removal operations, and from construction operations. Protection shall include the root system, trunk, limbs, and crown from breakage or scarring, and the soil from compaction.

Remove stumps and immediate root plate from existing trees to be removed. Grind trunk bases and large buttress roots to a depth of the largest buttress root or at least 200mm below the top most roots whichever is less and over the area of three times the diameter of the trunk (DBH).

For trees where the stump will fall under new paved areas, grind roots to a total depth of 450mm below the existing grade. If the sides of the stump hole still have greater than approximately 20% wood visible, continue grinding operation deeper and or wider until the resulting hole has less than 20% wood.

Remove all wood chips produced by the grinding operation and back fill in 200mm layers with controlled fill of a quality acceptable to the site engineer for fill material under structures, compacted to 95% of the maximum dry density standard proctor. Project Arborist shall approve each hole at the end of the grinding operation.

In areas where the tree location is to be a planting bed or lawn, remove all woodchips and backfill stump holes with planting soil as defined in Specification Section Planting Soil, in maximum of 300mm layers and compact to 80 - 85% of the maximum dry density standard proctor.

Using a commercial, high-powered vacuum truck if required, remove the soil from the excavation produced by the Air Knife excavation. The vacuum truck should generally operate simultaneously with the hose operator, such that the soil produced is picked up from the excavation hole, and the exposed roots can be observed and not damaged by the ongoing operation. Do not drive the vacuum truck into the Tree and Plant Protection Area unless the area is protected from compaction as approved in advance by the Owner's Representative.

Remove all excavated soil and excavated Wood Chips, and contaminated soil at the end of the excavation.

Schedule the work so that foundations or utility work is completed immediately after the excavation. Do not let the roots dry out. Mist the roots several times during the day. If the excavated area must remain open overnight, mist the roots and cover the excavation with

black plastic.

Dispose of all soil in a manner that meets local laws and regulations.

Restore soil within the trench as soon as the work is completed. Utilize soil of similar texture to the removed soil and lightly compact with hand tools. Leave soil mounded over the trench to a height of approximately 10% of the trench depth to account for settlement.

Restore any Geogrids, Filter Fabric, Wood Chips or Mulch and or matting that was previously required for the area

Tree 6 (*Cinnamomum camphora* Camphorlaurel) is a tree in fair condition Appendix 1 (In Tree Impact Report) gives a description of the tree as per AS-4970-2009 Section 2. Appendix 2 (Tree Impact Report) shows a photograph of the tree; Appendix 4 (tree Impact Report) indicates the location of the tree on a survey plan of the site.

The tree will be severely affected by the proposed development works (See Appendix 1 Tree Impact Report). The hydrological and soil environments of the tree will be heavily impacted. The TPZ of the tree will have an unacceptable incursion of 50% from the proposed development works. The tree will require removal as part of the proposed development

Do not fell the tree with a single cut unless the tree will fall in an area not included in the Tree and Plant Protection Area. No tree to be removed within 15m of the Tree and Plant Protection Area shall be pushed over or up-rooted using a piece of grading equipment

Protect adjacent paving, soil, trees, shrubs, ground cover plantings and understory plants to remain from damage during all tree removal operations, and from construction operations. Protection shall include the root system, trunk, limbs, and crown from breakage or scarring, and the soil from compaction.

Remove stumps and immediate root plate from existing trees to be removed. Grind trunk bases and large buttress roots to a depth of the largest buttress root or at least 200mm below the top most roots whichever is less and over the area of three times the diameter of the trunk (DBH).

For trees where the stump will fall under new paved areas, grind roots to a total depth of 450mm below the existing grade. If the sides of the stump hole still have greater than approximately 20% wood visible, continue grinding operation deeper and or wider until the resulting hole has less than 20% wood.

Remove all wood chips produced by the grinding operation and back fill in 200mm layers with controlled fill of a quality acceptable to the site engineer for fill material under structures, compacted to 95% of the maximum dry density standard proctor. Project Arborist shall approve each hole at the end of the grinding operation.

In areas where the tree location is to be a planting bed or lawn, remove all woodchips and backfill stump holes with planting soil as defined in Specification Section Planting Soil, in maximum of 300mm layers and compact to 80 - 85% of the maximum dry density standard proctor.

Using a commercial, high-powered vacuum truck if required, remove the soil from the excavation produced by the Air Knife excavation. The vacuum truck should generally operate simultaneously with the hose operator, such that the soil produced is picked up from the excavation hole, and the exposed roots can be observed and not damaged by the ongoing operation. Do not drive the vacuum truck into the Tree and Plant Protection Area unless the area is protected from compaction as approved in advance by the Owner's Representative.

Remove all excavated soil and excavated Wood Chips, and contaminated soil at the end of the excavation.

Schedule the work so that foundations or utility work is completed immediately after the excavation. Do not let the roots dry out. Mist the roots several times during the day. If the excavated area must remain open overnight, mist the roots and cover the excavation with

black plastic.

Dispose of all soil in a manner that meets local laws and regulations.

Restore soil within the trench as soon as the work is completed. Utilize soil of similar texture to the removed soil and lightly compact with hand tools. Leave soil mounded over the trench to a height of approximately 10% of the trench depth to account for settlement.

Restore any Geogrids, Filter Fabric, Wood Chips or Mulch and or matting that was previously required for the area

Tree 7 (*Cinnamomum camphora* Camphorlaurel) is a tree in fair condition Appendix 1 (In Tree Impact Report) gives a description of the tree as per AS-4970-2009 Section 2. Appendix 2 (Tree Impact Report) shows a photograph of the tree; Appendix 4 (tree Impact Report) indicates the location of the tree on a survey plan of the site.

The tree will be severely affected by the proposed development works (See Appendix 1 Tree Impact Report). The hydrological and soil environments of the tree will be heavily impacted. The TPZ of the tree will have an unacceptable incursion of 50% from the proposed development works. The tree will require removal as part of the proposed development

Do not fell the tree with a single cut unless the tree will fall in an area not included in the Tree and Plant Protection Area. No tree to be removed within 15m of the Tree and Plant Protection Area shall be pushed over or up-rooted using a piece of grading equipment

Protect adjacent paving, soil, trees, shrubs, ground cover plantings and understory plants to remain from damage during all tree removal operations, and from construction operations. Protection shall include the root system, trunk, limbs, and crown from breakage or scarring, and the soil from compaction.

Remove stumps and immediate root plate from existing trees to be removed. Grind trunk bases and large buttress roots to a depth of the largest buttress root or at least 200mm below the top most roots whichever is less and over the area of three times the diameter of the trunk (DBH).

For trees where the stump will fall under new paved areas, grind roots to a total depth of 450mm below the existing grade. If the sides of the stump hole still have greater than approximately 20% wood visible, continue grinding operation deeper and or wider until the resulting hole has less than 20% wood.

Remove all wood chips produced by the grinding operation and back fill in 200mm layers with controlled fill of a quality acceptable to the site engineer for fill material under structures, compacted to 95% of the maximum dry density standard proctor. Project Arborist shall approve each hole at the end of the grinding operation.

In areas where the tree location is to be a planting bed or lawn, remove all woodchips and backfill stump holes with planting soil as defined in Specification Section Planting Soil, in maximum of 300mm layers and compact to 80 - 85% of the maximum dry density standard proctor.

Using a commercial, high-powered vacuum truck if required, remove the soil from the excavation produced by the Air Knife excavation. The vacuum truck should generally operate simultaneously with the hose operator, such that the soil produced is picked up from the excavation hole, and the exposed roots can be observed and not damaged by the ongoing operation. Do not drive the vacuum truck into the Tree and Plant Protection Area unless the area is protected from compaction as approved in advance by the Owner's Representative.

Remove all excavated soil and excavated Wood Chips, and contaminated soil at the end of the excavation.

Schedule the work so that foundations or utility work is completed immediately after the excavation. Do not let the roots dry out. Mist the roots several times during the day. If the excavated area must remain open overnight, mist the roots and cover the excavation with

black plastic.

Dispose of all soil in a manner that meets local laws and regulations.

Restore soil within the trench as soon as the work is completed. Utilize soil of similar texture to the removed soil and lightly compact with hand tools. Leave soil mounded over the trench to a height of approximately 10% of the trench depth to account for settlement.

Restore any Geogrids, Filter Fabric, Wood Chips or Mulch and or matting that was previously required for the area

Tree 8 (*Callistemon viminalis* Bottlebrush) is a tree in fair condition Appendix 1 (In Tree Impact Report) gives a description of the tree as per AS-4970-2009 Section 2. Appendix 2 (Tree Impact Report) shows a photograph of the tree; Appendix 4 (tree Impact Report) indicates the location of the tree on a survey plan of the site.

The tree will be severely affected by the proposed development works (See Appendix 1 Tree Impact Report). The hydrological and soil environments of the tree will be heavily impacted. The TPZ of the tree will have an unacceptable incursion of 50% from the proposed development works. The tree will require removal as part of the proposed development

Do not fell the tree with a single cut unless the tree will fall in an area not included in the Tree and Plant Protection Area. No tree to be removed within 15m of the Tree and Plant Protection Area shall be pushed over or up-rooted using a piece of grading equipment

Protect adjacent paving, soil, trees, shrubs, ground cover plantings and understory plants to remain from damage during all tree removal operations, and from construction operations. Protection shall include the root system, trunk, limbs, and crown from breakage or scarring, and the soil from compaction.

Remove stumps and immediate root plate from existing trees to be removed. Grind trunk bases and large buttress roots to a depth of the largest buttress root or at least 200mm below the top most roots whichever is less and over the area of three times the diameter of the trunk (DBH).

For trees where the stump will fall under new paved areas, grind roots to a total depth of 450mm below the existing grade. If the sides of the stump hole still have greater than approximately 20% wood visible, continue grinding operation deeper and or wider until the resulting hole has less than 20% wood.

Remove all wood chips produced by the grinding operation and back fill in 200mm layers with controlled fill of a quality acceptable to the site engineer for fill material under structures, compacted to 95% of the maximum dry density standard proctor. Project Arborist shall approve each hole at the end of the grinding operation.

In areas where the tree location is to be a planting bed or lawn, remove all woodchips and backfill stump holes with planting soil as defined in Specification Section Planting Soil, in maximum of 300mm layers and compact to 80 - 85% of the maximum dry density standard proctor.

Using a commercial, high-powered vacuum truck if required, remove the soil from the excavation produced by the Air Knife excavation. The vacuum truck should generally operate simultaneously with the hose operator, such that the soil produced is picked up from the excavation hole, and the exposed roots can be observed and not damaged by the ongoing operation. Do not drive the vacuum truck into the Tree and Plant Protection Area unless the area is protected from compaction as approved in advance by the Owner's Representative.

Remove all excavated soil and excavated Wood Chips, and contaminated soil at the end of the excavation.

Schedule the work so that foundations or utility work is completed immediately after the excavation. Do not let the roots dry out. Mist the roots several times during the day. If the excavated area must remain open overnight, mist the roots and cover the excavation with

black plastic.

Dispose of all soil in a manner that meets local laws and regulations.

Restore soil within the trench as soon as the work is completed. Utilize soil of similar texture to the removed soil and lightly compact with hand tools. Leave soil mounded over the trench to a height of approximately 10% of the trench depth to account for settlement.

Restore any Geogrids, Filter Fabric, Wood Chips or Mulch and or matting that was previously required for the area

Tree 9 (*Jacaranda mimosifolia* Jacaranda) is a tree in fair condition Appendix 1 (In Tree Impact Report) gives a description of the tree as per AS-4970-2009 Section 2. Appendix 2 (Tree Impact Report) shows a photograph of the tree; Appendix 4 (tree Impact Report) indicates the location of the tree on a survey plan of the site.

The tree will be severely affected by the proposed development works (See Appendix 1 Tree Impact Report). The hydrological and soil environments of the tree will be heavily impacted. The TPZ of the tree will have an unacceptable incursion of 50% from the proposed development works. The tree will require removal as part of the proposed development

Do not fell the tree with a single cut unless the tree will fall in an area not included in the Tree and Plant Protection Area. No tree to be removed within 15m of the Tree and Plant Protection Area shall be pushed over or up-rooted using a piece of grading equipment

Protect adjacent paving, soil, trees, shrubs, ground cover plantings and understory plants to remain from damage during all tree removal operations, and from construction operations. Protection shall include the root system, trunk, limbs, and crown from breakage or scarring, and the soil from compaction.

Remove stumps and immediate root plate from existing trees to be removed. Grind trunk bases and large buttress roots to a depth of the largest buttress root or at least 200mm below the top most roots whichever is less and over the area of three times the diameter of the trunk (DBH).

For trees where the stump will fall under new paved areas, grind roots to a total depth of 450mm below the existing grade. If the sides of the stump hole still have greater than approximately 20% wood visible, continue grinding operation deeper and or wider until the resulting hole has less than 20% wood.

Remove all wood chips produced by the grinding operation and back fill in 200mm layers with controlled fill of a quality acceptable to the site engineer for fill material under structures, compacted to 95% of the maximum dry density standard proctor. Project Arborist shall approve each hole at the end of the grinding operation.

In areas where the tree location is to be a planting bed or lawn, remove all woodchips and backfill stump holes with planting soil as defined in Specification Section Planting Soil, in maximum of 300mm layers and compact to 80 - 85% of the maximum dry density standard proctor.

Using a commercial, high-powered vacuum truck if required, remove the soil from the excavation produced by the Air Knife excavation. The vacuum truck should generally operate simultaneously with the hose operator, such that the soil produced is picked up from the excavation hole, and the exposed roots can be observed and not damaged by the ongoing operation. Do not drive the vacuum truck into the Tree and Plant Protection Area unless the area is protected from compaction as approved in advance by the Owner's Representative.

Remove all excavated soil and excavated Wood Chips, and contaminated soil at the end of the excavation.

Schedule the work so that foundations or utility work is completed immediately after the excavation. Do not let the roots dry out. Mist the roots several times during the day. If the excavated area must remain open overnight, mist the roots and cover the excavation with

black plastic.

Dispose of all soil in a manner that meets local laws and regulations.

Restore soil within the trench as soon as the work is completed. Utilize soil of similar texture to the removed soil and lightly compact with hand tools. Leave soil mounded over the trench to a height of approximately 10% of the trench depth to account for settlement.

Restore any Geogrids, Filter Fabric, Wood Chips or Mulch and or matting that was previously required for the area

Tree 10 (*Eucalyptus paniculata* Grey Ironbark) is a tree in fair condition Appendix 1 (In the Tree Impact Report) is a tree in fair condition Appendix 1 (In Tree Impact Report) gives a description of the tree as per AS-4970-2009 Section 2. Appendix 2 (Tree Impact Report) shows a photograph of the tree; Appendix 4 (tree Impact Report) indicates the location of the tree on a survey plan of the site.

The tree will be severely affected by the proposed development works (See Appendix 1 Tree Impact Report). The hydrological and soil environments of the tree will be heavily impacted. The TPZ of the tree will have an unacceptable incursion of 50% from the proposed development works. The tree will require removal as part of the proposed development

Do not fell the tree with a single cut unless the tree will fall in an area not included in the Tree and Plant Protection Area. No tree to be removed within 15m of the Tree and Plant Protection Area shall be pushed over or up-rooted using a piece of grading equipment

Protect adjacent paving, soil, trees, shrubs, ground cover plantings and understory plants to remain from damage during all tree removal operations, and from construction operations. Protection shall include the root system, trunk, limbs, and crown from breakage or scarring, and the soil from compaction.

Remove stumps and immediate root plate from existing trees to be removed. Grind trunk bases and large buttress roots to a depth of the largest buttress root or at least 200mm below the top most roots whichever is less and over the area of three times the diameter of the trunk (DBH).

For trees where the stump will fall under new paved areas, grind roots to a total depth of 450mm below the existing grade. If the sides of the stump hole still have greater than approximately 20% wood visible, continue grinding operation deeper and or wider until the resulting hole has less than 20% wood.

Remove all wood chips produced by the grinding operation and back fill in 200mm layers with controlled fill of a quality acceptable to the site engineer for fill material under structures, compacted to 95% of the maximum dry density standard proctor. Project Arborist shall approve each hole at the end of the grinding operation.

In areas where the tree location is to be a planting bed or lawn, remove all woodchips and backfill stump holes with planting soil as defined in Specification Section Planting Soil, in maximum of 300mm layers and compact to 80 - 85% of the maximum dry density standard proctor.

Using a commercial, high-powered vacuum truck if required, remove the soil from the excavation produced by the Air Knife excavation. The vacuum truck should generally operate simultaneously with the hose operator, such that the soil produced is picked up from the excavation hole, and the exposed roots can be observed and not damaged by the ongoing operation. Do not drive the vacuum truck into the Tree and Plant Protection Area unless the area is protected from compaction as approved in advance by the Owner's Representative.

Remove all excavated soil and excavated Wood Chips, and contaminated soil at the end of the excavation.

Schedule the work so that foundations or utility work is completed immediately after the

excavation. Do not let the roots dry out. Mist the roots several times during the day. If the excavated area must remain open overnight, mist the roots and cover the excavation with black plastic.

Dispose of all soil in a manner that meets local laws and regulations.

Restore soil within the trench as soon as the work is completed. Utilize soil of similar texture to the removed soil and lightly compact with hand tools. Leave soil mounded over the trench to a height of approximately 10% of the trench depth to account for settlement.

Restore any Geogrids, Filter Fabric, Wood Chips or Mulch and or matting that was previously required for the area

Tree 11 (*Pittosporum undulatum* Sweet Pittosporum) is a tree in fair condition Appendix 1 (In Tree Impact Report) gives a description of the tree as per AS-4970-2009 Section 2. Appendix 2 (Tree Impact Report) shows a photograph of the tree; Appendix 4 (tree Impact Report) indicates the location of the tree on a survey plan of the site.

The tree will be severely affected by the proposed development works (See Appendix 1 Tree Impact Report). The hydrological and soil environments of the tree will be heavily impacted. The TPZ of the tree will have an unacceptable incursion of 50% from the proposed development works. The tree will require removal as part of the proposed development

Do not fell the tree with a single cut unless the tree will fall in an area not included in the Tree and Plant Protection Area. No tree to be removed within 15m of the Tree and Plant Protection Area shall be pushed over or up-rooted using a piece of grading equipment

Protect adjacent paving, soil, trees, shrubs, ground cover plantings and understory plants to remain from damage during all tree removal operations, and from construction operations. Protection shall include the root system, trunk, limbs, and crown from breakage or scarring, and the soil from compaction.

Remove stumps and immediate root plate from existing trees to be removed. Grind trunk bases and large buttress roots to a depth of the largest buttress root or at least 200mm below the top most roots whichever is less and over the area of three times the diameter of the trunk (DBH).

For trees where the stump will fall under new paved areas, grind roots to a total depth of 450mm below the existing grade. If the sides of the stump hole still have greater than approximately 20% wood visible, continue grinding operation deeper and or wider until the resulting hole has less than 20% wood.

Remove all wood chips produced by the grinding operation and back fill in 200mm layers with controlled fill of a quality acceptable to the site engineer for fill material under structures, compacted to 95% of the maximum dry density standard proctor. Project Arborist shall approve each hole at the end of the grinding operation.

In areas where the tree location is to be a planting bed or lawn, remove all woodchips and backfill stump holes with planting soil as defined in Specification Section Planting Soil, in maximum of 300mm layers and compact to 80 - 85% of the maximum dry density standard proctor.

Using a commercial, high-powered vacuum truck if required, remove the soil from the excavation produced by the Air Knife excavation. The vacuum truck should generally operate simultaneously with the hose operator, such that the soil produced is picked up from the excavation hole, and the exposed roots can be observed and not damaged by the ongoing operation. Do not drive the vacuum truck into the Tree and Plant Protection Area unless the area is protected from compaction as approved in advance by the Owner's Representative.

Remove all excavated soil and excavated Wood Chips, and contaminated soil at the end of the excavation.

Schedule the work so that foundations or utility work is completed immediately after the excavation. Do not let the roots dry out. Mist the roots several times during the day. If the

excavated area must remain open overnight, mist the roots and cover the excavation with black plastic.

Dispose of all soil in a manner that meets local laws and regulations.

Restore soil within the trench as soon as the work is completed. Utilize soil of similar texture to the removed soil and lightly compact with hand tools. Leave soil mounded over the trench to a height of approximately 10% of the trench depth to account for settlement.

Restore any Geogrids, Filter Fabric, Wood Chips or Mulch and or matting that was previously required for the area

Tree 12 (*Eucalyptus paniculata* Grey Ironbark) is a tree in fair condition Appendix 1 (In Tree Impact Report) gives a description of the tree as per AS-4970-2009 Section 2. Appendix 2 (Tree Impact Report) shows a photograph of the tree; Appendix 4 (tree Impact Report) indicates the location of the tree on a survey plan of the site.

The tree will be severely affected by the proposed development works (See Appendix 1 Tree Impact Report). The hydrological and soil environments of the tree will be heavily impacted. The TPZ of the tree will have an unacceptable incursion of 50% from the proposed development works. The tree will require removal as part of the proposed development

Do not fell the tree with a single cut unless the tree will fall in an area not included in the Tree and Plant Protection Area. No tree to be removed within 15m of the Tree and Plant Protection Area shall be pushed over or up-rooted using a piece of grading equipment

Protect adjacent paving, soil, trees, shrubs, ground cover plantings and understory plants to remain from damage during all tree removal operations, and from construction operations. Protection shall include the root system, trunk, limbs, and crown from breakage or scarring, and the soil from compaction.

Remove stumps and immediate root plate from existing trees to be removed. Grind trunk bases and large buttress roots to a depth of the largest buttress root or at least 200mm below the top most roots whichever is less and over the area of three times the diameter of the trunk (DBH).

For trees where the stump will fall under new paved areas, grind roots to a total depth of 450mm below the existing grade. If the sides of the stump hole still have greater than approximately 20% wood visible, continue grinding operation deeper and or wider until the resulting hole has less than 20% wood.

Remove all wood chips produced by the grinding operation and back fill in 200mm layers with controlled fill of a quality acceptable to the site engineer for fill material under structures, compacted to 95% of the maximum dry density standard proctor. Project Arborist shall approve each hole at the end of the grinding operation.

In areas where the tree location is to be a planting bed or lawn, remove all woodchips and backfill stump holes with planting soil as defined in Specification Section Planting Soil, in maximum of 300mm layers and compact to 80 - 85% of the maximum dry density standard proctor.

Using a commercial, high-powered vacuum truck if required, remove the soil from the excavation produced by the Air Knife excavation. The vacuum truck should generally operate simultaneously with the hose operator, such that the soil produced is picked up from the excavation hole, and the exposed roots can be observed and not damaged by the ongoing operation. Do not drive the vacuum truck into the Tree and Plant Protection Area unless the area is protected from compaction as approved in advance by the Owner's Representative.

Remove all excavated soil and excavated Wood Chips, and contaminated soil at the end of the excavation.

Schedule the work so that foundations or utility work is completed immediately after the excavation. Do not let the roots dry out. Mist the roots several times during the day. If the

excavated area must remain open overnight, mist the roots and cover the excavation with black plastic.

Dispose of all soil in a manner that meets local laws and regulations.

Restore soil within the trench as soon as the work is completed. Utilize soil of similar texture to the removed soil and lightly compact with hand tools. Leave soil mounded over the trench to a height of approximately 10% of the trench depth to account for settlement.

Restore any Geogrids, Filter Fabric, Wood Chips or Mulch and or matting that was previously required for the area

Tree 13 (*Jacaranda mimosifolia* Jacaranda) is a tree in fair condition Appendix 1 (In Tree Impact Report) gives a description of the tree as per AS-4970-2009 Section 2. Appendix 2 (Tree Impact Report) shows a photograph of the tree; Appendix 4 (tree Impact Report) indicates the location of the tree on a survey plan of the site.

The tree will be severely affected by the proposed development works (See Appendix 1 Tree Impact Report). The hydrological and soil environments of the tree will be heavily impacted. The TPZ of the tree will have an unacceptable incursion of 50% from the proposed development works. The tree will require removal as part of the proposed development

Do not fell the tree with a single cut unless the tree will fall in an area not included in the Tree and Plant Protection Area. No tree to be removed within 15m of the Tree and Plant Protection Area shall be pushed over or up-rooted using a piece of grading equipment

Protect adjacent paving, soil, trees, shrubs, ground cover plantings and understory plants to remain from damage during all tree removal operations, and from construction operations. Protection shall include the root system, trunk, limbs, and crown from breakage or scarring, and the soil from compaction.

Remove stumps and immediate root plate from existing trees to be removed. Grind trunk bases and large buttress roots to a depth of the largest buttress root or at least 200mm below the top most roots whichever is less and over the area of three times the diameter of the trunk (DBH).

For trees where the stump will fall under new paved areas, grind roots to a total depth of 450mm below the existing grade. If the sides of the stump hole still have greater than approximately 20% wood visible, continue grinding operation deeper and or wider until the resulting hole has less than 20% wood.

Remove all wood chips produced by the grinding operation and back fill in 200mm layers with controlled fill of a quality acceptable to the site engineer for fill material under structures, compacted to 95% of the maximum dry density standard proctor. Project Arborist shall approve each hole at the end of the grinding operation.

In areas where the tree location is to be a planting bed or lawn, remove all woodchips and backfill stump holes with planting soil as defined in Specification Section Planting Soil, in maximum of 300mm layers and compact to 80 - 85% of the maximum dry density standard proctor.

Using a commercial, high-powered vacuum truck if required, remove the soil from the excavation produced by the Air Knife excavation. The vacuum truck should generally operate simultaneously with the hose operator, such that the soil produced is picked up from the excavation hole, and the exposed roots can be observed and not damaged by the ongoing operation. Do not drive the vacuum truck into the Tree and Plant Protection Area unless the area is protected from compaction as approved in advance by the Owner's Representative.

Remove all excavated soil and excavated Wood Chips, and contaminated soil at the end of the excavation.

Schedule the work so that foundations or utility work is completed immediately after the

excavation. Do not let the roots dry out. Mist the roots several times during the day. If the excavated area must remain open overnight, mist the roots and cover the excavation with black plastic.

Dispose of all soil in a manner that meets local laws and regulations.

Restore soil within the trench as soon as the work is completed. Utilize soil of similar texture to the removed soil and lightly compact with hand tools. Leave soil mounded over the trench to a height of approximately 10% of the trench depth to account for settlement.

Restore any Geogrids, Filter Fabric, Wood Chips or Mulch and or matting that was previously required for the area

Tree 14 (*Unknown Species* Non indigenous) is a tree in fair condition Appendix 1 (In Tree Impact Report) gives a description of the tree as per AS-4970-2009 Section 2. Appendix 2 (Tree Impact Report) shows a photograph of the tree; Appendix 4 (tree Impact Report) indicates the location of the tree on a survey plan of the site.

The tree will be severely affected by the proposed development works (See Appendix 1 Tree Impact Report). The hydrological and soil environments of the tree will be heavily impacted. The TPZ of the tree will have an unacceptable incursion of 50% from the proposed development works. The tree will require removal as part of the proposed development

Do not fell the tree with a single cut unless the tree will fall in an area not included in the Tree and Plant Protection Area. No tree to be removed within 15m of the Tree and Plant Protection Area shall be pushed over or up-rooted using a piece of grading equipment

Protect adjacent paving, soil, trees, shrubs, ground cover plantings and understory plants to remain from damage during all tree removal operations, and from construction operations. Protection shall include the root system, trunk, limbs, and crown from breakage or scarring, and the soil from compaction.

Remove stumps and immediate root plate from existing trees to be removed. Grind trunk bases and large buttress roots to a depth of the largest buttress root or at least 200mm below the top most roots whichever is less and over the area of three times the diameter of the trunk (DBH).

For trees where the stump will fall under new paved areas, grind roots to a total depth of 450mm below the existing grade. If the sides of the stump hole still have greater than approximately 20% wood visible, continue grinding operation deeper and or wider until the resulting hole has less than 20% wood.

Remove all wood chips produced by the grinding operation and back fill in 200mm layers with controlled fill of a quality acceptable to the site engineer for fill material under structures, compacted to 95% of the maximum dry density standard proctor. Project Arborist shall approve each hole at the end of the grinding operation.

In areas where the tree location is to be a planting bed or lawn, remove all woodchips and backfill stump holes with planting soil as defined in Specification Section Planting Soil, in maximum of 300mm layers and compact to 80 - 85% of the maximum dry density standard proctor.

Using a commercial, high-powered vacuum truck if required, remove the soil from the excavation produced by the Air Knife excavation. The vacuum truck should generally operate simultaneously with the hose operator, such that the soil produced is picked up from the excavation hole, and the exposed roots can be observed and not damaged by the ongoing operation. Do not drive the vacuum truck into the Tree and Plant Protection Area unless the area is protected from compaction as approved in advance by the Owner's Representative.

Remove all excavated soil and excavated Wood Chips, and contaminated soil at the end of the excavation.

Schedule the work so that foundations or utility work is completed immediately after the excavation. Do not let the roots dry out. Mist the roots several times during the day. If the excavated area must remain open overnight, mist the roots and cover the excavation with

black plastic.

Dispose of all soil in a manner that meets local laws and regulations.

Restore soil within the trench as soon as the work is completed. Utilize soil of similar texture to the removed soil and lightly compact with hand tools. Leave soil mounded over the trench to a height of approximately 10% of the trench depth to account for settlement.

Restore any Geogrids, Filter Fabric, Wood Chips or Mulch and or matting that was previously required for the area

Tree 15 (*Liquidambar styraciflua* Liquidamber) is a tree in fair condition Appendix 1 (In Tree Impact Report) gives a description of the tree as per AS-4970-2009 Section 2. Appendix 2 (Tree Impact Report) shows a photograph of the tree; Appendix 4 (tree Impact Report) indicates the location of the tree on a survey plan of the site.

The tree will be severely affected by the proposed development works (See Appendix 1 Tree Impact Report). The hydrological and soil environments of the tree will be heavily impacted. The TPZ of the tree will have an unacceptable incursion of 50% from the proposed development works. The tree will require removal as part of the proposed development

Do not fell the tree with a single cut unless the tree will fall in an area not included in the Tree and Plant Protection Area. No tree to be removed within 15m of the Tree and Plant Protection Area shall be pushed over or up-rooted using a piece of grading equipment

Protect adjacent paving, soil, trees, shrubs, ground cover plantings and understory plants to remain from damage during all tree removal operations, and from construction operations. Protection shall include the root system, trunk, limbs, and crown from breakage or scarring, and the soil from compaction.

Remove stumps and immediate root plate from existing trees to be removed. Grind trunk bases and large buttress roots to a depth of the largest buttress root or at least 200mm below the top most roots whichever is less and over the area of three times the diameter of the trunk (DBH).

For trees where the stump will fall under new paved areas, grind roots to a total depth of 450mm below the existing grade. If the sides of the stump hole still have greater than approximately 20% wood visible, continue grinding operation deeper and or wider until the resulting hole has less than 20% wood.

Remove all wood chips produced by the grinding operation and back fill in 200mm layers with controlled fill of a quality acceptable to the site engineer for fill material under structures, compacted to 95% of the maximum dry density standard proctor. Project Arborist shall approve each hole at the end of the grinding operation.

In areas where the tree location is to be a planting bed or lawn, remove all woodchips and backfill stump holes with planting soil as defined in Specification Section Planting Soil, in maximum of 300mm layers and compact to 80 - 85% of the maximum dry density standard proctor.

Using a commercial, high-powered vacuum truck if required, remove the soil from the excavation produced by the Air Knife excavation. The vacuum truck should generally operate simultaneously with the hose operator, such that the soil produced is picked up from the excavation hole, and the exposed roots can be observed and not damaged by the ongoing operation. Do not drive the vacuum truck into the Tree and Plant Protection Area unless the area is protected from compaction as approved in advance by the Owner's Representative.

Remove all excavated soil and excavated Wood Chips, and contaminated soil at the end of the excavation.

Schedule the work so that foundations or utility work is completed immediately after the excavation. Do not let the roots dry out. Mist the roots several times during the day. If the excavated area must remain open overnight, mist the roots and cover the excavation with

black plastic.

Dispose of all soil in a manner that meets local laws and regulations.

Restore soil within the trench as soon as the work is completed. Utilize soil of similar texture to the removed soil and lightly compact with hand tools. Leave soil mounded over the trench to a height of approximately 10% of the trench depth to account for settlement.

Restore any Geogrids, Filter Fabric, Wood Chips or Mulch and or matting that was previously required for the area

Tree 16 (*Casuarina glauca* Swamp Oak) is a tree in fair condition Appendix 1 (In Tree Impact Report) gives a description of the tree as per AS-4970-2009 Section 2. Appendix 2 (Tree Impact Report) shows a photograph of the tree; Appendix 4 (tree Impact Report) indicates the location of the tree on a survey plan of the site.

The tree will be severely affected by the proposed development works (See Appendix 1 Tree Impact Report). The hydrological and soil environments of the tree will be heavily impacted. The TPZ of the tree will have an unacceptable incursion of 50% from the proposed development works. The tree will require removal as part of the proposed development

Do not fell the tree with a single cut unless the tree will fall in an area not included in the Tree and Plant Protection Area. No tree to be removed within 15m of the Tree and Plant Protection Area shall be pushed over or up-rooted using a piece of grading equipment

Protect adjacent paving, soil, trees, shrubs, ground cover plantings and understory plants to remain from damage during all tree removal operations, and from construction operations. Protection shall include the root system, trunk, limbs, and crown from breakage or scarring, and the soil from compaction.

Remove stumps and immediate root plate from existing trees to be removed. Grind trunk bases and large buttress roots to a depth of the largest buttress root or at least 200mm below the top most roots whichever is less and over the area of three times the diameter of the trunk (DBH).

For trees where the stump will fall under new paved areas, grind roots to a total depth of 450mm below the existing grade. If the sides of the stump hole still have greater than approximately 20% wood visible, continue grinding operation deeper and or wider until the resulting hole has less than 20% wood.

Remove all wood chips produced by the grinding operation and back fill in 200mm layers with controlled fill of a quality acceptable to the site engineer for fill material under structures, compacted to 95% of the maximum dry density standard proctor. Project Arborist shall approve each hole at the end of the grinding operation.

In areas where the tree location is to be a planting bed or lawn, remove all woodchips and backfill stump holes with planting soil as defined in Specification Section Planting Soil, in maximum of 300mm layers and compact to 80 - 85% of the maximum dry density standard proctor.

Using a commercial, high-powered vacuum truck if required, remove the soil from the excavation produced by the Air Knife excavation. The vacuum truck should generally operate simultaneously with the hose operator, such that the soil produced is picked up from the excavation hole, and the exposed roots can be observed and not damaged by the ongoing operation. Do not drive the vacuum truck into the Tree and Plant Protection Area unless the area is protected from compaction as approved in advance by the Owner's Representative.

Remove all excavated soil and excavated Wood Chips, and contaminated soil at the end of the excavation.

Schedule the work so that foundations or utility work is completed immediately after the excavation. Do not let the roots dry out. Mist the roots several times during the day. If the excavated area must remain open overnight, mist the roots and cover the excavation with

black plastic.

Dispose of all soil in a manner that meets local laws and regulations.

Restore soil within the trench as soon as the work is completed. Utilize soil of similar texture to the removed soil and lightly compact with hand tools. Leave soil mounded over the trench to a height of approximately 10% of the trench depth to account for settlement.

Restore any Geogrids, Filter Fabric, Wood Chips or Mulch and or matting that was previously required for the area

Tree 17 (*Schinus areira* Peppercorn) is a tree in fair condition Appendix 1 (In Tree Impact Report) gives a description of the tree as per AS-4970-2009 Section 2. Appendix 2 (Tree Impact Report) shows a photograph of the tree; Appendix 4 (tree Impact Report) indicates the location of the tree on a survey plan of the site.

The tree will be severely affected by the proposed development works (See Appendix 1 Tree Impact Report). The hydrological and soil environments of the tree will be heavily impacted. The TPZ of the tree will have an unacceptable incursion of 50% from the proposed development works. The tree will require removal as part of the proposed development

Do not fell the tree with a single cut unless the tree will fall in an area not included in the Tree and Plant Protection Area. No tree to be removed within 15m of the Tree and Plant Protection Area shall be pushed over or up-rooted using a piece of grading equipment

Protect adjacent paving, soil, trees, shrubs, ground cover plantings and understory plants to remain from damage during all tree removal operations, and from construction operations. Protection shall include the root system, trunk, limbs, and crown from breakage or scarring, and the soil from compaction.

Remove stumps and immediate root plate from existing trees to be removed. Grind trunk bases and large buttress roots to a depth of the largest buttress root or at least 200mm below the top most roots whichever is less and over the area of three times the diameter of the trunk (DBH).

For trees where the stump will fall under new paved areas, grind roots to a total depth of 450mm below the existing grade. If the sides of the stump hole still have greater than approximately 20% wood visible, continue grinding operation deeper and or wider until the resulting hole has less than 20% wood.

Remove all wood chips produced by the grinding operation and back fill in 200mm layers with controlled fill of a quality acceptable to the site engineer for fill material under structures, compacted to 95% of the maximum dry density standard proctor. Project Arborist shall approve each hole at the end of the grinding operation.

In areas where the tree location is to be a planting bed or lawn, remove all woodchips and backfill stump holes with planting soil as defined in Specification Section Planting Soil, in maximum of 300mm layers and compact to 80 - 85% of the maximum dry density standard proctor.

Using a commercial, high-powered vacuum truck if required, remove the soil from the excavation produced by the Air Knife excavation. The vacuum truck should generally operate simultaneously with the hose operator, such that the soil produced is picked up from the excavation hole, and the exposed roots can be observed and not damaged by the ongoing operation. Do not drive the vacuum truck into the Tree and Plant Protection Area unless the area is protected from compaction as approved in advance by the Owner's Representative.

Remove all excavated soil and excavated Wood Chips, and contaminated soil at the end of the excavation.

Schedule the work so that foundations or utility work is completed immediately after the excavation. Do not let the roots dry out. Mist the roots several times during the day. If the excavated area must remain open overnight, mist the roots and cover the excavation with

black plastic.

Dispose of all soil in a manner that meets local laws and regulations.

Restore soil within the trench as soon as the work is completed. Utilize soil of similar texture to the removed soil and lightly compact with hand tools. Leave soil mounded over the trench to a height of approximately 10% of the trench depth to account for settlement.

Restore any Geogrids, Filter Fabric, Wood Chips or Mulch and or matting that was previously required for the area

Tree 18 (*Liquidambar styraciflua* Liquidamber) is a tree in fair condition Appendix 1 (In Tree Impact Report) gives a description of the tree as per AS-4970-2009 Section 2. Appendix 2 (Tree Impact Report) shows a photograph of the tree; Appendix 4 (tree Impact Report) indicates the location of the tree on a survey plan of the site.

The tree will be severely affected by the proposed development works (See Appendix 1 Tree Impact Report). The hydrological and soil environments of the tree will be heavily impacted. The TPZ of the tree will have an unacceptable incursion of 50% from the proposed development works. The tree will require removal as part of the proposed development

Do not fell the tree with a single cut unless the tree will fall in an area not included in the Tree and Plant Protection Area. No tree to be removed within 15m of the Tree and Plant Protection Area shall be pushed over or up-rooted using a piece of grading equipment

Protect adjacent paving, soil, trees, shrubs, ground cover plantings and understory plants to remain from damage during all tree removal operations, and from construction operations. Protection shall include the root system, trunk, limbs, and crown from breakage or scarring, and the soil from compaction.

Remove stumps and immediate root plate from existing trees to be removed. Grind trunk bases and large buttress roots to a depth of the largest buttress root or at least 200mm below the top most roots whichever is less and over the area of three times the diameter of the trunk (DBH).

For trees where the stump will fall under new paved areas, grind roots to a total depth of 450mm below the existing grade. If the sides of the stump hole still have greater than approximately 20% wood visible, continue grinding operation deeper and or wider until the resulting hole has less than 20% wood.

Remove all wood chips produced by the grinding operation and back fill in 200mm layers with controlled fill of a quality acceptable to the site engineer for fill material under structures, compacted to 95% of the maximum dry density standard proctor. Project Arborist shall approve each hole at the end of the grinding operation.

In areas where the tree location is to be a planting bed or lawn, remove all woodchips and backfill stump holes with planting soil as defined in Specification Section Planting Soil, in maximum of 300mm layers and compact to 80 - 85% of the maximum dry density standard proctor.

Using a commercial, high-powered vacuum truck if required, remove the soil from the excavation produced by the Air Knife excavation. The vacuum truck should generally operate simultaneously with the hose operator, such that the soil produced is picked up from the excavation hole, and the exposed roots can be observed and not damaged by the ongoing operation. Do not drive the vacuum truck into the Tree and Plant Protection Area unless the area is protected from compaction as approved in advance by the Owner's Representative.

Remove all excavated soil and excavated Wood Chips, and contaminated soil at the end of the excavation.

Schedule the work so that foundations or utility work is completed immediately after the excavation. Do not let the roots dry out. Mist the roots several times during the day. If the excavated area must remain open overnight, mist the roots and cover the excavation with

black plastic.

Dispose of all soil in a manner that meets local laws and regulations.

Restore soil within the trench as soon as the work is completed. Utilize soil of similar texture to the removed soil and lightly compact with hand tools. Leave soil mounded over the trench to a height of approximately 10% of the trench depth to account for settlement.

Restore any Geogrids, Filter Fabric, Wood Chips or Mulch and or matting that was previously required for the area

Tree 19 (*Melia azedarach* White Cedar) is a tree in fair condition Appendix 1 (In Tree Impact Report) gives a description of the tree as per AS-4970-2009 Section 2. Appendix 2 (Tree Impact Report) shows a photograph of the tree; Appendix 4 (tree Impact Report) indicates the location of the tree on a survey plan of the site.

The tree will be severely affected by the proposed development works (See Appendix 1 Tree Impact Report). The hydrological and soil environments of the tree will be heavily impacted. The TPZ of the tree will have an unacceptable incursion of 50% from the proposed development works. The tree will require removal as part of the proposed development

Do not fell the tree with a single cut unless the tree will fall in an area not included in the Tree and Plant Protection Area. No tree to be removed within 15m of the Tree and Plant Protection Area shall be pushed over or up-rooted using a piece of grading equipment

Protect adjacent paving, soil, trees, shrubs, ground cover plantings and understory plants to remain from damage during all tree removal operations, and from construction operations. Protection shall include the root system, trunk, limbs, and crown from breakage or scarring, and the soil from compaction.

Remove stumps and immediate root plate from existing trees to be removed. Grind trunk bases and large buttress roots to a depth of the largest buttress root or at least 200mm below the top most roots whichever is less and over the area of three times the diameter of the trunk (DBH).

For trees where the stump will fall under new paved areas, grind roots to a total depth of 450mm below the existing grade. If the sides of the stump hole still have greater than approximately 20% wood visible, continue grinding operation deeper and or wider until the resulting hole has less than 20% wood.

Remove all wood chips produced by the grinding operation and back fill in 200mm layers with controlled fill of a quality acceptable to the site engineer for fill material under structures, compacted to 95% of the maximum dry density standard proctor. Project Arborist shall approve each hole at the end of the grinding operation.

In areas where the tree location is to be a planting bed or lawn, remove all woodchips and backfill stump holes with planting soil as defined in Specification Section Planting Soil, in maximum of 300mm layers and compact to 80 - 85% of the maximum dry density standard proctor.

Using a commercial, high-powered vacuum truck if required, remove the soil from the excavation produced by the Air Knife excavation. The vacuum truck should generally operate simultaneously with the hose operator, such that the soil produced is picked up from the excavation hole, and the exposed roots can be observed and not damaged by the ongoing operation. Do not drive the vacuum truck into the Tree and Plant Protection Area unless the area is protected from compaction as approved in advance by the Owner's Representative.

Remove all excavated soil and excavated Wood Chips, and contaminated soil at the end of the excavation.

Schedule the work so that foundations or utility work is completed immediately after the excavation. Do not let the roots dry out. Mist the roots several times during the day. If the excavated area must remain open overnight, mist the roots and cover the excavation with

black plastic.

Dispose of all soil in a manner that meets local laws and regulations.

Restore soil within the trench as soon as the work is completed. Utilize soil of similar texture to the removed soil and lightly compact with hand tools. Leave soil mounded over the trench to a height of approximately 10% of the trench depth to account for settlement.

Restore any Geogrids, Filter Fabric, Wood Chips or Mulch and or matting that was previously required for the area

Tree 20 (*Melaleuca bracteata* Revolution Green) is a tree in fair condition Appendix 1 (In Tree Impact Report) gives a description of the tree as per AS-4970-2009 Section 2. Appendix 2 (Tree Impact Report) shows a photograph of the tree; Appendix 4 (tree Impact Report) indicates the location of the tree on a survey plan of the site.

The tree will be severely affected by the proposed development works (See Appendix 1 Tree Impact Report). The hydrological and soil environments of the tree will be heavily impacted. The TPZ of the tree will have an unacceptable incursion of 50% from the proposed development works. The tree will require removal as part of the proposed development

Do not fell the tree with a single cut unless the tree will fall in an area not included in the Tree and Plant Protection Area. No tree to be removed within 15m of the Tree and Plant Protection Area shall be pushed over or up-rooted using a piece of grading equipment

Protect adjacent paving, soil, trees, shrubs, ground cover plantings and understory plants to remain from damage during all tree removal operations, and from construction operations. Protection shall include the root system, trunk, limbs, and crown from breakage or scarring, and the soil from compaction.

Remove stumps and immediate root plate from existing trees to be removed. Grind trunk bases and large buttress roots to a depth of the largest buttress root or at least 200mm below the top most roots whichever is less and over the area of three times the diameter of the trunk (DBH).

For trees where the stump will fall under new paved areas, grind roots to a total depth of 450mm below the existing grade. If the sides of the stump hole still have greater than approximately 20% wood visible, continue grinding operation deeper and or wider until the resulting hole has less than 20% wood.

Remove all wood chips produced by the grinding operation and back fill in 200mm layers with controlled fill of a quality acceptable to the site engineer for fill material under structures, compacted to 95% of the maximum dry density standard proctor. Project Arborist shall approve each hole at the end of the grinding operation.

In areas where the tree location is to be a planting bed or lawn, remove all woodchips and backfill stump holes with planting soil as defined in Specification Section Planting Soil, in maximum of 300mm layers and compact to 80 - 85% of the maximum dry density standard proctor.

Using a commercial, high-powered vacuum truck if required, remove the soil from the excavation produced by the Air Knife excavation. The vacuum truck should generally operate simultaneously with the hose operator, such that the soil produced is picked up from the excavation hole, and the exposed roots can be observed and not damaged by the ongoing operation. Do not drive the vacuum truck into the Tree and Plant Protection Area unless the area is protected from compaction as approved in advance by the Owner's Representative.

Remove all excavated soil and excavated Wood Chips, and contaminated soil at the end of the excavation.

Schedule the work so that foundations or utility work is completed immediately after the excavation. Do not let the roots dry out. Mist the roots several times during the day. If the excavated area must remain open overnight, mist the roots and cover the excavation with

black plastic.

Dispose of all soil in a manner that meets local laws and regulations.

Restore soil within the trench as soon as the work is completed. Utilize soil of similar texture to the removed soil and lightly compact with hand tools. Leave soil mounded over the trench to a height of approximately 10% of the trench depth to account for settlement.

Restore any Geogrids, Filter Fabric, Wood Chips or Mulch and or matting that was previously required for the area

Tree 21 (*Liquidambar styraciflua* Liquidamber) is a tree in fair condition Appendix 1 (In Tree Impact Report) gives a description of the tree as per AS-4970-2009 Section 2. Appendix 2 (Tree Impact Report) shows a photograph of the tree; Appendix 4 (tree Impact Report) indicates the location of the tree on a survey plan of the site.

The tree will be severely affected by the proposed development works (See Appendix 1 Tree Impact Report). The hydrological and soil environments of the tree will be heavily impacted. The TPZ of the tree will have an unacceptable incursion of 50% from the proposed development works. The tree will require removal as part of the proposed development

Do not fell the tree with a single cut unless the tree will fall in an area not included in the Tree and Plant Protection Area. No tree to be removed within 15m of the Tree and Plant Protection Area shall be pushed over or up-rooted using a piece of grading equipment

Protect adjacent paving, soil, trees, shrubs, ground cover plantings and understory plants to remain from damage during all tree removal operations, and from construction operations. Protection shall include the root system, trunk, limbs, and crown from breakage or scarring, and the soil from compaction.

Remove stumps and immediate root plate from existing trees to be removed. Grind trunk bases and large buttress roots to a depth of the largest buttress root or at least 200mm below the top most roots whichever is less and over the area of three times the diameter of the trunk (DBH).

For trees where the stump will fall under new paved areas, grind roots to a total depth of 450mm below the existing grade. If the sides of the stump hole still have greater than approximately 20% wood visible, continue grinding operation deeper and or wider until the resulting hole has less than 20% wood.

Remove all wood chips produced by the grinding operation and back fill in 200mm layers with controlled fill of a quality acceptable to the site engineer for fill material under structures, compacted to 95% of the maximum dry density standard proctor. Project Arborist shall approve each hole at the end of the grinding operation.

In areas where the tree location is to be a planting bed or lawn, remove all woodchips and backfill stump holes with planting soil as defined in Specification Section Planting Soil, in maximum of 300mm layers and compact to 80 - 85% of the maximum dry density standard proctor.

Using a commercial, high-powered vacuum truck if required, remove the soil from the excavation produced by the Air Knife excavation. The vacuum truck should generally operate simultaneously with the hose operator, such that the soil produced is picked up from the excavation hole, and the exposed roots can be observed and not damaged by the ongoing operation. Do not drive the vacuum truck into the Tree and Plant Protection Area unless the area is protected from compaction as approved in advance by the Owner's Representative.

Remove all excavated soil and excavated Wood Chips, and contaminated soil at the end of the excavation.

Schedule the work so that foundations or utility work is completed immediately after the excavation. Do not let the roots dry out. Mist the roots several times during the day. If the excavated area must remain open overnight, mist the roots and cover the excavation with

black plastic.

Dispose of all soil in a manner that meets local laws and regulations.

Restore soil within the trench as soon as the work is completed. Utilize soil of similar texture to the removed soil and lightly compact with hand tools. Leave soil mounded over the trench to a height of approximately 10% of the trench depth to account for settlement.

Restore any Geogrids, Filter Fabric, Wood Chips or Mulch and or matting that was previously required for the area

Tree 22 (*Archontophoenix cunninghamiana* Bangalow Palm) is a tree in fair condition Appendix 1 (In Tree Impact Report) gives a description of the tree as per AS-4970-2009 Section 2. Appendix 2 (Tree Impact Report) shows a photograph of the tree; Appendix 4 (tree Impact Report) indicates the location of the tree on a survey plan of the site.

The tree will be severely affected by the proposed development works (See Appendix 1 Tree Impact Report). The hydrological and soil environments of the tree will be heavily impacted. The TPZ of the tree will have an unacceptable incursion of 50% from the proposed development works. The tree will require removal as part of the proposed development

Do not fell the tree with a single cut unless the tree will fall in an area not included in the Tree and Plant Protection Area. No tree to be removed within 15m of the Tree and Plant Protection Area shall be pushed over or up-rooted using a piece of grading equipment

Protect adjacent paving, soil, trees, shrubs, ground cover plantings and understory plants to remain from damage during all tree removal operations, and from construction operations. Protection shall include the root system, trunk, limbs, and crown from breakage or scarring, and the soil from compaction.

Remove stumps and immediate root plate from existing trees to be removed. Grind trunk bases and large buttress roots to a depth of the largest buttress root or at least 200mm below the top most roots whichever is less and over the area of three times the diameter of the trunk (DBH).

For trees where the stump will fall under new paved areas, grind roots to a total depth of 450mm below the existing grade. If the sides of the stump hole still have greater than approximately 20% wood visible, continue grinding operation deeper and or wider until the resulting hole has less than 20% wood.

Remove all wood chips produced by the grinding operation and back fill in 200mm layers with controlled fill of a quality acceptable to the site engineer for fill material under structures, compacted to 95% of the maximum dry density standard proctor. Project Arborist shall approve each hole at the end of the grinding operation.

In areas where the tree location is to be a planting bed or lawn, remove all woodchips and backfill stump holes with planting soil as defined in Specification Section Planting Soil, in maximum of 300mm layers and compact to 80 - 85% of the maximum dry density standard proctor.

Using a commercial, high-powered vacuum truck if required, remove the soil from the excavation produced by the Air Knife excavation. The vacuum truck should generally operate simultaneously with the hose operator, such that the soil produced is picked up from the excavation hole, and the exposed roots can be observed and not damaged by the ongoing operation. Do not drive the vacuum truck into the Tree and Plant Protection Area unless the area is protected from compaction as approved in advance by the Owner's Representative.

Remove all excavated soil and excavated Wood Chips, and contaminated soil at the end of the excavation.

Schedule the work so that foundations or utility work is completed immediately after the excavation. Do not let the roots dry out. Mist the roots several times during the day. If the excavated area must remain open overnight, mist the roots and cover the excavation with

black plastic.

Dispose of all soil in a manner that meets local laws and regulations.

Restore soil within the trench as soon as the work is completed. Utilize soil of similar texture to the removed soil and lightly compact with hand tools. Leave soil mounded over the trench to a height of approximately 10% of the trench depth to account for settlement.

Restore any Geogrids, Filter Fabric, Wood Chips or Mulch and or matting that was previously required for the area

Tree 23 (*Eucalyptus nicholii* Small Leaved Peppermint) is a tree in fair condition Appendix 1 (In Tree Impact Report) gives a description of the tree as per AS-4970-2009 Section 2. Appendix 2 (Tree Impact Report) shows a photograph of the tree; Appendix 4 (tree Impact Report) indicates the location of the tree on a survey plan of the site.

The tree will be severely affected by the proposed development works (See Appendix 1 Tree Impact Report). The hydrological and soil environments of the tree will be heavily impacted. The TPZ of the tree will have an unacceptable incursion of 50% from the proposed development works. The tree will require removal as part of the proposed development

Do not fell the tree with a single cut unless the tree will fall in an area not included in the Tree and Plant Protection Area. No tree to be removed within 15m of the Tree and Plant Protection Area shall be pushed over or up-rooted using a piece of grading equipment

Protect adjacent paving, soil, trees, shrubs, ground cover plantings and understory plants to remain from damage during all tree removal operations, and from construction operations. Protection shall include the root system, trunk, limbs, and crown from breakage or scarring, and the soil from compaction.

Remove stumps and immediate root plate from existing trees to be removed. Grind trunk bases and large buttress roots to a depth of the largest buttress root or at least 200mm below the top most roots whichever is less and over the area of three times the diameter of the trunk (DBH).

For trees where the stump will fall under new paved areas, grind roots to a total depth of 450mm below the existing grade. If the sides of the stump hole still have greater than approximately 20% wood visible, continue grinding operation deeper and or wider until the resulting hole has less than 20% wood.

Remove all wood chips produced by the grinding operation and back fill in 200mm layers with controlled fill of a quality acceptable to the site engineer for fill material under structures, compacted to 95% of the maximum dry density standard proctor. Project Arborist shall approve each hole at the end of the grinding operation.

In areas where the tree location is to be a planting bed or lawn, remove all woodchips and backfill stump holes with planting soil as defined in Specification Section Planting Soil, in maximum of 300mm layers and compact to 80 - 85% of the maximum dry density standard proctor.

Using a commercial, high-powered vacuum truck if required, remove the soil from the excavation produced by the Air Knife excavation. The vacuum truck should generally operate simultaneously with the hose operator, such that the soil produced is picked up from the excavation hole, and the exposed roots can be observed and not damaged by the ongoing operation. Do not drive the vacuum truck into the Tree and Plant Protection Area unless the area is protected from compaction as approved in advance by the Owner's Representative.

Remove all excavated soil and excavated Wood Chips, and contaminated soil at the end of the excavation.

Schedule the work so that foundations or utility work is completed immediately after the excavation. Do not let the roots dry out. Mist the roots several times during the day. If the excavated area must remain open overnight, mist the roots and cover the excavation with

black plastic.

Dispose of all soil in a manner that meets local laws and regulations.

Restore soil within the trench as soon as the work is completed. Utilize soil of similar texture to the removed soil and lightly compact with hand tools. Leave soil mounded over the trench to a height of approximately 10% of the trench depth to account for settlement.

Restore any Geogrids, Filter Fabric, Wood Chips or Mulch and or matting that was previously required for the area

Tree 24 (*Callistemon viminalis* Weeping Bottlebrush) is a tree in fair condition Appendix 1 (In Tree Impact Report) gives a description of the tree as per AS-4970-2009 Section 2. Appendix 2 (Tree Impact Report) shows a photograph of the tree; Appendix 4 (tree Impact Report) indicates the location of the tree on a survey plan of the site.

The tree will be severely affected by the proposed development works (See Appendix 1 Tree Impact Report). The hydrological and soil environments of the tree will be heavily impacted. The TPZ of the tree will have an unacceptable incursion of 50% from the proposed development works. The tree will require removal as part of the proposed development

Do not fell the tree with a single cut unless the tree will fall in an area not included in the Tree and Plant Protection Area. No tree to be removed within 15m of the Tree and Plant Protection Area shall be pushed over or up-rooted using a piece of grading equipment

Protect adjacent paving, soil, trees, shrubs, ground cover plantings and understory plants to remain from damage during all tree removal operations, and from construction operations. Protection shall include the root system, trunk, limbs, and crown from breakage or scarring, and the soil from compaction.

Remove stumps and immediate root plate from existing trees to be removed. Grind trunk bases and large buttress roots to a depth of the largest buttress root or at least 200mm below the top most roots whichever is less and over the area of three times the diameter of the trunk (DBH).

For trees where the stump will fall under new paved areas, grind roots to a total depth of 450mm below the existing grade. If the sides of the stump hole still have greater than approximately 20% wood visible, continue grinding operation deeper and or wider until the resulting hole has less than 20% wood.

Remove all wood chips produced by the grinding operation and back fill in 200mm layers with controlled fill of a quality acceptable to the site engineer for fill material under structures, compacted to 95% of the maximum dry density standard proctor. Project Arborist shall approve each hole at the end of the grinding operation.

In areas where the tree location is to be a planting bed or lawn, remove all woodchips and backfill stump holes with planting soil as defined in Specification Section Planting Soil, in maximum of 300mm layers and compact to 80 - 85% of the maximum dry density standard proctor.

Using a commercial, high-powered vacuum truck if required, remove the soil from the excavation produced by the Air Knife excavation. The vacuum truck should generally operate simultaneously with the hose operator, such that the soil produced is picked up from the excavation hole, and the exposed roots can be observed and not damaged by the ongoing operation. Do not drive the vacuum truck into the Tree and Plant Protection Area unless the area is protected from compaction as approved in advance by the Owner's Representative.

Remove all excavated soil and excavated Wood Chips, and contaminated soil at the end of the excavation.

Schedule the work so that foundations or utility work is completed immediately after the excavation. Do not let the roots dry out. Mist the roots several times during the day. If the excavated area must remain open overnight, mist the roots and cover the excavation with

black plastic.

Dispose of all soil in a manner that meets local laws and regulations.

Restore soil within the trench as soon as the work is completed. Utilize soil of similar texture to the removed soil and lightly compact with hand tools. Leave soil mounded over the trench to a height of approximately 10% of the trench depth to account for settlement.

Restore any Geogrids, Filter Fabric, Wood Chips or Mulch and or matting that was previously required for the area

Tree 25 (*Jacaranda mimosifolia* Jacaranda) is a tree in fair condition Appendix 1 (In Tree Impact Report) gives a description of the tree as per AS-4970-2009 Section 2. Appendix 2 (Tree Impact Report) shows a photograph of the tree; Appendix 4 (tree Impact Report) indicates the location of the tree on a survey plan of the site.

The tree will be severely affected by the proposed development works (See Appendix 1 Tree Impact Report). The hydrological and soil environments of the tree will be heavily impacted. The TPZ of the tree will have an unacceptable incursion of 50% from the proposed development works. The tree will require removal as part of the proposed development

Do not fell the tree with a single cut unless the tree will fall in an area not included in the Tree and Plant Protection Area. No tree to be removed within 15m of the Tree and Plant Protection Area shall be pushed over or up-rooted using a piece of grading equipment

Protect adjacent paving, soil, trees, shrubs, ground cover plantings and understory plants to remain from damage during all tree removal operations, and from construction operations. Protection shall include the root system, trunk, limbs, and crown from breakage or scarring, and the soil from compaction.

Remove stumps and immediate root plate from existing trees to be removed. Grind trunk bases and large buttress roots to a depth of the largest buttress root or at least 200mm below the top most roots whichever is less and over the area of three times the diameter of the trunk (DBH).

For trees where the stump will fall under new paved areas, grind roots to a total depth of 450mm below the existing grade. If the sides of the stump hole still have greater than approximately 20% wood visible, continue grinding operation deeper and or wider until the resulting hole has less than 20% wood.

Remove all wood chips produced by the grinding operation and back fill in 200mm layers with controlled fill of a quality acceptable to the site engineer for fill material under structures, compacted to 95% of the maximum dry density standard proctor. Project Arborist shall approve each hole at the end of the grinding operation.

In areas where the tree location is to be a planting bed or lawn, remove all woodchips and backfill stump holes with planting soil as defined in Specification Section Planting Soil, in maximum of 300mm layers and compact to 80 - 85% of the maximum dry density standard proctor.

Using a commercial, high-powered vacuum truck if required, remove the soil from the excavation produced by the Air Knife excavation. The vacuum truck should generally operate simultaneously with the hose operator, such that the soil produced is picked up from the excavation hole, and the exposed roots can be observed and not damaged by the ongoing operation. Do not drive the vacuum truck into the Tree and Plant Protection Area unless the area is protected from compaction as approved in advance by the Owner's Representative.

Remove all excavated soil and excavated Wood Chips, and contaminated soil at the end of the excavation.

Schedule the work so that foundations or utility work is completed immediately after the excavation. Do not let the roots dry out. Mist the roots several times during the day. If the excavated area must remain open overnight, mist the roots and cover the excavation with

black plastic.

Dispose of all soil in a manner that meets local laws and regulations.

Restore soil within the trench as soon as the work is completed. Utilize soil of similar texture to the removed soil and lightly compact with hand tools. Leave soil mounded over the trench to a height of approximately 10% of the trench depth to account for settlement.

Restore any Geogrids, Filter Fabric, Wood Chips or Mulch and or matting that was previously required for the area

Tree 26 (*Harpephyllum caffrum* Kaffir Plum) is a tree in fair condition Appendix 1 (In Tree Impact Report) gives a description of the tree as per AS-4970-2009 Section 2. Appendix 2 (Tree Impact Report) shows a photograph of the tree; Appendix 4 (tree Impact Report) indicates the location of the tree on a survey plan of the site.

The tree will be severely affected by the proposed development works (See Appendix 1 Tree Impact Report). The hydrological and soil environments of the tree will be heavily impacted. The TPZ of the tree will have an unacceptable incursion of 50% from the proposed development works. The tree will require removal as part of the proposed development

Do not fell the tree with a single cut unless the tree will fall in an area not included in the Tree and Plant Protection Area. No tree to be removed within 15m of the Tree and Plant Protection Area shall be pushed over or up-rooted using a piece of grading equipment

Protect adjacent paving, soil, trees, shrubs, ground cover plantings and understory plants to remain from damage during all tree removal operations, and from construction operations. Protection shall include the root system, trunk, limbs, and crown from breakage or scarring, and the soil from compaction.

Remove stumps and immediate root plate from existing trees to be removed. Grind trunk bases and large buttress roots to a depth of the largest buttress root or at least 200mm below the top most roots whichever is less and over the area of three times the diameter of the trunk (DBH).

For trees where the stump will fall under new paved areas, grind roots to a total depth of 450mm below the existing grade. If the sides of the stump hole still have greater than approximately 20% wood visible, continue grinding operation deeper and or wider until the resulting hole has less than 20% wood.

Remove all wood chips produced by the grinding operation and back fill in 200mm layers with controlled fill of a quality acceptable to the site engineer for fill material under structures, compacted to 95% of the maximum dry density standard proctor. Project Arborist shall approve each hole at the end of the grinding operation.

In areas where the tree location is to be a planting bed or lawn, remove all woodchips and backfill stump holes with planting soil as defined in Specification Section Planting Soil, in maximum of 300mm layers and compact to 80 - 85% of the maximum dry density standard proctor.

Using a commercial, high-powered vacuum truck if required, remove the soil from the excavation produced by the Air Knife excavation. The vacuum truck should generally operate simultaneously with the hose operator, such that the soil produced is picked up from the excavation hole, and the exposed roots can be observed and not damaged by the ongoing operation. Do not drive the vacuum truck into the Tree and Plant Protection Area unless the area is protected from compaction as approved in advance by the Owner's Representative.

Remove all excavated soil and excavated Wood Chips, and contaminated soil at the end of the excavation.

Schedule the work so that foundations or utility work is completed immediately after the excavation. Do not let the roots dry out. Mist the roots several times during the day. If the excavated area must remain open overnight, mist the roots and cover the excavation with

black plastic.

Dispose of all soil in a manner that meets local laws and regulations.

Restore soil within the trench as soon as the work is completed. Utilize soil of similar texture to the removed soil and lightly compact with hand tools. Leave soil mounded over the trench to a height of approximately 10% of the trench depth to account for settlement.

Restore any Geogrids, Filter Fabric, Wood Chips or Mulch and or matting that was previously required for the area

Tree 27 (*Grevillea robusta* Silky Oak) is a tree in fair condition Appendix 1 (In Tree Impact Report) gives a description of the tree as per AS-4970-2009 Section 2. Appendix 2 (Tree Impact Report) shows a photograph of the tree; Appendix 4 (tree Impact Report) indicates the location of the tree on a survey plan of the site.

The tree will be severely affected by the proposed development works (See Appendix 1 Tree Impact Report). The hydrological and soil environments of the tree will be heavily impacted. The TPZ of the tree will have an unacceptable incursion of 50% from the proposed development works. The tree will require removal as part of the proposed development

Do not fell the tree with a single cut unless the tree will fall in an area not included in the Tree and Plant Protection Area. No tree to be removed within 15m of the Tree and Plant Protection Area shall be pushed over or up-rooted using a piece of grading equipment

Protect adjacent paving, soil, trees, shrubs, ground cover plantings and understory plants to remain from damage during all tree removal operations, and from construction operations. Protection shall include the root system, trunk, limbs, and crown from breakage or scarring, and the soil from compaction.

Remove stumps and immediate root plate from existing trees to be removed. Grind trunk bases and large buttress roots to a depth of the largest buttress root or at least 200mm below the top most roots whichever is less and over the area of three times the diameter of the trunk (DBH).

For trees where the stump will fall under new paved areas, grind roots to a total depth of 450mm below the existing grade. If the sides of the stump hole still have greater than approximately 20% wood visible, continue grinding operation deeper and or wider until the resulting hole has less than 20% wood.

Remove all wood chips produced by the grinding operation and back fill in 200mm layers with controlled fill of a quality acceptable to the site engineer for fill material under structures, compacted to 95% of the maximum dry density standard proctor. Project Arborist shall approve each hole at the end of the grinding operation.

In areas where the tree location is to be a planting bed or lawn, remove all woodchips and backfill stump holes with planting soil as defined in Specification Section Planting Soil, in maximum of 300mm layers and compact to 80 - 85% of the maximum dry density standard proctor.

Using a commercial, high-powered vacuum truck if required, remove the soil from the excavation produced by the Air Knife excavation. The vacuum truck should generally operate simultaneously with the hose operator, such that the soil produced is picked up from the excavation hole, and the exposed roots can be observed and not damaged by the ongoing operation. Do not drive the vacuum truck into the Tree and Plant Protection Area unless the area is protected from compaction as approved in advance by the Owner's Representative.

Remove all excavated soil and excavated Wood Chips, and contaminated soil at the end of the excavation.

Schedule the work so that foundations or utility work is completed immediately after the excavation. Do not let the roots dry out. Mist the roots several times during the day. If the excavated area must remain open overnight, mist the roots and cover the excavation with

black plastic.

Dispose of all soil in a manner that meets local laws and regulations.

Restore soil within the trench as soon as the work is completed. Utilize soil of similar texture to the removed soil and lightly compact with hand tools. Leave soil mounded over the trench to a height of approximately 10% of the trench depth to account for settlement.

Restore any Geogrids, Filter Fabric, Wood Chips or Mulch and or matting that was previously required for the area

Tree 28 (*Morus nigra* Mulberry Tree) is a tree in fair condition Appendix 1 (In Tree Impact Report) gives a description of the tree as per AS-4970-2009 Section 2. Appendix 2 (Tree Impact Report) shows a photograph of the tree; Appendix 4 (tree Impact Report) indicates the location of the tree on a survey plan of the site.

The tree will be severely affected by the proposed development works (See Appendix 1 Tree Impact Report). The hydrological and soil environments of the tree will be heavily impacted. The TPZ of the tree will have an unacceptable incursion of 50% from the proposed development works. The tree will require removal as part of the proposed development

Do not fell the tree with a single cut unless the tree will fall in an area not included in the Tree and Plant Protection Area. No tree to be removed within 15m of the Tree and Plant Protection Area shall be pushed over or up-rooted using a piece of grading equipment

Protect adjacent paving, soil, trees, shrubs, ground cover plantings and understory plants to remain from damage during all tree removal operations, and from construction operations. Protection shall include the root system, trunk, limbs, and crown from breakage or scarring, and the soil from compaction.

Remove stumps and immediate root plate from existing trees to be removed. Grind trunk bases and large buttress roots to a depth of the largest buttress root or at least 200mm below the top most roots whichever is less and over the area of three times the diameter of the trunk (DBH).

For trees where the stump will fall under new paved areas, grind roots to a total depth of 450mm below the existing grade. If the sides of the stump hole still have greater than approximately 20% wood visible, continue grinding operation deeper and or wider until the resulting hole has less than 20% wood.

Remove all wood chips produced by the grinding operation and back fill in 200mm layers with controlled fill of a quality acceptable to the site engineer for fill material under structures, compacted to 95% of the maximum dry density standard proctor. Project Arborist shall approve each hole at the end of the grinding operation.

In areas where the tree location is to be a planting bed or lawn, remove all woodchips and backfill stump holes with planting soil as defined in Specification Section Planting Soil, in maximum of 300mm layers and compact to 80 - 85% of the maximum dry density standard proctor.

Using a commercial, high-powered vacuum truck if required, remove the soil from the excavation produced by the Air Knife excavation. The vacuum truck should generally operate simultaneously with the hose operator, such that the soil produced is picked up from the excavation hole, and the exposed roots can be observed and not damaged by the ongoing operation. Do not drive the vacuum truck into the Tree and Plant Protection Area unless the area is protected from compaction as approved in advance by the Owner's Representative.

Remove all excavated soil and excavated Wood Chips, and contaminated soil at the end of the excavation.

Schedule the work so that foundations or utility work is completed immediately after the excavation. Do not let the roots dry out. Mist the roots several times during the day. If the excavated area must remain open overnight, mist the roots and cover the excavation with

black plastic.

Dispose of all soil in a manner that meets local laws and regulations.

Restore soil within the trench as soon as the work is completed. Utilize soil of similar texture to the removed soil and lightly compact with hand tools. Leave soil mounded over the trench to a height of approximately 10% of the trench depth to account for settlement.

Restore any Geogrids, Filter Fabric, Wood Chips or Mulch and or matting that was previously required for the area

Appendix 8 - Bibliography / References

Chapman G and Murphy C Soil (1989) Landscapes of NSW, Soil Conservation Service of NSW

Institute of Australian Consulting Arborists (2008) Dictionary of Terminology Management of Trees in Urban Environments.

Barrell, J. (1993-95) 'Pre-planning Tree Surveys: Safe Useful Life Expectancy (SULE) is the Natural Progression' *Arboricultural Journal* Vol. 17, PP 33-46, Academic Publishers, Great Britain.

Carolyn, R.C. (1994), *Flora of the Sydney Region*, Reed

Costermans L.F. (Leon F.) (1994). *Native Trees and Shrubs of south-eastern Australia* Rev. ed. Landsdowne Publishing Pty Ltd

Harris, R.W., Clark, J.R., Matheny, N.P., (2004) *Arboriculture – Integrated Management of Landscape Trees, Shrubs, and Vines*, Fourth Edition, Prentice Hall

Mattheck C, Breloer, H (2004) *The Body Language of Trees. A Handbook for Failure Analysis. Research for Amenity Trees No. 4.* The Stationary Shop.

NSW TAFE Commission (1994) *Tree Care & Maintenance*, print West Pile,

Tony, (2000), *Sydney Gardening by Suburb*, Murdoch Books Shigo, A.L.

(1986) *a New Tree Biology*, Shigo & Tree Associates

Rolf K 1992a A Review of preventative and loosening measures to alleviate soil compaction in tree planting areas, *Arboricultural Journal* 18:431-88.

Rolf K 1992b Soil physical effects of pneumatic subsoil loosening using a Terralift soil aerator. *Journal of Arboriculture* 18:235-240.

Rolf K 1994 Soil Compaction and Loosening on soil physics and Tree Growth .In the *Landscape Below Ground* G. Watson and D Neely, eds, Savoy, IL: International Society of Arboriculture pp,131-148.

Gross R 1995. Construction applications of hydraulic soil excavation, In *Trees and Building Sites*. G Watson and D Neely, eds, Savoy, IL; International Society of Arboriculture. Pp177-184.

Smiley, T. 1994 The effects of soil aeration equipment on tree growth. In the *Landscape Below Ground*. G Watson and D Neely, eds. Savoy IL; International Society of Arboriculture. pp.207-210.

Day, S, and N .Bassuk 1994. A review of the effects of soil compaction and amelioration treatments of Landscape Trees. *Journal of Arboriculture*, 20:9-17.

Harris R.W 1992. *Arboriculture: Integrated Management of Landscape Trees, Shrubs, and Vines* 2nd Edition Englewood Cliffs NJ: Prentice Hall 674pp

Watson, G. 1991. Attaining root: crown balance in landscape trees. *Journal of Arboriculture* 17:211-216.

Watson, G. 1996. Tree root system enhancement with paclobutrazol. *Journal of Arboriculture*. 22:211-217.


Watson, G. 1996. Replacing soil in the root zone of mature trees for better root growth. *Journal of Arboriculture* 22:167-173

P Svihra, P. 1991 A practical guide for diagnosing root rot in ornamentals. *Journal of Arboriculture*. 12:129-134

Miller, R. 1993 Greenbelt Silverculture. In proceedings of the Sixth National Urban Forestry Conference Washington DC: American Forests pp194-196

Weaver, M and R. Stipes. 1988, White pine decline: A case study from Virginia landscapes, *Journal of Arboriculture*. 14:109-120.

Appendix 9 - Root Management Systems

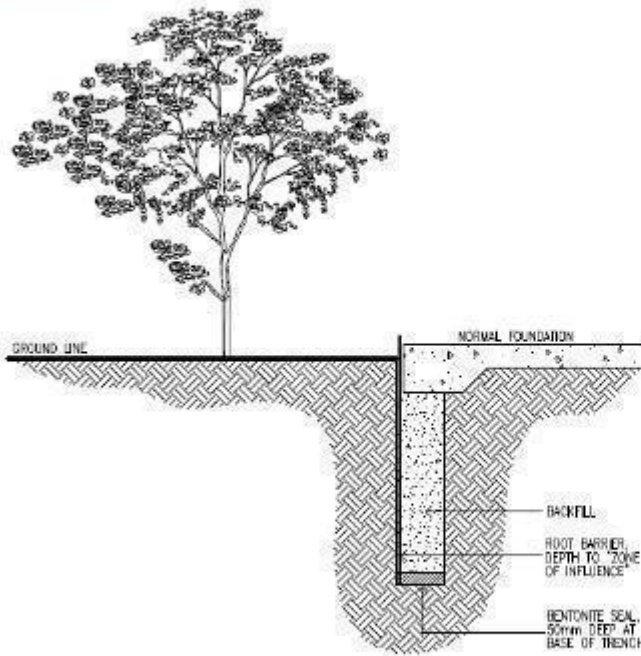

TYPICAL ROOT BARRIER INSTALLATION AS PART OF FOUNDATION

DESIGN & INSTALLATION GUIDELINES

(INCLUDING TYPICAL)

NORMALLY PLACED BETWEEN THE TREE AND WHATEVER YOU WISH TO PROTECT. TRY **NOT** TO SURROUND THE TREE - OUR PREFERRED METHOD IS PLACING THE ROOT BARRIER ALONG BESIDE THE PATH, BUILDING, PIPE ETC SO THAT THE TREE ROOTS CAN NOT GAIN ACCESS TO THE STRUCTURE. TO STABILISE MOISTURE IN REACTIVE CLAYS UNDER THE STRUCTURE A DEEPER BARRIER IS REQUIRED.

DEPTH

DETERMINED "ZONE OF INFLUENCE". NORMALLY 1.5 TO 2 METRES DEEP.

SEAL

SODIUM BENTONITE OR OTHER ROOT GROWTH INHIBITOR IS USED TO SEAL THE BOTTOM OF THE TRENCH AND BIND THE BOTTOM OF THE ROOT BARRIER TO THE UNDISTURBED SOIL. IN SUMMARY, TAKE THE BARRIER DOWN TO SOIL THAT NOTHING CAN GROW IN AND BIND THE ROOT BARRIER TO IT.

LENGTH

SUFFICIENT TO PROTECT THE STRUCTURE FROM THE EFFECTS OF MOISTURE CHANGE IN THE SOIL. BSA GUIDELINES CONSIDER THE FOLLOWING DISTANCES AS REASONABLE. STRUCTURES CLOSER THAN THESE MARGINS TO TREES MUST BE PROTECTED FROM, OR SPECIALLY ENGINEERED TO WITHSTAND THE EFFECT OF THE TREE/S.

HEIGHT OF TREE (h) - DISTANCE FROM HOUSE (d)

d = 1h FOR CLASS "M" & "L" SITES

d = 1.5h FOR CLASS "E" SITES

d = 2h FOR ROWS OR GROUPS OF TREES

INSTALL ROOT BARRIER IN ONE PIECE.

TREE CARE

WORKING IN FROM THE DRIP LINE (THE EDGE OF THE LEAVES) THE CLOSER YOU GET TO THE TRUNK THE HIGHER THE RISK OF DAMAGING OR DESTABILISING THE TREE. 50% OF THE DISTANCE FROM THE DRIP LINE TO THE TRUNK (%20 OF THE TREES TOTAL ROOT PLATFORM) IS REGARDED AS THE CLOSEST YOU CAN CUT WITHOUT MAJOR RISK TO PLANTS HEALTH. IF IT IS NECESSARY TO CUT CLOSER THAN HALFWAY TOWARDS THE TRUNK, IT WOULD BE ADVISABLE TO ENGAGE THE SERVICES OF AN ARBORIST TO ASSESS THE TREE PRIOR TO THE WORK BEING CARRIED OUT, AND TO HELP NURSE THE TREE THROUGH THE PERIOD OF INSTALLATION.

BARRIER PLACEMENT

1. DIG A NARROW TRENCH TO THE REQUIRED DEPTH, INSERT ROOT BARRIER. ENSURE 50mm OF ROOT BARRIER IS LEFT ABOVE FINISHED GROUND HEIGHT (THIS IS TO ALLOW FOR SETTLEMENT AND MAY BE TRIMMED OFF LATER).
2. TRIM EXPOSED TREE ROOTS TO LEAVE A CLEAN CUT, TREAT WITH FUNGICIDE IF REQUIRED.
3. BACK FILL THE BASE OF THE TRENCH PLACING A LAYER OF BENTONITE, THEN BACK FILL WITH FLOWABLE FILL TO GET COMPACTION.
4. BRING ROOT BARRIER UP INSIDE FOUNDATION FORMWORK PRIOR TO POURING SLAB.
5. ROOT BARRIER SHOULD BE TRIMMED TO JUST BELOW DAMP COURSE HEIGHT BUT ABOVE GROUND (TOP OF ROOT BARRIER MUST BE EXPOSED ON COMPLETION).

ROOT BARRIER SUPPLY AND/OR COMPLETE INSTALLATION AVAILABLE. CONTACT ROOT BARRIER, PHONE 1300 136 844. WWW.ROOTBARRIER.COM.AU

THE INFORMATION CONTAINED IN THIS DOCUMENT REFLECTS OUR BEST KNOWLEDGE AT THE TIME OF ISSUE AND IS SUBJECT TO CHANGE WITHOUT NOTICE. NO WARRANTY IS EXPRESSED OR IMPLIED OTHER THAN THAT REQUIRED BY LAW. WE DO NOT UNDERTAKE ANY LIABILITY FOR THE USE OF OUR PRODUCTS AND INFORMATION.

Appendix 10 - Arborist Report Specification

A report by a qualified arborist shall be prepared detailing the position, species, height, trunk diameter and canopy spread of existing trees on or adjacent to the site, and a detailed analysis of the condition and health of these trees. The trees are to be clearly numbered in the report.

The report is to provide a tree location plan which is easily legible, at a suitable scale of not less than 1:200, indicating the trees and tree numbers.

Information is to be provided detailing trees proposed to be removed and trees to be retained in regard to the proposal, full reasons for recommending removal, including development impacts, tree condition, relevant structural testing or other relevant arboricultural analysis supporting the conclusions. Unsubstantiated observations, analysis or opinion is not acceptable.

The report shall also provide an analysis of the impacts of the proposal on existing trees both on the site and adjacent to the site.

The report shall address, the viability of tree retention, and methods by which adverse impacts of the proposal on trees if any may be avoided.

The report shall reference and use the standards and principals as set out in AS4970-2009 Protection of Trees on Development Sites.

1. Arboricultural Impact Assessment Report Specification

Council will require a comprehensive assessment of the impact of the development of trees on the site (and any trees on adjoining private or public land if the proposed development will encroach into the TPZ of those trees).

The report must contain at a minimum:

1. A site address;
2. Author's contact details and qualifications;
3. Statement detailing who (person/s, organisation, company) commissioned the arborist to prepare the report;
4. Date of inspection;
5. Executive summary (for larger reports);
6. Statement outlining the aims of the report;
7. The methodology of investigation techniques used in the research and preparation of the report;
8. Identification of trees by a numerical value that correlates to a site survey plan;

9. A corresponding numbered plan (to scale, with the scale shown) showing all the trees on the site (and trees on adjoining private and public land if the proposed development will encroach into the TPZ of those trees);
- 10 An analysis of the architectural and landscape drawings and description of the proposed development including alterations to existing buildings, services, drainage and driveways, and the proposed building footprint;
- 11 A plan (to scale, with the scale shown) showing all trees to be retained, removed or transplanted (colour coded);
- 12 An accurate, comprehensive assessment of the likely impact of the proposed development on the trees on the site and trees on adjoining private or public land if the proposed development will encroach into the TPZ of those trees.

The assessment must include:

- A. Details of any soil modification
 - B. Discussion of the impact during building construction (hoardings, scaffolding, site and vehicle access etc);
 - C. A discussion of the impact of the proposed buildings, infrastructure and stormwater drainage; and
 - D A discussion of the impact of the landscape modifications on the trees;
13. Recommendations as to design modifications and construction methods to minimise the adverse impact on trees to be retained; and
 14. References used in the preparation of the report.

2. Tree Protection Plans

Council will require site specific tree protection measures to be provided for all trees on the site (and any trees on adjoining private or public land if the proposed development will encroach into the TPZ of those trees). The protection measures must comply with Australian Standard 4970 - 2009 Protection of trees on development sites.

The Tree Protection Plan must contain at a minimum:

1. A site address;
2. Author's contact details and qualifications;
3. Statement detailing who (person/s, organisation, company) commissioned the arborist to prepare the Plan;
4. Statement outlining the aims of the Plan;
5. A plan based on the survey plan (to scale, with the scale shown) showing all the trees on the site to be retained and trees on adjoining private and public land if the proposed development

will encroach into the TPZ of those trees;

6. Details of any pruning required for the proposed development or construction works, and a pruning specification containing the information set out in this Appendix under “Pruning Specification”;
7. Site specific recommendations in accordance with AS 4970- 2009 Protection of trees on development site for tree protection for all trees to be retained. The proposed protection measures must protect the trees throughout the entire development and construction process (Including the demolition and excavation stages);
8. A plan (to scale with the scale shown) showing the TPZ, and location and type of tree protection measures to be installed. The plan must include all trees on the site (and trees on adjoining private and public land if the proposed development will encroach into the TPZ of those trees);

Appendix 11 - Disclaimer

This assessment has been prepared for the exclusive use of the client and Mark Bury Consulting which accepts no responsibility for its use by other persons.

The client acknowledges that this appraisal, and any opinions, advice or recommendations expressed or given in it, are based on the information supplied by the client and on the data inspections, measurements and analysis carried out or obtained by Mark Bury Consulting and referred to in the assessment. The client should rely on the assessment and on its contents, only to that extent.

This assessment was carried out from the ground, and covers what was reasonably able to be assessed and available to this assessor at the time of inspection. No aerial or subterranean inspections were carried out.

This report is to be utilised in its entirety only. Any written or verbal submission, report or presentation that includes statements taken from the findings, discussions conclusions or recommendations made in this report, may only be used where the whole of the original report (or a copy) is referenced in, and directly attached to that submission, report or presentation. This report must be revised for use in the Land and Environment Court and permission sorted from the owner for its use in court.

Care has been taken to obtain information from reliable sources. All data has been verified where possible, however, Mark Bury Consulting can neither guarantee nor be responsible for the accuracy of information provided by others.

Information contained in this report covers only the trees that were examined and reflects the condition of the trees at the time of inspection, furthermore the inspection was limited to a visual examination of the subject trees without dissection, excavation, probing or coring. There is no warranty or guarantee, expressed or implied, that problems or deficiencies of the subject tree may not arise in the future. This report cannot be used in a court of law until it is revised and referenced.